



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

EQ INSURANCE COMPANY LTD

INV No. AC2102640

5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEX
SINGAPORE 069110

INV Date 20/05/2021
Reference CC4/EQI20007820/Db3q2
Code EQI

PROFESSIONAL SERVICE FEE

Vehicle No. SHD 6528P
Insured Veh. GBG 4970M
Claim No. DM20HO01083/JT
Policy No. DMCPHQ19-004347
Accident Date 28/07/2020
Inspection Date 29/07/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
EQ INSURANCE COMPANY LTD 5 MAXWELL ROAD #17-00 TOWER BLOCK MND COMPLEXSINGAPORE 069110			Ref: CC4/EQI20007820/Db3q2 Date: 20/05/2021 Code: EQI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBG 4970M	Veh. Inspected	SHD 6528P	
Policy No.	DMCPHQ19-004347	Coverage (\$)	0.00	
Claim No.	DM20HO01083/JT	Excess (\$)	0.00	
Assign From	JAIME	Assign Date	29/07/2020	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	JTDKB3FU403090315	Colour	BLUE	
Odometer	68368 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	WEST LAKE	5 mm	
L/H Front Tyre	195/65 R15	WEST LAKE	5 mm	
R/H Rear Tyre	195/65 R15	WEST LAKE	5 mm	
L/H Rear Tyre	195/65 R15	WEST LAKE	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	28/07/2020	Inspection Date	29/07/2020	
Survey held at	BIFROST AUTO PTE LTD 8 KAKI BUKIT AVENUE 4 #01-49 PREMIER @ KAKI BUKIT SINGAPORE 415875			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			11 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 6528P

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	TORN / CUT	647.31	647.31
1	REAR BUMPER LOWER COVER	NOT NECESSARY	779.99	-
1	REAR BUMPER SIDE RETAINER	NOT NECESSARY	159.08	-
1	REAR BUMPER CLIPS	NECESSARY	31.05	31.05
2	REAR BUMPER UPPER STOPPER (LH/RH) @\$107.84	NOT NECESSARY	215.68	-
1	SEAL ,REAR BUMPER SIDE ,LH	NO SUCH PARTS	209.47	-
1	REAR BUMPER UNDER SIDE COVER (LH)	NOT NECESSARY	327.47	-
1	ARM SUB-ASSY ,REAR BUMPER ,LH	NO SUCH PARTS	197.05	-
1	TAIL LAMP ASSY (UPPER)	CUT	787.48	787.48
1	TAIL LAMP ASSY (LOWER)	CRACKED	774.07	774.07
1	TAIL LAMP QUARTER PANEL	NOT NECESSARY	304.88	-
1	TAIL LAMP SIDE COVER	NOT NECESSARY	361.34	-
1	REAR TAILLAMP GUIDE -WHITE	NOT NECESSARY	134.52	-
1	REAR FIBER TOOL BOX TRIM (LH)	NOT NECESSARY	844.08	-
1	SPARE TYRE SIDE PANEL (LH)	NOT NECESSARY	277.36	-
1	REAR FENDER ,LH	BUCKLED	1,181.00	1,181.00
1	REAR FENDE INNER PANEL (LH)	NOT NECESSARY	1,027.57	-
1	REAR FENDER OUTER PANEL ,LH	TO REPAIR SEE LABOUR	685.99	-
1	REAR FENDER REINFORCEMENT ,ROCKER PANEL ,LH	NOT NECESSARY	779.57	-
1	REAR FLOOR PANEL SIDE (LH)	NOT NECESSARY	389.86	-
1	REAR FENDER SHIELD (LH)	DEFORMED	245.88	245.88
1	REAR FENDER TRIMBOARD (LH)	NOT NECESSARY	1,023.34	-
1	REAR FENDER AIR DUCT	NOT NECESSARY	233.04	-
1	PANEL SUB-ASSY ,REAR DOOR ,LH	DENTED	1,776.09	1,776.09
1	REAR DOOR HINGE UPPER	NOT NECESSARY	116.17	-
1	REAR DOOR HINGE LOWER	NOT NECESSARY	116.17	-
1	REAR DOOR CHECK	NOT NECESSARY	215.96	-
1	REAR DOOR TRIMBOARD	NOT NECESSARY	1,023.34	-
1	MOTOR ,POWER WINDOW REGULATOR FRT ,LH	NOT NECESSARY	1,329.35	-
1	REGULATOR ,FRONT DOOR WINDOW REAR ,LH	NOT NECESSARY	322.39	-

Report Ref No. CC4/EQI20007820/Db3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR DOOR OUTER HANDLE	CUT	131.27	131.27
1	REAR DOOR OUTER MOULDING	SERVICEABLE	181.52	-
1	PANEL SUB-ASSY ,FRONT DOOR ,LH	DENTED	1,784.14	1,784.14
1	FRONT DOOR OUTER HANDLE (LH)	CUT	534.82	131.27
1	REGULATOR ,FRONT DOOR WINDOW FRT ,LH	NOT NECESSARY	322.39	-
1	MIRROR ASSY ,OUTER REAR VIEW ,LH	BROKEN	2,440.06	1,374.20
1	MOULDING ,REAR DOOR WINDOW ,FRONT LH	SERVICEABLE	97.68	-
1	ROCKER PANEL OUTER GARNISH	BROKEN / CUT	813.02	813.02
1	ROCKER PANEL OUTER	NOT NECESSARY	733.70	-
1	REAR TYRE RIM (LH)	DISTORTED	2,194.88	1,570.55
1	REAR WHEEL HUB CAP (LH)	CUT	250.82	250.82
1	REAR WHEEL BEARING & HUB ASSY	DAMAGED	861.30	493.00
1	REAR CROSS MEMBER	BENT	3,105.86	2,200.40
1	REAR SHOCK ABSORBER	DISTORTED	166.98	166.98
1	REAR SHOCK ABSORBER MOUNTING	NOT NECESSARY	176.86	-
1	REAR LOWER ARM	DISTORTED	702.22	497.50
1	REAR UPPER ARM	DISTORTED	503.62	356.80
1	REAR KNUCKLE ARM	DISTORTED	1,144.16	810.60
1	REAR COIL SPRING	NOT NECESSARY	270.16	-
1	REAR COIL SPRING MOUNTING	NOT NECESSARY	177.43	-
1	REAR BRAKE ABS SENSOR (WIRE)	NOT NECESSARY	393.53	-
1	REAR STABILIZER BAR	NOT NECESSARY	439.68	-
1	REAR STABILIZER LINK	NOT NECESSARY	213.98	-
1	EAR TRAILING ARM	DISTORTED	443.49	443.49
1	REAR ASSIST ARM	DISTORTED	483.02	483.02
1	REAR HEIGHT SENSOR LH ONLY	DAMAGED / BENT	1,114.10	1,114.10
1	REAR BRAKE CALIPER	NOT NECESSARY	1,189.75	-
1	FRONT BUMPER COVER	DISTORTED	705.61	705.61
1	FRONT BUMPER CLIPS	NECESSARY	31.05	31.05
1	FRONT BUMPER SIDE RETAINER	NOT NECESSARY	108.69	-
1	FENDER SUB-ASSY ,FRONT LH	DENTED	1,334.29	977.80
1	FRONT FENDER SHIELD	SERVICEABLE	280.18	-
1	FRONT FENDER SHIELD CLIP	NOT NECESSARY	21.03	-

Report Ref No. CC4/EQI20007820/Db3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT FENDE HYBRID EMBLEM,LH	NECESSARY	122.09	122.09
1	FRONT WHEEL RIM	DISTORTED	2,216.83	1,570.55
1	FRONT WHEEL HUB CAP	CUT	248.14	248.14
1	FRONT WHEEL HUB BEARING	DAMAGED	790.36	560.10
1	FRONT SUSPENSION LOWER ARM(LH)	DISTORTED	891.93	637.50
1	FRONT SHOCK ABSORBER (LH)	NOT NECESSARY	562.06	-
1	ABSORBER TOP MOUNTING	NOT NECESSARY	276.94	-
1	FRONT DRIVE SHAFT (LH)	NOT NECESSARY	2,489.89	-
1	RACK & PINION ASSY	NOT NECESSARY	2,288.46	-
1	BAR ,STABILIZER	NOT NECESSARY	497.41	-
1	LINK ASSY ,FRONT STABILIZER ,LH	NOT NECESSARY	277.78	-
1	KNUCKLE ,STEERING LH	DISTORTED	819.80	476.75
1	JOINT ASSY ,LOWER BALL ,FRONT (LH)	NOT NECESSARY	282.27	-
1	DISC,FRONT	NOT NECESSARY	593.78	-
1	END SUB-ASSY ,TIE ROD ,LH	NOT NECESSARY	224.85	-
1	SENSOR ,SPEED ,FRONT LH	NOT NECESSARY	630.23	-
1	LOCK ASSY FUEL LID (ADDITIONAL)	DAMAGED	496.00	496.00
	LESS 20% DISCOUNT		-10,715.33	-
	LESS 25% DISCOUNT		-	-5,972.41
			42,861.33	17,917.22
1	REAR TYRE (LH) (60%) (DEPRECIATION) (SN)	TORN	304.88	150.00
	LESS 20% DISCOUNT		-60.98	-
			243.90	150.00
	<u>SPECIAL NETT ITEMS</u>			
1	REAR BUMPER REVERSE SENSOR (SN)	NOT NECESSARY	191.54	-
1	REAR DOOR COMFORT & APPS STICKER (SN)	NECESSARY	112.92	112.92
1	FRONT DOOR COMFORT LOGO (SN)	NECESSARY	105.86	105.86
1	FRONT TYRE (LH) (SN)	NOT NECESSARY	304.88	-
			715.20	218.78

Report Ref No. CC4/EQI20007820/Db3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR FENDER OUTER PANEL ,LH.		1,600.00	1,000.00
	SPRAY PAINTING CHARGE.		1,400.00	1,000.00
	WIRING CHARGE.		180.00	30.00
	TUFF KOTE.		160.00	40.00
	TOWING CHARGE.	NOT NECESSARY	80.00	-
	REMOVE /REFIX CUSHION & UPHOLSTERY REAR .		150.00	80.00
	REMOVE/REFIX UNDERCARRIAGE (RR).		400.00	150.00
	TRANSFER OF DOOR MECHANISM FRONT .		80.00	60.00
	RE-SET FRT POWER WINDOW SYSTEM.	NOT NECESSARY	200.00	-
	TRANSFER OF DOOR MECHANISM REAR .		80.00	60.00
	RE-SET REAR POWER WINDOW SYSTEM.	NOT NECESSARY	200.00	-
	FOUR WHEEL ALIGNMENT.		120.00	60.00
	REMOVE/REFIX UNDERCARRIAGE (FRT).		400.00	150.00
	FRONT CHASSIS ALIGNMENT CHARGE.	NOT NECESSARY	220.00	-
	DIAGNOSTIC & RESETTING TO ERASE FAULT CODE.		550.00	280.00
			5,820.00	2,910.00
	GRAND TOTAL		49,640.43	21,196.00
	RECOMMENDED COST OF REPAIRS			21,196.00

Report Ref No. CC4/EQI20007820/Db3q2

ANG BRYAN TANI

Automotive Assessor / Investigator

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 6528P

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

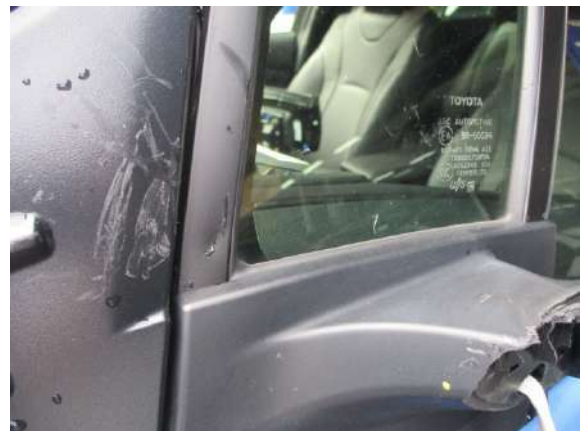



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

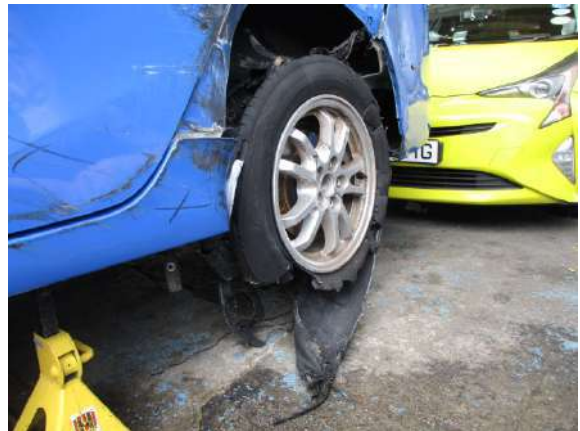



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

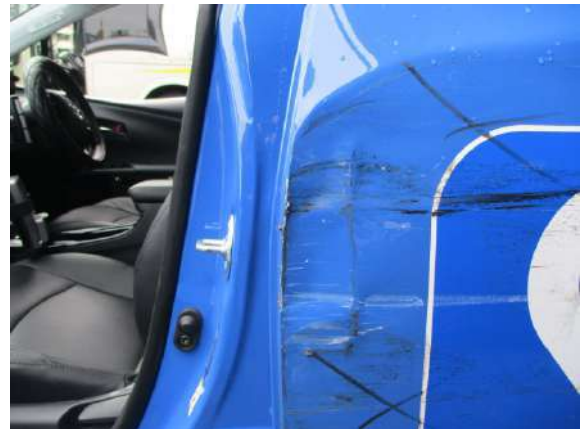



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 6528P

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

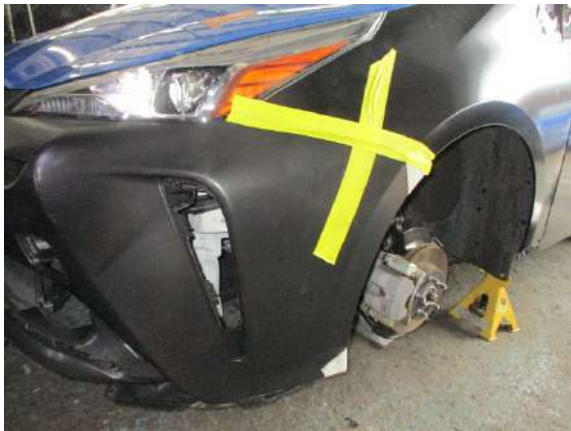



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 6528P

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

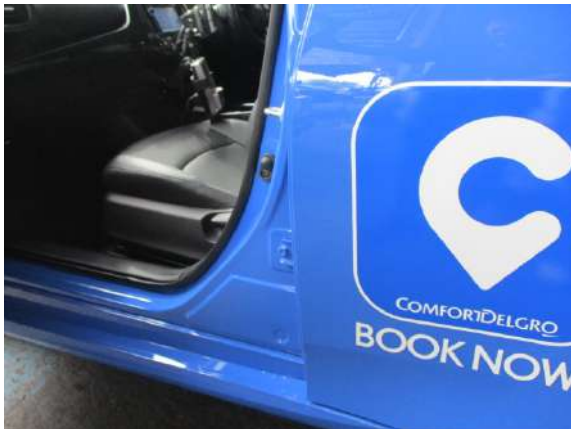



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

