

ASS. REC. BY:

REF:

C12 / 2000 8155 / k/c

C

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

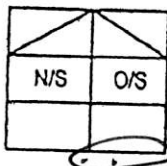
Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 06 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SHC 51506 Yr Regn: 01, 14Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: Renault Latitude c.c. 1995Colour M. White / R A/C: Insured / Std / NI / NASp. Reading 410 755 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: VFIABL15AUC 27 8710Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModl: Nil / S/Rlm / STD A/Rlm orTyre Size: F: 161in 215/60R16R: Giti

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or _____

Front _____ Rear _____

R/Bal. 9 mm R/Bal. 9 mmL/Bal. 9 mm L/Bal. 9 mmD.O.A. 4/8/20 D.O.I. 5/8/2020

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rea O/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

11/8 21.5pm @ 63506

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trlp: _____

Add Fee: ☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech Invs (\$ _____)☐ : Weekend (\$ _____)

Survey Fee: _____

Transportation: _____

S + RS. \$ _____

Fees: _____

Others: _____

TOTAL

Report Format :

Lump Sum / I.B.I. (\$) _____

Not Authored
 61 Sep & 63501

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5150G

AAD2008-022

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration :

05 AUG 2020

SHC 5150G

VF1ABL15AUC276710

RENAULT

LATITUDE

4.8.2020

CHINA TAIPING

14/01/2014

	PART
1	BUMPER COVER REAR
1	BUMPER LOWER REAR
1	BUMPER BRACKET CTR REAR
1	BUMPER BRACKET SIDE RH REAR
1	BUMPER RETAINER RH REAR
1	BUMPER REFLECTOR RH
1	BUMPER BRACKET SIDE LH REAR
1	BUMPER RETAINER LH REAR
1	BUMPER REFLECTOR LH
1	BUMPER BEAM REAR
1	BUMPER BEAM BRACKET LH REAR
1	BUMPER BEAM BRACKET RH REAR
1	BUMPER BLOCK RH REAR
1	BUMPER HARNESS REAR
1	OUTER PANEL REAR (End Panel)
1	OUTER PANEL REAR (End Panel) TRIM
1	TAILLAMP RH
1	TAILLAMP PANEL RH
1	TAILLAMP LH
1	TAILLAMP PANEL LH
1	BOOT REAR
1	BOOT FINISHER
1	BOOT WEATHERSTRIP
1	BOOT REFLECTOR LAMP LH
1	BOOT REFLECTOR LAMP RH
1	BOOT BADGE 'RENAULT'

	LIST	
\$	Buc	561.70 ✓
\$	Sn	411.90 X
\$	Sn	98.10 X
\$	Dir	82.10 ✓
\$	Dir	59.80 ✓
\$	Sn	16.60
\$	Sn	80.80
\$	Sn	54.20
\$	Sn	16.60
\$	R	547.80
\$	R	114.50
\$	R	100.90
\$	Sn	76.50
\$	Sn	301.10
\$	R	745.80
\$	Sn	404.56
\$	Br	401.40 ✓
\$	Br	401.40 ✓
\$	Sn	401.40 X
\$	R	401.40 X
\$	Br	1,677.20 ✓
\$	wap / Dir	344.70 ✓
\$	Cr	178.20 50.80 89.10 Sn
\$	Sn	277.70 X
\$	Br	277.70 ✓
\$	Mr	82.40 ✓

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5150G**AAD2008-022**

- 1 BOOT BADGE
- 1 BOOT STRUT LH
- 1 BOOT TRIM BOARD
- 1 BOOT STRUT RH
- 1 BOOT HINGE LH
- 1 BOOT HINGE RH
- 1 BOOT LOCK
- 2 BOOT RUBBER PLUG
- 2 LICENCE PLATE LAMP
- 1 BOOT SWITCH
- 1 EXHAUST REAR
- 1 REAR RH FENDER PANEL
- 1 WHEELARCH REAR RH
- 1 FENDER PANEL INNER TRIM REAR RH
- 1 SPARE WHEEL PANEL
- 1 SPARE WHEEL PANEL TRIM
- 1 SPARE TYRE BOARD
- 1 CHASSIS PANEL REAR RH
- 1 FENDER PANEL INNER REAR RH L70Y
- 1 FENDER INNER BOARD RH L70Y
- 1 FENDER WHEEL HOUSING PANEL REAR RH

\$	<i>Nr</i>	95.80	✓
\$	<i>SL</i>	145.10	X
\$	<i>SL</i>	611.00	X
\$	<i>SL</i>	145.10	X
\$	<i>R</i>	254.20	X
\$	<i>R</i>	253.80	✓
\$	<i>R</i>	246.60	X
\$	<i>SL</i>	139.30	X
\$	<i>SL</i>	26.30	X
\$	<i>SL</i>	113.00	X
\$	<i>R</i>	5,263.60	X
\$	<i>Bu</i>	1,933.20	✓
\$	<i>SL</i>	275.40	} X
\$	<i>R</i>	671.45	
\$	<i>R</i>	1,229.40	
\$	<i>SL</i>	612.21	
\$	<i>SL</i>	680.90	
\$	<i>R</i>	2,192.40	
\$	<i>R</i>	1,241.60	
\$	<i>SL</i>	561.40	
\$	<i>R</i>	4,682.09	
TOTAL \$		29,490.31	
10% \$		2,949.03	
\$		26,541.28	

Special Nett

- 1SET PARKING AID
- 1SET REAR BUMPER CLIP
- 1SET BUMPER BRACKET CTR CLIP
- 1SET BUMPER BRACKET SIDE CLIP RH RR
- 1SET BUMPER RETAINER RH CLIP RR
- 1SET BUMPER BRACKET SIDE CLIP LH RR
- 1SET BUMPER RETAINER CLIP LH RR
- 1SET BUMPER LOWER REAR RIVET

\$	<i>SL</i>	700.00	X
\$	<i>Nr</i>	75.00	✓
\$	<i>Nr</i>	55.00	} X
\$	<i>Nr</i>	60.00	
\$	<i>Nr</i>	65.00	
\$	<i>Nr</i>	60.00	
\$	<i>Nr</i>	65.00	
\$	<i>Nr</i>	70.00	

Trans-cab Auto Services Pte Ltd**AAD2008-022**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5150G

1SET BUMPER LOWER REAR CLIP

1 BOOT STICKER "Trans-cab"

1 BOOT STICKER "6555-3333"

1SET BOOT FINISHER CLIP

1 TAILLAMP CLIP LH

1 TAILLAMP CLIP RH

1 Rear Bumper Protector

1 REAR LICENCE PLATE WITH HOLDER

1 EXHAUST MOUNTING

1 FENDER INNER TRIM CLIP RH

1SET FENDER WHEELARCH REAR RH CLIP

2 REAR WINDSCREEN SEALANT

1 WINDSCREEN MOULDING

1 REAR WINDSCREEN INNER SPONGE SEAL

2 SEAM SEALANT

1 RENAULT TYRE 215/60/16

1 RENAULT TYRE RIM

1 SPARE TYRE

1SET END PANEL TRIM CLIP

\$	nn	75.00	✓
\$	nn	80.00	305m
\$	nn	80.00	305m
\$	nn	55.00	X
\$	nn	40.00	X
\$	nn	40.00	5.00 ✓
\$	nsp	180.00	X
\$	sn	130.00	X
\$	sn	60.00	X
\$	nn	55.00	X
\$	nn	65.00	X
\$	nn	150.00	405m
\$	nn	200.00	X
\$	nn	130.00	305m
\$	nn	170.00	X
\$	sn	330.00	X
\$	sn	380.00	X
\$	sn	330.00	X
\$	nn	55.00	X
TOTAL	\$	3,755.00	

TOTAL PARTS \$ 30,296.28**LABOUR**

To check steering geometry and computer wheel alignment

\$ nn 220.00 X

To drop rear exhaust box, renew the same, to repair and realign rear and centre exhaust pipe.

\$ nn 380.00 X

To transfer of bootlid fittings, attachments and perform water seepage test.

\$ 170.00 601

Towing Fees

\$ nn 150.00 X

Trans-cab Auto Services Pte Ltd**AAD2008-022**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5150G

To transfer of rear bumper fittings, attachment and perform water seepage test.	\$	<i>nn</i>	170.00	<i>X</i>
To transfer of rear end panel fittings, attachment and perform water seepage test.	\$		380.00	<i>100%</i>
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$		2,800.00	<i>800%</i>
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	<i>nn</i>	380.00	<i>X</i>
To transfer of tire, rim and on wheel balancing.	\$	<i>5</i>	170.00	<i>X</i>
To transfer of rear fender fittings, attachment and perform water seepage test.	\$	<i>5</i>	170.00	<i>X</i>
Labour charge to mount and dismount vehicle on jig bench, to facilitate repair.	\$	<i>5</i>	380.00	<i>X</i>
To transfer of rear windscreen glass to facilitate bodywork repair.	\$		170.00	<i>120%</i>
To Check Electrical Lighting Concerned.	\$		170.00	<i>20%</i>
To Rust-Proofing and apply undercoat Of The Affected Areas.	\$		250.00	<i>60%</i>
To supply and re-do rear luggage floor panel insulation padding.	\$	<i>5</i>	380.00	<i>X</i>
To pull and jack out chassis frame and correct it to symmetrical position with the aid of hydraulic pneumatic jack.	\$	<i>5</i>	380.00	<i>X</i>

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5150G**AAD2008-022**

To transfer of rear luggage floor panel fittings, attachment and perform water seepage test.	\$	380.00	X
Putty and spray painting of the affected portion.	\$	2,800.00	8801
To reinstall rear bumper parking sensor.	\$	170.00	601
TOTAL	\$	10,070.00	
Over All Total	\$	40,366.28	

LUMP SUM (REPAIR DAY)~~25 DAYS~~

6 days

For Official Use

Prepared By : _____
(Accident Dept)

Verify By : _____
(Accident Workshop)

Checked By : _____
(Finance Dept)

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	878K
Vehicle Details	
Vehicle No.:	SHC5150G
Vehicle to be Exported:	Yes
Intended Deregistration Date:	05 Aug 2020
Vehicle Make:	RENAULT
Vehicle Model:	LATITUDE 2.0L DCI AUTO D/AB 4DR
Primary Colour:	Red
Manufacturing Year:	2013
Engine No.:	M9R8839C000834
Chassis No.:	VF1ABL15AUC276710
Maximum Power Output:	127.0 kW (170 bhp)
Open Market Value:	\$19,998.00
Original Registration Date:	14 Jan 2014
First Registration Date:	14 Jan 2014
Transfer Count:	0
Actual ARF Paid:	\$12,498.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	13 Jan 2022
PARF Rebate Amount:	\$8,123.00
Intended COE Rebate Details	
COE Expiry Date:	13 Jan 2022
COE Category:	A - Car (1600cc & below)
COE Period(Years):	8
PQP Paid:	\$60,888.00
COE Rebate Amount:	\$10,945.00
Total Rebate Amount:	\$19,068.00
Message	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 05 Aug 2020

OK