

PRUDENT ADJUSTORS SERVICES

BLOCK 607 ELIAS ROAD # 05-192

SINGAPORE (510607)

BUSINESS REGN. No. 53193457L

Hp 96699986

INVOICE

Mr. Jason Xie Zhi Hao
21 Swiss View
Singapore 288027

Invoice No : PA/20070014/tpw
Our Ref : PA/SKH8154/0420/tpw
Date : 17 July 2020

Claim Type	Third Party	Date of Accident	: 06 April 2020
Vehicle No.	SKH 8154 P	Date of Inspection	: 17 April 2020
No	Description	Amount (S\$)	
1	Survey fees inclusive of Transportation and Photographs (50) copies	\$725.00	
	Total	<u>\$725.00</u>	
Singapore Dollar: Seven Hundred And Twenty-Five Only			
All payments made payable to : Prudent Adjustors Services			


Prudent Adjustors Services
Bok Jee Tan

PRUDENT ADJUSTORS SERVICES

BLOCK 607 ELIAS ROAD # 05-192
SINGAPORE (510607)
BUSINESS REGN. No. 53193457L
Hp 96699986

VEHICLE DAMAGE INSPECTION REPORT

Mr. Jason Xie Zhi Hao
21 Swiss View
Singapore 288027

Our Ref : PA/SKH8154/0420/tpw
Date : 17 July 2020

REFERENCES

Claim Type	: Third Party	Date of Accident	: 06 April 2020
Vehicle No.	: SKH 8154 P	Date of Assignment	: 16 April 2020
Make	: BMW	Date of Inspection	: 17 April 2020
Model	: 3161 1.6 AT D/AB 4DR ABSHD	Date of Re-inspection	: 21 April 2020
Reg. Date	: 18 January 2018	COE Expiry	: 17 January 2023
Color	: Red	Chassis No	: WBA3A12050J719524
Odometer	: 121,608 km	Engine No	: Blocked

TYRE CONDITION

	<u>Front near side</u>	<u>Front off side</u>	<u>Rear near side</u>	<u>Rear off side</u>
Make	Pirelli	Pirelli	Pirelli	Pirelli
Size	225/50-17	225/50-17	225/50-17	225/50-17
Thread Balance	5 mm	5 mm	6 mm	6 mm

GENERAL DESCRIPTION OF DAMAGE (PHOTOGRAPHS ATTACHED)

The vehicle sustained damage at front and rear portion.
Please refer to photographs and assessment of repairs for details
Enclosed (50) photographs depicting damages.

INSPECTION AND ASSESSMENT SUMMARY

Original Quotation : \$17,791.02 Revised Assessment \$13,150.00 Lump sum

Survey conducted at JD Motorsports Pte Ltd

In accordance to your instruction, we have not authorized repairs.

In normal circumstances, repairs to the vehicle would take approximately
Seven (7) days to complete.

This survey was conducted on a "WITHOUT PREJUDICE" basis.

PRUDENT ADJUSTORS SERVICESVehicle No: **SKH 8154 P**

Our Ref: PA/SKH8154/0420/tpw

ADJUSTMENT ON REPAIR COST AND REPLACEMENT OF PARTS

<u>S/N</u>	<u>Description Material</u>	<u>Qty</u>	<u>Condition</u>	<u>Original Quotation</u>	<u>Revised Quotation</u>
1	Headlamp RH - HID	1 pc	Hdr cracked	1,917.60	1,917.60
2	Headlamp control unit RH	1 pc	Necessary	980.00	980.00
3	Headlamp lower bracket RH	1 pc	Bent	250.00	250.00
4	Headlamp nozzle cover RH	1 pc	Serviceable	215.00	~
5	Headlamp nozzle pump RH	1 pc	Serviceable	399.00	~
6	Front grille c/w chrome RH	1 pc	Cracked	420.00	420.00
7	Front bumper	1 pc	Deformed	1,839.60	1,839.60
8	Front bumper side retainer @ \$180/-	2 pcs	Bent	360.00	360.00
9	Front bumper bracket RH	1 pc	Bent	237.60	237.60
10	Front bumper reinforcement	1 pc	Dented	948.00	948.00
11	Front bumper sponge	1 pc	Cracked	510.00	510.00
12	Front bumper lower grille	1 pc	Cracked	450.00	450.00
13	Rear bumper	1 pc	Torn	1,907.35	1,907.35
14	Rear bumper reinforcement	1 pc	Dented	697.00	697.00
15	Rear bumper inner lower garnish	1 pc	Cracked	425.00	425.00
16	Rear bumper reverse sensor @ \$462/-	4 pcs	Malfunction	464.00	464.00
17	Rear lamp RH	1 pc	Cracked	1,848.00	1,848.00
18	Rear lamp side garnish RH	1 pc	Cracked	320.50	320.50
				14,188.65	13,574.65
List price less 5%				709.43	678.73
				13,479.22	12,895.92
<u>Add special nett item</u>					
19	Front bumper emblem	1 pc	Necessary	101.80	101.80
20	Front number plate	1 pc	Dented	60.00	50.00
21	Front bumper clip	10 pcs	Necessary	80.00	70.00
22	Rear bumper clips	10 pcs	Necessary	80.00	70.00
23	Tail lamp clip	2 pcs	Necessary	40.00	30.00
				361.80	321.80

PRUDENT ADJUSTORS SERVICESVehicle No: **SKH 8154 P**

Our Ref: PA/SKH8154/0420/tpw

Labour charges

To check wiring system (Front & Rear)	250.00	200.00
Remove & refit rear bumper sensor	200.00	180.00
Straighten end panel, rear fender & replace	1,500.00	1,200.00
damage parts		
Spray painting charges	1,200.00	1,000.00
Conduct standard post repair diagnostic scan	800.00	650.00
	<u>3,950.00</u>	<u>3,230.00</u>

Total parts & labour concluded	<u>17,791.02</u>	<u>16,447.72</u>
--------------------------------	------------------	------------------

Lump sum repair adjustment		<u>13,150.00</u>
----------------------------	--	-------------------------

The information contained in this document is privileged and confidential and is intended for the exclusive use of the addressee designation. If you are not the addressee; any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this document not meant for you, please contact us immediately to arrange for it to return.



Prudent Adjustors Services
Bok Jee Tan

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC

Owner ID: 269J

Vehicle Details

Vehicle No.: SKH8154P

Vehicle to be Exported: Yes

Intended Deregistration Date: 19 Jun 2020

Vehicle Make: B.M.W.

Vehicle Model: 316I 1.6 AT D/AB 4DR ABS HID

Primary Colour: Red

Manufacturing Year: 2012

Engine No.: B432J362N13B16A

Chassis No.: WBA3A12050J719524

Maximum Power Output: 100.0 kW (134 bhp)

Open Market Value: \$33,146.00

Original Registration Date: 18 Jan 2013

First Registration Date: 18 Jan 2013

Transfer Count: 1

Actual ARF Paid: \$23,146.00

Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 17 Jan 2023

PARF Rebate Amount: \$13,887.00

Intended COE Rebate Details

COE Expiry Date: 17 Jan 2023

COE Category: A - Car (1600cc & below)

COE Period(Years): 10

QP Paid: \$92,100.00

COE Rebate Amount: \$23,742.00

Total Rebate Amount: \$37,629.00

The information contained herein is correct as at 19 Jun 2020

OK


























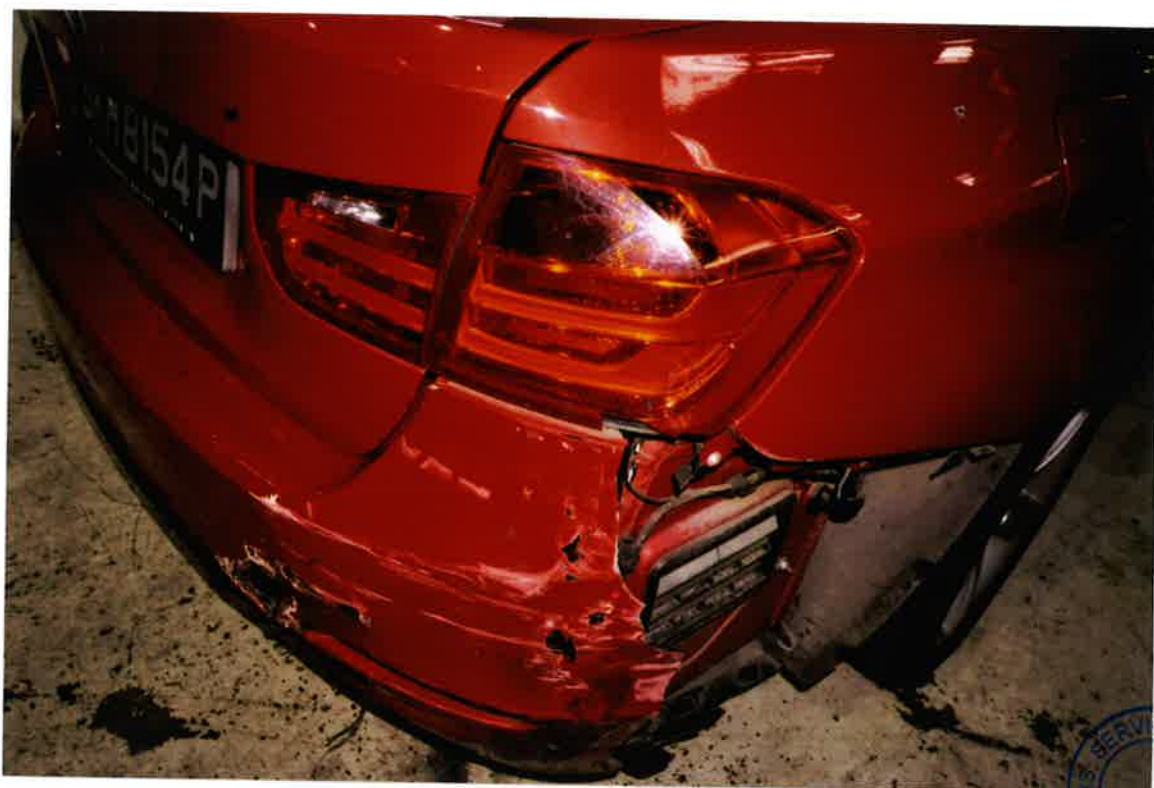











Re-Survey





Re-Survey





Re-Survey





Re-Survey





Re-Survey





Re-Survey





Re-Survey





Re-Survey

