ASSERTED BY: Store | NEF: CS/C7/20008871/EVF3 ASSIGNMENT Veh No: SMIT 877911 Yr Rogn: 14/2 Estimated Cost COLIFINSTIF RESTOD RESTEVATINY IMY Make: Milsudishi Attinge To Inspect Vehicle No: . A/C: at Workshop mv3 T/Radlo: Insured / Std / NI / NA Sp.Rending Eng/No: C/No: Gan. Cond: Good / Fair / Poor / Burnt Claims No. Steering: Inforder / Jammed / Leaked / Burnt or Excess: Brake: In arder / Jammed / Leaked / Burnt or (Client's Record) Modi: NII / \$/Rim / STD A/Rim or Make of Veh: Tyre Size: (Policy Condition) BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / Remark: The veh had commenced its TOYOTYOKO or repair at the time of inspection. Rear Front Bal. or Market Value: Consistent?: Yes or No R/Bal. IDAC Acoldent Roort: L/Bal. L/Bal. Consistent?: Yes or No GIA / PR Seen: D.O.I. D.O.A. Res.: Yes or No days Est Repairs: 3 Val.: Yes or No Lum Sum: Read Y O/S I N/S I U/C I Rooftop or Des. of Damages (Frt 1) CA I REV I REP. I 24 HRS Vehicle: IN/OUT The U/C / Chassis frame / Body Structure affected due to collision. Person Contacted: Date / Time Action / Instruction MV- 53K Days Of Repair: 14 Dale/Time, File Pass W? : Prell. Report Survey Fee: Resurvey No. of Trlp: 2 : Final Report Transportation: Date/Time, File Return to? S + RS __SI Add Fee: : Site Insp (\$ 2) 17/9/20-Typist : Interview (\$ **Pholos** : Tech. Inva /5 Others Merimen Reported: Lung Sun / LEJ: (\$21,943.47 Weel and 15 TOTAL

yder Auto Pte Ltd L Kaki Bukit Ave 2, #02-19 Kaki Bukit Autohub 417921

Insurer Reference: SKN5041U Repairer Reference: 035376

Date calculated: 24/08/2020 4:34 PM

Full Report Registration: SMH8779M Printed: 24/08/2020 4:34 PM

Summary Information

Claim

Location:

Singapore (SG)

San Choon

SKN5041U

Work Provider:

China Taiping Insurance

(Singapore) Pte Ltd

Printed by:

Claim Reference:

Estimated Repair Time:

Actual Repair Days:

Currency:

Date of Incident:

Hire Car Start: Hire Car End:

SGD.

Vehicle Details

Vehicle

Manufacturer:

Model:

MITSUBISHI ATTRAGE (A13A)

Sub Model:

BASE MODEL

Model Sheet Number:

32 AT 01

Registration:

SMH8779M MMBSTA13AJH004497

VIN number: Odometer:

Model Specs

EXHAUST W/CATALYST

1.2 LTR 59KW

Vehicle Condition

Vehicle Status

Pre-Accident Damage: Date of Inspection:


Damage Areas

AII

Underbody

Steve (LKK) wit pijl 25/8/22, 11.00 on P/P, 14 dys

Audatex System Using Manufacturer Times

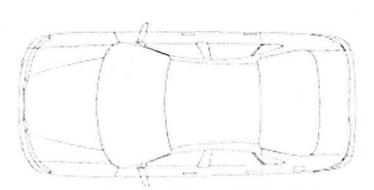

LKK Auto Consultants hence notify the Repairer of the following:

- · To resurvey before/after spray painting
- . To display damaged part(s) during resurvey
- · Parts prices are subject to confirmation
- . Third party survey is on a "Without Prejudice" basis
- . No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

tok epwert 364 to Repairer

Signature: Date:

PRINT DATE 24/08/2020

.abour	- D 40 WII /h	 Price = 80.	00 SGD/h
	Time Base 10 WU/h	WU WU	Price SGD
Code	Description	W	
NO NUMBER	PREPARATION TIME PER JOB	2.0	16.00
NO NUMBER	RENEW FRONT BUMPER	7.0	56.00
514110 00)	INCLUDES: R + R NECESSARY ATTACHED PARTS		
E14121 10)	R + R FRONT BUMPER ATTACHED PARTS	5.0	40.00
514121 10) 425111 10)	RENEW BONNET	3.0	24.00
423111 10)	INCLUDES: BONNET AND ATTACHED PARTS R+R,		
	ADJUST BONNET		16.00
NO NUMBER	R + R COWL SEAL	2.0	16.00 24.00
425113 00)	R + R L/BONNET HINGE	3.0 3.0	24.00
425113 00)	R + R R/BONNET HINGE	8.0	64.00
422022 00)	R + R L/F WING	8.0	04.00
	INCLUDES: R + R HEADLAMP AND WHEELARCH		
	TRIM	8.0	64.00
422022 10)	RENEW R/FR WING	0.0	0
9 v	INCLUDES: R/HEADLAMP ASSY, WHEELARCH-		
	TRIM RIGHT R + R	2.0	16.00
NO NUMBER	ADJUST HEADLAMPS	17.0	136.00
421020 YE)	RENEW FRONT PANEL CPL	244.0	1,952.00
NO NUMBER	RENEW BOTH REAR OUT SIDE PNL/ END PANEL		
	INCLUDES: REAR END PANEL REINFORCEMENT		
	RENEW		
	BUMPER, TAILGATE, TAILLAMPS, ALL ATTACHED PARTS AND		
	TRIMS IN REPAIR AREA		
	REMOVE AND REFIT		
514221 10	REAR BUMPER (REMOVED) RENEW	5.0	40.00
314221 10	INCLUDES: REQUIRED ATTACHED PARTS		
	REMOVE AND REFIT		
NO NUMBER	RENEW L/UPPER SIDE PANEL EXTENSION	10.0	80.00
NO NUMBER	RENEW R/UPPER SIDE PANEL EXTENSION	10.0	
424311 10)	RENEW TAILGATE	5.0	
421030 ZA	RENEW L/R SIDEMEMBER EXTENSION	11.0	
421030 ZA	RENEW R/R SIDEMEMBER EXTENSION	11.0	
NO NUMBER	RENEW BOOT FLOOR PANEL	41.0	
NO NUMBER	REMOVE AND REFIT FUEL TANK CPL	11.0	
145010 00)	R + R RADIATOR CPL	7.0	
NO NUMBER	R + R REAR SILENCER	8.0	
NO NUMBER	R + R EXHAUST PIPE RUBBER/S	4.0	
NN	support panel upper R&R / NEW PARTS	4.0*	
NN	bodykit R&R / NEW PARTS		10/160.00
NN	body kit L & R R&R / NEW PARTS		1.0/ 16.00
NN	ventilator cover R&R / NEW PARTS	2.0*	1.0/ 16.00
NN	buzzer R&R / NEW PARTS		1.0/ 16.00
NN	antenna R&R / NEW PARTS		1.9/ 16.00
NN	spare wheel panel R&R / NEW PARTS	1.0*	
NN	spare wheel board R&R / NEW PARTS	1.0*	
NN	reverse sensor R&R / NEW PARTS		4.0/120.00
NN	body kit R&R / NEW PARTS extension R&R / NEW PARTS	20.0*	15/160.00
NN			

Labour Cost	
Panel / Mechanical	Labour

Hrs WU 51.60 516.0

0 4,128.00

4,128.00

		• 1912.00	in and the	
Total	OT.	La	noı	ur

Paint Work	SYSTEM AZT	Time Basis	10 WU/h
Code	Description	wu	Price SGD
	BONNET NEW PART PAINTING	17.0	
	R/F WING NEW PART PAINTING	10.0	
	FRONT PANEL CPL SURFACE PAINT	5.0	
	REAR PANEL CPL NEW PART PAINTING	19.0	
	BOOTLID NEW PART PAINTING	13.0	
	L/R OUT QTR PANEL NEW PART PAINTING	19.0	
	R/R OUT QTR PANEL NEW PART PAINTING	19.0	
	L/UPP SIDE PANEL EXT NEW PART PAINTING	9.0	
	R/UPP SIDE PANEL EXT NEW PART PAINTING	9.0	
	REAR FLOOR PANEL SURFACE PAINT	7.0	
	L/SIDE MEMBER EXT SURFACE PAINT	4.0	
	R/SIDE MEMBER EXT SURFACE PAINT	4.0	
	FRONT BUMPER NEW PART PAINT K1R	12.0	
	FRT BUMPER TRIM CAP NEW PART PAINT K1R	3.0	
	REAR BUMPER NEW PART PAINT K1R	10.0	

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	41.51
0742	R/F WING NEW PART PAINTING	15.31
1009	FRONT PANEL CPL SURFACE PAINT	8.10
2711	REAR PANEL CPL NEW PART PAINTING	20.10
2931	BOOTLID NEW PART PAINTING	28.61
3481	L/R OUT QTR PANEL NEW PART PAINTING	19.23
3482	R/R OUT QTR PANEL NEW PART PAINTING	19.23
3577	L/UPP SIDE PANEL EXT NEW PART PAINTING	2.19
3578	R/UPP SIDE PANEL EXT NEW PART PAINTING	2.19
3901	REAR FLOOR PANEL SURFACE PAINT	16.19
4027	L/SIDE MEMBER EXT SURFACE PAINT	0.70
4028	R/SIDE MEMBER EXT SURFACE PAINT	0.70
0283	FRONT BUMPER NEW PART PAINT K1R	49.56
0349	FRT BUMPER TRIM CAP NEW PART PAINT K1R	0.35
2583	REAR BUMPER NEW PART PAINT K1R	42.23

Labour Cost - Paint		Hrs	WU	Price SGD
Factor	80.00 SGD/h			
Time Paint			160.0	
Preparation Main Work Metal		1.70	17.0	136.00
Preparation Comp. Work Plastic		0.30	3.0	24.00
Total	10 WU/h	18.00	180.0	1,440.00

	Price SGD
Material Cost - Paint	148.37
New Part Painting	92.14
New Part Painting - Plastic K1R	25.69
Surface-/Blend Paint	18.10
Material-constant Metal	9.00
Material-constant Plastic	293.30
Total	

Spare Part	\$			prices as at 2015-06-01
Code	Description	Part Number	Part Source	Price SGD
	antenna / BR	Rear	Original	160.20
1011	ailleinia /	7415A646	Original	93.80
3021	BADGE MODEL / PC	Rear bumper	Original	0.00
1004	bodykit	Front	Original	0.00
1019	body kit	Rear burn chrome	Original	0.00
1006	body kit L & R	5900A623	Original	891.20
0471	BONNET / 00	5900A023	Original	280.80
0493	BONNET LOCK X	5908A186	Original	325.60
2977	BOOT/TAILGATE LOCK	5927A041	Original	286.60
2944	BOOT/TAILGATE SEAL	5921A017 !	Original	201.50
2635	BOOT/T-GATE	8341A199 ⁴	Original	o 27 view.
	MOULDING	E0204220	Original	1,076.40
2931	BOOTLID / 00	5920A238	Original	106.60
1010	buzzer / BR	Rear	Original	85.50
0494	CLIP FASTENING 1X	MU001908	Original	84.50
4985	END PANEL TRIM	7240A172XA	Original	296.40
1020	extension (LH) / 00	Rear chassis	Original	865.80
0283	FRONT BUMPER / JR	6400F244	Original	45.00
257	FRONT NUMBER PLATE	KNPL3 / ST		1,298.70
1009	FRONT PANEL CPL X	5256B865	Original Original	68.60
349	FRT BUMPER TRIM CAP	6400F205BA/ (M	Original	29.00
258	FRT NO PLATE REINF	KNPLO / DR	Original	625.00
)415	GRILLE / DK	6402A301	Original	159.00
)413	GRILLE BACKING	6400F190	Original	58.00
2953	L/BOOTLID HINGE ?	5923A037	Original	10.00
2955	L/FASTENING CLIP X	5925A022	Original	10.00
3283	L/FASTENING CLIP X	MR482761	Original	20.00
205	L/FASTENING CLIP X	MU001623	Original	737.20
561	L/F HEADLAMP / UK	8301C543	Original	35.10
317	L/F UPP BUMPER BRKT	6400F221/ DR	Original	489.00
1983	L/INN W-HOUSE COVER	7230A169 !	Original	431.60
3281	L/R LAMP / JR	8330A851	Original	125.20
203	L/R MUDFLAP / TN	5370B565	Original	87.50
2629	L/R OUT BUMPER BRKT	6410C433/ DR	Original	972.40
3481	L/R OUT QTR PANEL	5301F967/ DD	Original	10.00
361	L/SCREW M8X20	MF247251/ NC	Original	933.40
1027	L/SIDE MEMBER EXT	5253AM39 ?	Original	
3577	L/UPP SIDE PANEL EXT	5301F977	Original	265.00
475	LEFT BONNET HINGE	5905A157	Original	82.50
1978	LUGG COMP CARPET	7646A264 · aa	Original	250.90
)411	LWR RADIATOR GRILLE	6402A281 / BK	Original	216.5
)431	MANUFACTURER BADGE	7415A603 / 11	Original	82.6
	R/BOOTLID HINGE	5923A038	Original	58.0
2954	R/FASTENING CLIP	5925A022 ×	Original	10.00
2956	R/FASTENING CLIP	MR482761 ×	Original	10.00
3284 3206	R/FASTENING CLIP	MU001623X	Original	20.0

	201				Price SGD
			rait itamber an	Part Source	737.20
Je		R/F HEADLAMP	030103	Original	35.10
,62		R/F UPP BUMPER BRKT	6400F222 / UK	Original	569.40
318		NI OII DOIN -	5220H942 / DD	Original	
J742		R/F WING	JEEUI ID III A	Original	489.00
4984		R/INN W-HOUSE COVER		Original	431.60
3282		N L LAIT		Original	125.20
4204			33700300	Original	87.50
2630		NI OO! DU!	0 0	Original	972.40
3482		R/R OUT QTR PANEL	33011 3002	Original	10.00
0362		R/SCREW M8X20	1112112211	Original	933.40
C4028		R/SIDE MEMBER EXT	5253M348 1"	Original	265.00
/ 3578		R/UPP SIDE PANEL EXT	5301F978 ·	Original	58.50
3015		REAR BADGE	/4TOCOCY . ,	Original	962.00
2583		REAR BUMPER	04100/30/	Original	130.20
8831		REAR EXHAUST RUBBER	5251C804 \ DD	Original	1,398.00
3901		REAR FLOOR PANEL	3231000	Original	47.30
3020		REAR MANUFACT BADGE	5281A631 / 00	Original	260.00
2711		REAR PANEL CPL	3201110317	Original	0.00
1017		reverse sensor	Rear / mis 5905A158 X	Original	82.50
0476		RIGHT BONNET HINGE		Original	65.50
1790		RR EXHAUST SEAL RING	1570C567 ?	Original	771.00
8833		RR EXHAUST SILENCER	Rear ?	Original	153.00
1014		spare wheel board	Rear insulator	0.000	150.00
1013		spare wheel panel	Front X	Original	160.00
1001		support panel upper	5927A044 X	Original	120.20
2973		T-GATE LOCK STRIKER		Original	125.00
1009		ventilator cover	Rear / CRY	Original	
f. OEN D	+ c	Savings			0.00
f: OEM Par n: Non-OE		Subtotal			21,034.10
u: Used pa		Subtotal Discount(+	-10.00%)		-2,103.41
		Total			18,930.69

: X	τι	a	5	
		2000		

Extras			nine CCD
Code	Description		rice SGD
1000	C&C REAR BADGE / PC		58.30*
	bumper clips Rear / //(30	80.00*
1002		00	812.00*
1003	body kit Rear bumper / M/J		398.00*
1005	body kit L & R Rear bum chrome / MIS		
1007	screw Rear bumper / 1/0	10	20.00*
1008	molding clips Rear boot lid / 1/C	19	32.00*
		10	48.00*
1012		10	80.00*
1015	windscreen sealant Rear / n/C	00	
1016	reverse sensor Rear / MIS	200	280.00*
1018	body kit Front / RR		835.00*
1010	Total Extras		2,643.30

nal Calculation SGD SGD 21,034.10 parts -2,103.41 Total Discount(+10.00%) 18,930.69 Total Parts Labour Time Base 10 WU/h 4,128.00 Total 516.0 WU X 80.00 SGD/h 4,128.00 Total of Labour 2,643.30 **Total Of Extras** Paint Work Time Base 10 WU/h 1,440.00 Labour Cost 180.0 WU X 80.00 SGD/h 293.30 **Material Cost** 1,733.30 **Total Paint Including Material** 27,435.29 Repair Cost

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

NA120071748 / National Assessment Centre Services - Ubl VIRY DATE & TIME: 22/08/2020 12:10 BMITTED BY: Roslinda Binte Abdul Wahab

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

- 1. Please report correctly the details of the accident to speed up the claims process.
- 2. This Form must be completed by the Policyholder and/or the Authorised Driver.
- 3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or witholding of material facts may allow insurance companies to repudiate policy liability.
- 4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
- 5. Any false reporting may be referred to the Police for investigation.
- 6. This report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
- 7. By the ladgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT:=

Date Of Report

22/08/2020 12:10

Date Of Accident

21/08/2020 18:40

Exact Location Of Accident

PIE TWDS CHANGI B4 THOMSON FLYOVER

Country/State of Loss

SINGAPORE

DETAILS OF OWN VEHICLE =

Vehicle Registration Number

SMH8779M

Insured/Policyholder

Name Of Registered Owner

FOONG MENG PENG (FENG WENBIN)

NRIC No

SXXXX521J

Email Address

NOEMAIL

Mobile Phone No

(LOCAL) +65-84995940

Alternative Phone No

OTHERS-84995940

Vehicle Particulars

Manufacturer

MITSUBISHI

Model

ATTRAGE

Exact Purpose for which vehicle was being used at

time of accident

WORK

Are you claiming under your own insurance policy

for repair to your vehicle?

NO

If No. Please state action to be taken

THIRD PARTY

Vehicle Category

PRIVATE HIRE

Insurance Company

Name of Insurance Company

NTUC INCOME INSURANCE CO-OPERATIVE LTD

Type Of Coverage

COMPREHENSIVE

Fleet Policy

NO

Policy Number

5116199800

Cover Note Number

Driver

Name of Driver

FOONG MENG PENG (FENG WENBIN)

NRIC No

SXXXX521J

Date Of Birth

10/05/1981

Occupation

OUTDOOR

Date Of Driving Pass

25/06/2015

Driving Experience

5 YEARS AND 1 MONTH

Gender

MALE

Mobile Number

(LOCAL) +65-84995940

Fax Number

Contact Number

OTHERS-84995940

EMail Address

NOEMAIL

BLK 441C BUKIT BTOK WEST AVENUE

#10-933

Address

653441

Postcode

Was driver an employee of the Insured's Company NO

If No, Relationship of the Driver with the Insured

OWNER

Vehicle Registration Number of Driver's Own

Vehicle

Insurance Company of Driver's Own Vehicle

General Information of the Accident

Type Of Accident

CHAIN COLLISION

Weather Conditions

CLEAR

Road Surface

DRY

Other Information

Was any foreign vehicle involved in this accident?

NO

Number of vehicles (including own vehicle)

involved in the accident

5

Was any body injured in the Accident?

YES

Was any injured conveyed to hospital by

ambulance?

NO

Was any other material or property damaged?

YES

I have been approached by unknown person(s) soliciting/offering accident claims assistance.

NO

Number of Passengers (Including Driver)

Passenger 1

3

NAME: GENDER: : SAMUEL

: MALE

Passenger 2

NAME:

: WEI REN

GENDER:

: MALE

Details of Police Action

Was the accident reported to the police?

NO

If Yes, Please state which Police Station

Was notice of intended Prosecution given?

NO

If Yes, against whom?

Circumstances of Accident

PLS REFER TO THE ATTACHED STATEMENT.

Attachment(s)

Are accident photos available for attachment?

YES

Was there any video captured by Car Camera?

NO

Was there any audio recorded?

NO

DETAILS OF OTHER VEHICLE PROPERTY #1

Vehicle Registration Number

SKN5041U

Vehicle Make/Model/Colour

Details Of Properties

Vehicle Category

PRIVATE CAR

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

EDETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number

SHA2062H

Vehicle Make/Model/Colour

Details Of Properties

Vehicle Category

TAX

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

EDETAILS OF OTHER VEHICLE PROPERTY 3

Vehicle Registration Number

SLH75A

Vehicle Make/Model/Colour

Details Of Properties

Vehicle Category

PRIVATE CAR

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

II DETAILS OF OTHER VEHICLE PROPERTY 43

Vehicle Registration Number

SFL8373L

Vehicle Make/Model/Colour

Details Of Properties

Vehicle Category

PRIVATE CAR

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

E:DETAILS OF INJURED PERSON: 111

Name

FOONG MENG PENG (FENG WENBIN)

Approximate Age

Injuries Sustain

SLIGHT

Injured person in which vehicle?

SMH8779M

Were seat belts worn?

YES

Was this injured conveyed to hospital by

ambulance?

NO

DETAILS OF INJURED PERSON 2

Name

SAMUEL

Approximate Age

Injuries Sustain

SLIGHT

Injured person in which vehicle?

SMH8779M

Were seat belts worn?

YES

Was this injured conveyed to hospital by

ambulance?

NO

Address

Postcode

#DETAILS OF INJURED PERSON 3**

Name

WEIREN

Approximate Age

Injuries Sustain

SLIGHT

Injured person in which vehicle?

SMH8779M

Were seat belts worn?

YES

Was this injured conveyed to hospital by

ambulance?


NO

Address

Postcode

Individual Statement

SKETCH PLAN:

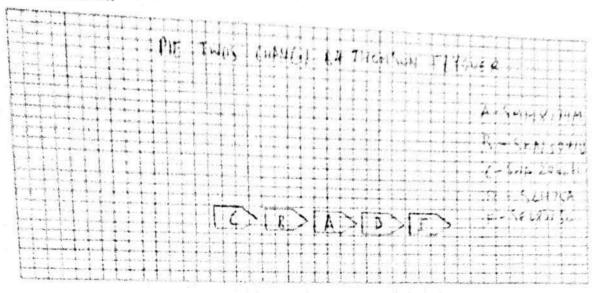

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

ATER WHILE MY VEHI EHICLE THE IMPACT	FORCED MY VE	HICLE FORWARD TO	O HIT VEHICLE C.
VHEN I ALIGHT I REAL	ISE I WAS INVOL	VE IN A CHAIN COL	LISION.
	The second secon		
Control of the second s			
	AND THE PARTY OF T	****	
		e deus jah-euse ja mand di idah keralagan dan menangan hari dan salah salah salah salah salah salah salah salah	WWw.scansesecondenses
	240	****	
		The same of the same	Skurse I
	T-al 7		
The second secon		B	

DECLARATION

If We declare the foregoing particulars are true in every respect.

Policyholder's Signature

Date & Time:

Driver's Signature

In driver is not the policyholder)

Date & Time:

Reporting Centre Personnel's Signature

Name:

NRIC / FIN No.: