

ASS. REC. BY:

Steve

REF:

CC4/AIG20008925/Ed93

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

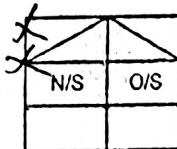

Bal. or Market Value:

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: days Res.: Yes or No

Lum Sum: % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: Person Contacted:

Veh No:

SLG 6978H

Yr Regn:

7/6/97

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or

Make:

Honda Civic

c.c

1595

Colour:

Black

A/C: Insured / Std / NI / NA

Sp. Reading

N/A

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

JHMF0467975200478

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

215/55R16

R:

BS / DUN / EXNOVA / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

5

mm

R/Bal.

5

mm

L/Bal.

5

mm

L/Bal.

5

mm

D.O.A.

19/8/20

D.O.I.

25/8/20

Survey held at

My Car

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

MV- 13K

PV- 8441

NV- 4559

Date/Time, File Pass to?



: Prel. Report

1)



: Final Report

Date/Time, File Return to?

2)

Rep. Form:

Lump Sum / L.E. / C

Days Of Repair:

Resurvey No. of Trip:

Add Fee:



: Site Insp (\$



: Interview (\$



: Tech. Invs (\$



: Weekend (\$

Survey Fee:

Transportation:

Photos

Others

TOTAL



MY CAR CONSULTANT PTE LTD

Reg no.: 2016058782

Address: 53 Ubi Ave 1 #01-33 Paya Ubi Industrial Park Singapore 408934

HP: 98888885

Estimation

Date: 20/8/2020

Vehicle: SLG6078H

Make / Model: HONDA CIVIC

Chassis No:

No.	Description	Unit	Unit Price	Amount
Parts Replacement:				
1	FRONT BUMPER / BR	1	\$ 988.00	\$ 988.00
2	FRONT BUMPER REINFORCEMENT X	1	\$ 326.30	\$ 326.30
3	FRONT BUMPER SIDE RETAINER / BR	2	\$ 56.30	\$ 112.60
4	FRONT BUMPER SIDE GRILLE RH ?	1	\$ 159.00	\$ 159.00
5	FRONT BUMPER LOWER CENTRE GRILLE X	1	\$ 211.00	\$ 211.00
6	FRONT BUMPER UNDERCOVER X	1	\$ 312.00	\$ 312.00
7	FRONT GRILLE / BR	1	\$ 498.00	\$ 498.00
8	HEADLAMP RH / BR	1	\$ 1,169.40	\$ 1,169.40
9	HEADLAMP LOWER BRACKET RH / BT	1	\$ 72.80	\$ 72.80
10	FRONT FENDER RH / DD	1	\$ 698.00	\$ 698.00
11	FRONT FENDER INNER PANEL RH X	1	\$ 398.00	\$ 38.00
12	FRONT FENDER BRACKET RH X	1	\$ 58.60	\$ 58.60
13	FRONT FENDER UPPER GARNISH RH X	1	\$ 158.00	\$ 158.00
14	FRONT FENDER COWLING RH / TN	1	\$ 185.20	\$ 185.20
15	FRONT SUPPORT PANEL X	1	\$ 542.00	\$ 542.00
16	FRONT SUPPORT PANEL TOP GARNISH X	1	\$ 312.00	\$ 312.00
17	RADIATOR COOLANT RESERVOIR X	1	\$ 212.00	\$ 212.00
18	FUSE BOX X	1	\$ 784.00	\$ 784.00
19	FRONT KNUCKLE ARM RH ?	1	\$ 490.50	\$ 490.50
20	FRONT KNUCKLE BEARING RH ?	1	\$ 198.20	\$ 198.20
21	FRONT LOWER ARM RH X	1	\$ 473.90	\$ 473.90
22	FRONT STABILIZER LINK RH X	1	\$ 187.60	\$ 187.60
23	FRONT SHOCK ABSORBER RH ?	1	\$ 512.20	\$ 512.20
24	STEERING RACK AND PINION X	1	\$ 1,897.00	\$ 1,897.00
				\$ 10,596.30
			Less 20%	\$ 2,119.26
			Total	\$ 8,477.04
S/Nett items:				
1	FRONT BUMPER CLIP SET / MR	1	\$ 50.00	\$ 50.00
2	FRONT SPORT RIM RH / CH	1	\$ 800.00	\$ 800.00
3	FRONT TYRE RH X	1	\$ 280.00	\$ 280.00
4	FRONT FENDER INNER COWLING CLIPS / MR	1	\$ 60.00	\$ 60.00
5	RADIATOR COOLANT X	1	\$ 50.00	\$ 50.00
				\$ 1,240.00
Labour to:				
1	SPRAY PAINTING ON AFFECTED AREAS	1	\$ 800.00	\$ 800.00
2	PANEL BEATING ON AFFECTED AREAS	1	\$ 800.00	\$ 800.00
3	CONDUCT FULL WHEEL ALIGNMENT	1	\$ 120.00	\$ 120.00
4	REMOVE AND REFIT FRONT UNDERCARRIAGE	1	\$ 400.00	\$ 400.00

29

600
400
60
200

5	TO CHECK ELECTRICAL WIRING	1	\$ 80.00	\$ 80.00
6	APPLY ANTI RUST ON AFFECTED AREAS	1	\$ 200.00	\$ 200.00
				\$ 2,400.00
			Parts Replacement Amount	\$ 9,717.04
			Total Amount for Labour	\$ 2,400.00
			Total Amount	\$ 12,117.04

30
30

Steve CLKK)

with Mr/L

25/8/70, 12.00 pm

6 days

L/S

My AL spy

- LKK Auto Consultants** hence notify the Repairer of the following:
- To resurvey before/after spray painting
 - To display damaged part(s) during resurvey
 - Parts prices are subject to confirmation
 - Third party survey is on a "Without Prejudice" basis
 - No illegal modification(s) is allowed
 - Supplementary item(s) must be resurveyed **and** is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: