



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

36 ROBINSON ROAD  
#16-01 CITY HOUSE  
SINGAPORE 068877

INV No. AC2102436

INV Date 12/04/2021

Reference CC4/FCI20009161/Gea3q2

Code FCI2

### PROFESSIONAL SERVICE FEE

Vehicle No. SKC 5712A  
Insured Veh. SHA 356Z  
Claim No. D20003428MFSH/1  
Policy No. D-20094921MFSH  
Accident Date 15/08/2020  
Inspection Date 31/08/2020

Description	Total
Survey Inspection	171.00
Digital Photographs	
Transportation	
<b>Subtotal</b>	<b>171.00</b>
<b>GST (7%)</b>	<b>11.97</b>
<b>Grand Total</b>	<b>182.97</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877		Ref: CC4/FCI20009161/Gea3q2 Date: 12/04/2021 Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SHA 356Z	Veh. Inspected	SKC 5712A
Policy No.	D-20094921MFSH	Coverage (\$)	0.00
Claim No.	D20003428MFSH/1	Excess (\$)	0.00
Assign From	ERIC WOO	Assign Date	30/08/2020
2. Vehicle Particulars & Condition			
Make & Model	HYUNDAI ELANTRA 1.6	c.c	1591
Engine No.	HIDDEN	Year of Reg.	2011
Chassis No.	KMHDH41CMCU273002	Colour	BROWN
Odometer	157440 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195/65 R15	YOKOHAMA	6 mm
L/H Front Tyre	195/65 R15	YOKOHAMA	6 mm
R/H Rear Tyre	195/65 R15	YOKOHAMA	6 mm
L/H Rear Tyre	195/65 R15	YOKOHAMA	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	15/08/2020	Inspection Date	31/08/2020
Survey held at	SBL MOTOR SERVICES PL BLK 3023A UBI ROAD 1 #01-65 . SINGAPORE 408717		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKC 5712A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b>LABOUR</b>			
	REMOVE/PUTTING /KNOCKING/FIXING.}		320.00	300.00
	FRONT R/H DOOR ASSY.}		-	-
	REAR R/H DOOR ASSY.}		-	-
	REAR R/H WHEEL ARCH.}		-	-
	FRONT RH SIDE MIRROR COVER.}		-	-
	PUTTY/SPRAY PAINTING ACCIDENT PARTS.		680.00	650.00
	ANTI-RUST (TUFF KOTE) AFFECTED PARTS.	NOT NECESSARY	80.00	-
	CHECK WIRING ON DOORS/ SIDE MIRROR .		50.00	50.00
			1,130.00	1,000.00
	<b>GRAND TOTAL</b>		<b>1,130.00</b>	<b>1,000.00</b>
	<b>RECOMMENDED COST OF REPAIRS</b>			<b>1,000.00</b>

Report Ref No. CC4/FCI20009161/Gea3q2

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.






## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

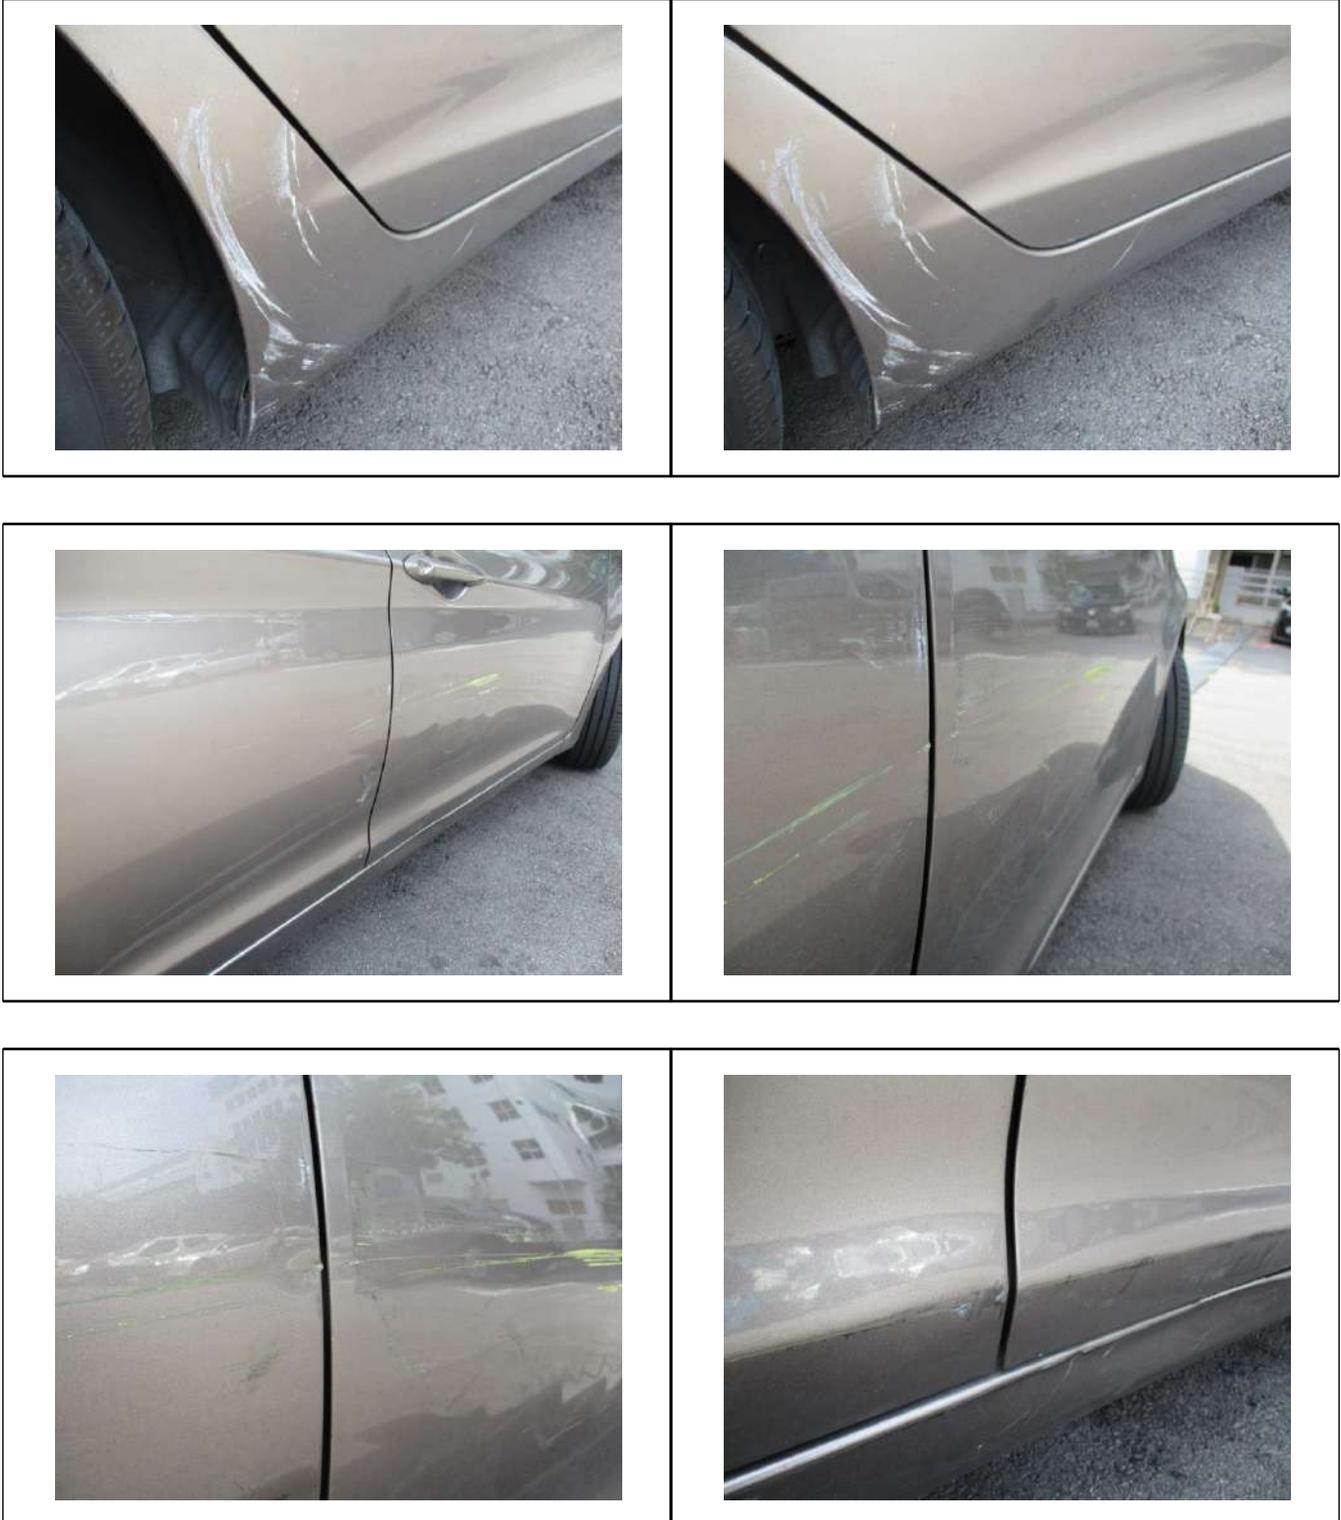



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

