



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2102199

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 05/04/2021
Reference CC6/CTI20009224/Aga3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SKF 2599P
Insured Veh. XE 4320P
Claim No. SNM20D203109
Policy No. DMCVSNA00061702002
Accident Date 29/08/2020
Inspection Date 07/09/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI20009224/Aga3q2 Date: 05/04/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XE 4320P	Veh. Inspected	SKF 2599P	
Policy No.	DMCVSNA00061702002	Coverage (\$)	0.00	
Claim No.	SNM20D203109	Excess (\$)	0.00	
Assign From		Assign Date	07/09/2020	
2. Vehicle Particulars & Condition				
Make & Model	B.M.W. 335i	c.c	2979	
Engine No.	HIDDEN	Year of Reg.	2012	
Chassis No.	WBA3A92050F095578	Colour	GREY	
Odometer	132726 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	275/30 R19	MICHELIN	6 mm	
L/H Front Tyre	275/30 R19	MICHELIN	6 mm	
R/H Rear Tyre	275/30 R19	MICHELIN	6 mm	
L/H Rear Tyre	275/30 R19	MICHELIN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	29/08/2020	Inspection Date	07/09/2020	
Survey held at	MODERN AUTOMOTIVE PTE LTD BLK 3023A UBI ROAD 1 #01-61 SINGAPORE 408717			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			8 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKF 2599P

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
2	FRONT BUMPER SIDE HOLDER -LH & RH	NECESSARY	250.00	250.00
1	FRONT BUMPER TOWING COVER	CRACKED	38.00	38.00
1	FRONT BUMPER FOG LAMP -RH	NOT NECESSARY	338.00	-
1	FRONT BUMPER FOGLAMP COVER -RH	NOT NECESSARY	105.00	-
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	755.00	-
1	FRONT BUMPER SPONGE	CRACKED	148.00	148.00
1	FRONT BUMPER LOGO	NECESSARY	85.00	85.00
2	FRONT GRILLE	O/S CUT	220.00	110.00
1	FRONT GRILLE INNER FRAME	CRACKED	388.00	388.00
1	AIR CON CONDENSER SIDE GUIDE -RH	DEFORMED	95.00	95.00
1	INTER COOLER OUTER COVER	DEFORMED	185.00	185.00
1	HEAD LAMP -RH	CRACKED	2,695.00	2,695.00
2	REAR BUMPER SIDE HOLDER-LH &RH	O/S CRACKED	310.00	155.00
1	REAR BUMPER TOWING COVER	NOT NECESSARY	35.00	-
1	REAR BUMPER REINFORCEMENT	BENT	715.00	715.00
1	REAR BUMPER CENTRE GUIDE	CRACKED	195.00	195.00
1	REAR BUMPER REINFORCEMENT COVER	NOT NECESSARY	89.00	-
1	TAIL LAMP-RH	CRACKED	395.00	395.00
1	TAIL LAMP PANEL -RH	DENTED	215.00	215.00
1	TAIL LAMP SIDE COVER -RH	CUT	49.00	49.00
1	BOOTLID	DENTED	1,655.00	1,655.00
1	BOOTLID LOCK	NOT NECESSARY	390.00	-
1	BOOTLID WEATHERSTRIPE	CUT	195.00	195.00
1	BOOTLID LAMP -RH	CRACKED	285.00	285.00
1	BMW LOGO	NECESSARY	75.00	75.00
1	335I EMBLEM	NECESSARY	85.00	85.00
1	REAR FENDER -RH	TO REPAIR SEE LABOUR	1,695.00	-
1	REAR WINDSCREEN C/W MOULDING	NOT NECESSARY	1,580.00	-
1	REAR EXHAUST PIPE	NOT NECESSARY	1,358.00	-
1	REAR EXHAUST MOUNTING	NOT NECESSARY	40.00	-

Report Ref No. CC6/CTI20009224/Aga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 5% DISCOUNT		-733.15	-400.65
			13,929.85	7,612.35
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT NUMBER PLATE (SN)	DENTED	30.00	30.00
1	FRONT NUMBER PLATE HOLDER (SN)	DEFORMED	30.00	30.00
1	FRONT BUMPER (M3 VERSION) (SN)	CRACKED	2,400.00	1,800.00
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	50.00	30.00
1	REAR BUMPER (M3 VERSION) (SN)	DEFORMED	2,300.00	1,800.00
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	50.00	30.00
1	REAR BUMPER SIDE REFLECTOR -RH (SN)	NOT NECESSARY	80.00	-
1	REAR WINDSCREEN SEALANT (SN)	NOT NECESSARY	60.00	-
			5,000.00	3,720.00
	<u>LABOUR</u>			
	TO KNOCKING OUT FRONT & REAR PORTION & RENEW ABOVE PARTS.INCLUSIVE OF THE REPAIR OF REAR FENDER -RH .		1,600.00	1,000.00
	TO PUTTY & SPRAY UP PAINT WORKS.		1,400.00	1,250.00
	TO CHECK WIRING SYSTEM.		100.00	60.00
	TO UNDERSEAL.		150.00	40.00
	TO REMOVE UPHOLSTERY .		150.00	50.00
	TO REMOVE REAR WINDSCREEN .	NOT NECESSARY	180.00	-
	TO REMOVE EXHAUST PIPE .	NOT NECESSARY	150.00	-
	TO TRANSFER BOOTLID FITTINGS.		150.00	80.00
	TO REMOVE FUEL TANK .	NOT NECESSARY	150.00	-
	TO PERFORM DIAGNOSTIC TEST.		150.00	100.00
	TO REMOVE REAR CAMERA.		100.00	50.00
			4,280.00	2,630.00
GRAND TOTAL			23,209.85	13,962.35



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			11,150.00
---	--	--	------------------

Report Ref No. CC6/CTI20009224/Aga3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKF 2599P

INSPECTION

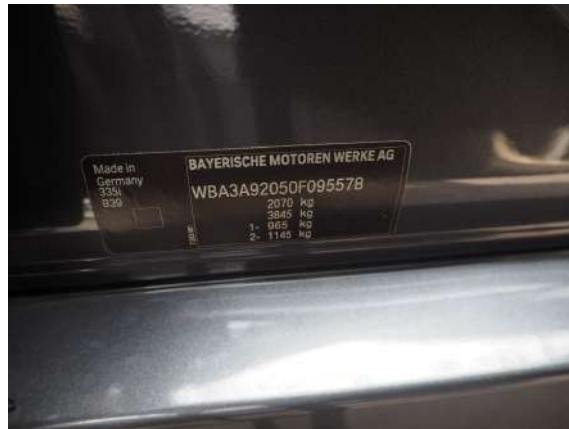



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKF 2599P

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

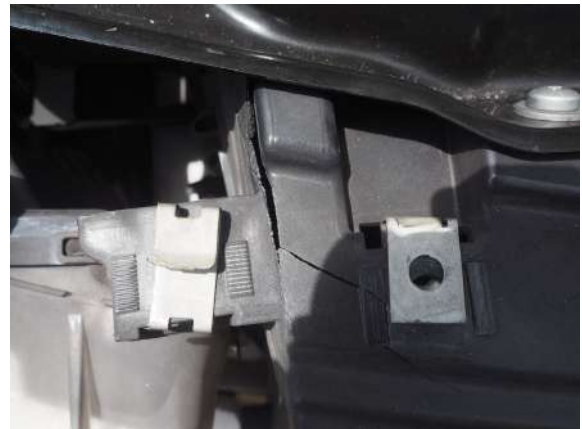



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

