

(08/11/13) wef

ASS. REC. BY: Marcus

REF:

CC4/11/20009322/ubs3

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

SGY8017K
Rico 60

at Workshop m/s

of

Insured:

Policy No.

Claims No.


Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

15k.

IDAC Accident Rpt:

Consistent?: Yes or No

GIA / PR Seen:

Consistent?: Yes or No

Est. Repairs:

4

days

Res.:

Yes or No

Lum Sum:

20

%

3 Val.:

Yes or No

CA / REV / REP. / 24 HRS

LTA 8947

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No:

SGY8017K

Yr Regn:

10 07

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

CA /

Make:

Honda civic

C.C

1595

Colour

white

A/C:

Insured / Std / NI / NA

Sp. Reading

Rotten Plug

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

JHMF0462075201339

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

225/45 R17

BS / DUN / EXNOVA / GYDFS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

29/8/20

D.O.I.

2/9/20

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

2/5 Rear

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Carbon fibre body kit

coe 8-10-2022 MTH 6053

10/9/20 1/5 £3800 confirmed with SIF

Date/Time, File Pass to?

☐

Preli. Report

1)

☐

Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

Photos

Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$))

Add Fee:

☐

Site Insp (\$

☐

Interview (\$


☐

Tech. Invs (\$

☐

Weekend (\$

) S + RS, SI

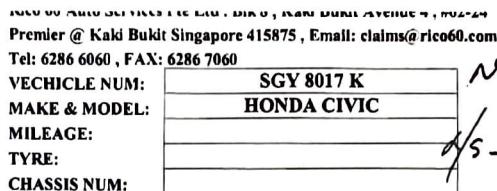

not Arthur
1/5 $\frac{23800}{4 \text{ days}}$
multiple of the
PRICE

ATTN: <u>hkh</u>		CHASSIS NUM: <u>1/s 3800</u>		<u>Chiphir Affin</u>	
NO.	DESCRIPTION - PARTS	QTY	PRICE		
1	REAR DOOR (RH) <u>12 X</u>	1	\$1,379.00	X	
2	REAR DOOR LOCK (RH) <u>11 X</u>	1	\$417.00	X	
3	REAR DOOR LOCK CATCH (RH) <u>11 X</u>	1	\$103.00	X	
4	REAR DOOR WINDOW MOULDING (RH) <u>11 X</u>	1	\$276.00	X	
5	REAR DOOR WINDOW INNER MOULDING (RH) <u>11 X</u>	1	\$319.00	X	
6	REAR DOOR WINDOW GARNISH (RH) <u>11 X</u>	1	\$234.00	X	
7	REAR DOOR SIDE PROTECTOR (RH) <u>117</u> ✓ <u>104.60</u>	1	\$416.00	✓	
8	REAR DOOR INNER BOARD (RH) <u>11 X</u>	1	\$677.00	X	
9	REAR DOOR INNER BOARD SWITCH (RH) <u>11 X</u>	1	\$368.00	X	
10	REAR DOOR HINGE UPPER & LOWER (RH) <u>11 X</u>	2	\$378.00	X	
11	REAR DOOR CHECKER (RH) <u>11 X</u>	1	\$209.00	X	
12	REAR DOOR WINDOW REGULATOR (RH) <u>11 X</u>	1	\$636.00	X	
13	REAR DOOR POWER WINDOW MOTOR (RH) <u>11 X</u>	1	\$457.00	X	
14	REAR DOOR WEATHERSTRIP (RH) <u>11 X</u>	1	\$346.00	X	
15	REAR DOOR INNER WEATHERSTRIP (RH) <u>11 X</u>	1	\$317.00	X	
16	ROCKER PANEL (RH) <u>DO 13er</u> <u>366.30</u>	1	\$1679.00	✓	
17	REAR WINDSCREEN MOULDING <u>11 X</u>	1	\$271.00	X	
18	REAR FENDER (RH) <u>12 X</u>	1	\$1,783.00	X	
19	REAR FENDER COWLING (RH) <u>11 X</u>	1	\$876.00	X	
20	TAIL LAMP (RH) <u>11 X</u>	1	\$677.00	X	
21	TAIL LAMP PANEL (RH) <u>11 X</u>	1	\$518.00	X	
22	REAR BUMPER <u>117</u> ✓ <u>1500.50</u>	1	\$1,500.50	✓	1500
23	REAR BUMPER RETAINER (RH) <u>11 X</u>	1	\$811.00	X	
24	REAR ABSORBER (RH) <u>11 X</u>	1	\$399.00	X	
25	REAR LOWER ARM (RH) <u>11 X</u>	1	\$376.00	X	
26	REAR KNUCKLE (RH) <u>11 X</u>	1	\$241.00	X	
27	REAR KNUCKLE BEARING (RH) <u>11 X</u>	1	\$369.00	X	
28	REAR BEARING HUB (RH) <u>11 X</u>	1	\$344.00	X	
29	REAR AXLE <u>11 X</u>	1	\$1,379.00	X	
SUBTOTAL			\$ -		
LESS 20%			\$ -		
PARTS TOTAL			\$ -		
SPECIAL NETT		QTY	PRICE		
1	REAR DOOR INNER BOARD CLIPS <u>11 X</u>	10	\$ 100.00	X	
2	REAR DOOR HANDLE CARBON FIBRE (RH) <u>11 X</u>	1	\$ 800.00	X	
3	REAR DOOR HANDLE END CAP CARBON FIBRE (RH) <u>11 X</u>	1	\$ 300.00	X	
4	ROCKER PANEL SEALANT <u>11 X</u>	1	\$ 200.00	X	
5	ROCKER PANEL SIDE SKIRT (RH) <u>117</u> <u>600</u>	1	\$ 3,500.00	600	
6	ROCKER PANEL SIDE SKIRT CLIPS <u>11</u> <u>35</u>	10	\$ 100.00	35	

1	REAR WINDSCREEN SEALANT	111X	1	\$	200.00	X
8	REAR FENDER SEALANT	111X	1	\$	300.00	X
9	REAR FENDER COWLING CLIPS	111X	10	\$	100.00	X
10	TAIL LAMP CLIPS	111X	2	\$	40.00	X
11	REAR BUMPER CLIPS	111X	10	\$	100.00	50
12	REAR BUMPER LOWER	111X	1	\$	3,000.00	X
13	REAR RIM SET O/S	111X	2	\$	8,000.00	600
14	REAR TYRE SET	111X	2	\$	3,000.00	X
SPECIAL NETT TOTAL					\$ 19,640.00	
LABOUR			QTY	PRICE		
1	TO RNR ACCIDENT DAMAGE PARTS, CUT/WELD, KNOCK&REALIGN	111X	1	\$	2,700.00	600
2	TO PUTTY AND RESPRAY ACCIDENT AFFECTED AREA	111X	1	\$	2,400.00	900
3	TO RUST PROOF ACCIDENT AFFECTED AREA	111X	1	\$	800.00	X
4	TO RNR UPHOSTERY, GARNISH AND ATTACHMENT PARTS	111X	1	\$	800.00	X
5	TO RNR REAR WINDSCREEN	111X	1	\$	400.00	X
6	TO RNR UNDERCARRIAGE SYSTEM	111X	1	\$	250.00	X
7	TO CHECK WHEEL ALIGNMENT	111X	1	\$	250.00	60
8	TO CHECK WIRING LAYOUT AND TAIL LAMP FUNCTION	111X	1	\$	150.00	20
9	TO RNR TYRE AND WHEEL BALANCING	111X	1	\$	250.00	X
10	TO DO DIAGNOSIS AND RESET , REPROGRAM OR CODING FAULT CODE.	111X	1	\$	800.00	X
11	TO DO WATER LEAK TEST .	111X	1	\$	120.00	X
TOTAL					\$ 8,920.00	
GRAND TOTAL COST					\$ 28,560.00	

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:



Rico 60 Auto Services Pte Ltd . Blk 8 , Kaki Bukit Avenue 4 , #02-24
Premier @ Kaki Bukit Singapore 415875 , Email: claims@rico60.com
Tel: 6286 6060 , FAX: 6286 7060

VEHICLE NUM:	SGY 8017 K
MAKE & MODEL:	HONDA CIVIC
MILEAGE:	
TYRE:	
CHASSIS NUM:	

ATTN:

CHASSIS NO:

NO.	DESCRIPTION - PARTS	QTY	PRICE
1	REAR DOOR SIDE PROTECTOR CHROME (RH) <i>ru ✓ PS</i>	1	8,304.00 <i>7,304.00</i>
	SUBTOTAL		\$ -
	LESS 20%		\$ -
	PARTS TOTAL		\$ -
	SPECIAL NETT	QTY	PRICE
	SPECIAL NETT TOTAL		\$ -
	LABOUR	QTY	PRICE
	TOTAL		
	GRAND TOTAL COST		\$ -

~~P = \$2,479
 - 20% = \$1,983.20
 S/N = \$2,785
 LABOUR = \$1,580
 Total = \$6,348.20
 - 20% = \$5,100.~~

~~P - 554.90
 20%
 7-444.72
 S.N - 2781.00
 L - 1580.00
 4809.72
 3567~~