



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

AUTO & GENERAL INSURANCE (S) PL
(BUDGET DIRECT INSURANCE)
190 CLEMENCEAU AVENUE #03-01
SINGAPORE SHOPPING CENTRE
SINGAPORE 239924

INV No. AC2007069
INV Date 19/10/2020
Reference CS/AGI20009351/Aqf3q2
Code AGI



PROFESSIONAL SERVICE FEE

Vehicle No. SLX 8072X
Insured Veh. SCN 4000P
Claim No. C10007109/ST
Policy No.
Accident Date 24/08/2020
Inspection Date 03/09/2020

Description	Total
Survey Inspection	250.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	250.00
GST (7%)	17.50
Grand Total	267.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
AUTO & GENERAL INSURANCE (S) PL		Ref : CS/AGI20009351/Aqf3q2		
(BUDGET DIRECT INSURANCE) 190 CLEMENCEAU AVENUE #03-01 SINGAPORE SHOPPING CENTRESINGAPORE 239924		Date : 19-10-2020		
Code : AGI				
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SCN 4000P	Veh. Inspected	SLX 8072X	
Policy No.		Coverage (\$)	0.00	
Claim No.	C10007109/ST	Excess (\$)	0.00	
Assign From	STANLEY LAI	Assign Date	02/09/2020	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA ALTIS	c.c	1598	
Engine No.	HIDDEN	Year of Reg.	2008	
Chassis No.	MR053ZEE106107685	Colour	WHITE	
Odometer	290604	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	CONTINENTAL	6 mm	
L/H Front Tyre	195/65 R15	CONTINENTAL	6 mm	
R/H Rear Tyre	195/65 R15	CONTINENTAL	6 mm	
L/H Rear Tyre	195/65 R15	CONTINENTAL	6 mm	
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
Accident Date	24/08/2020	Inspection Date	03/09/2020	
Survey held at	1 KAKI BUKIT AVE 6 #01-52			
Repairer	SIN YU SIN WORKSHOP			
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR: 4 Working Days			



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLX 8072X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BOOT LID	TO REPAIR SEE LABOUR	791.50	-
1	REAR BOOT LID 'LOGO' EMBLEM	NECESSARY	37.40	37.40
1	REAR BOOT LID 'COROLLA' EMBLEM	NECESSARY	37.80	37.80
1	REAR BOOT LID 'ALTIS' EMBLEM	NECESSARY	38.90	38.90
1	REAR BOOT LID '1.6' EMBLEM	NECESSARY	39.90	39.90
1	REAR BOOT LID WEATHER STRIP	NOT NECESSARY	201.30	-
1	REAR BOOT LID MECHANISM LOCK	NOT NECESSARY	191.60	-
1	REAR BOOT LID LOCK STRIKER	NOT NECESSARY	55.00	-
1	REAR BUMPER	DEFORMED	561.60	561.60
2	REAR BUMPER SIDE RETAINER L/R @\$61.45	NECESSARY	122.90	122.90
2	REAR BUMPER CORNER RETAINER L/R @\$60.25	NOT NECESSARY	120.50	-
2	REAR BUMPER SIDE REFLECTOR L/R @\$130.55	NOT NECESSARY	261.10	-
1	REAR BUMPER INNER SPONGE & REINFORCEMENT BEAM	CRACKED	231.40	231.40
2	REAR BUMPER IMPACT BRACKET L/R @\$130.15	NOT NECESSARY	260.30	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	781.40	-
1	REAR END PANEL GARNISH	NOT NECESSARY	189.90	-
4	REAR END PANEL GARNISH CLIP @\$3.60	NOT NECESSARY	14.40	-
	LESS 25% DISCOUNT		-984.23	-267.48
			2,952.67	802.42
<u>SPECIAL NETT ITEMS</u>				
1	REAR BUMPER CLIP (SN)	NECESSARY	30.00	30.00
1	REAR REVERSE SENSOR (SN)	DAMAGED	300.00	200.00
1	REAR END PANEL SEALANT (SN)	NOT NECESSARY	50.00	-
			380.00	230.00
<u>LABOUR</u>				
	TO CHECK WIRING .		80.00	30.00
	TO REMOVE,REPLACE AND REINSTALL REAR REVERSE SENSOR .		120.00	50.00

Report Ref No. CS/AGI20009351/Aqf3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE AND REINSTALL REAR INTERIOR TRIMS GARNISH ,SEAT ,ETC FOR NECESSARY REPAIRS.		150.00	50.00
	TO STRAIGHTEN ,REPAIR ,REALIGN ON FRONT & REAR AFFECTED AREA AND REPLACE DAMAGED PARTS.INCLUSIVE OF THE REPAIR OF REAR BOOT LID AND REAR END PANEL .		800.00	500.00
	TO SPRAY PAINTING ON AFFECTED.		800.00	600.00
			1,950.00	1,230.00
GRAND TOTAL			5,282.67	2,262.42
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				1,800.00

Report Ref No. CS/AGI20009351/Aqf3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLX 8072X

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

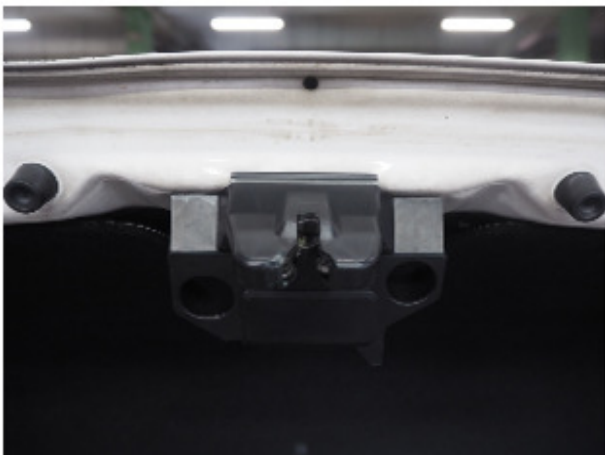



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLX 8072X

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

