

ASS. REC. BY:

REF:

C12/20009413/Ke

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

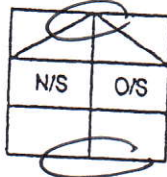

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

07 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

GBE 771214

Yr Regn:

03/16

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy Dyna

c.c.

2882

Colour

White

A/C:

Insured / Std / NI / NA

Sp. Reading

197613

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

JTIFAT 35 Y60K 206060

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: M / S / R / m / STD A / R / m or

Tyre Size:

F: Yokohama 195/75R15

R: Windforce 155R 12x8 (D)

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

3

mm

Rear

R/Bal.

22

mm

L/Bal.

3

mm

L/Bal.

22

mm

D.O.A.

31/8/20

D.O.I.

3/9/2020

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

& M

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

10/11/11 6:18pm @ 8900L Confirmed

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS. SI

Fines

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format :

Lump Sum / I.B.I. (\$

Not Notion
 L1 Reg 889006
 Prework After Paint
 7 days



ESTIMATE TO REPAIR

VEHICLE NO. : GBE 7712 H
 MAKE : TOYOTA
 MODEL : TOYOTA DYNA 150 MANUAL
 YEAR : 2015
 CHASSIS NO : JTFAT35Y60K206060

SURVEYOR NAME : LKK
 DATE OF SURVEY : 03 SEP 2020
 TIME OF SURVEY :

DATE : 3-Sep-20
 DATE OF ACCIDENT : 31-Aug-20
 THIRD PARTY REF : SJH 8992 Z
 THIRD PARTY REF : CHINA TAIPING INSURANCE (SINGAPORE) PTE LTD

Qty	Parts Description/ Labour	Type	Unit Price	Nett Item Amt	Amount
1 pc	front bumper			my \$ R 356.20	✓
1 pc	front girler			\$ M 450.50	✓
1 pc	front girler emblem			\$ M 74.60	✓
2 pcs	head lamps		\$ 573.50	\$ CM 1,147.00	✓
1 pc	front panel			\$ R 856.40	✓
1 pc	front panel DYNA emblem			\$ M 64.40	✓
1 pc	front panel top garnish			\$ CM 328.50	✓
1 pc	front windscreen glass			\$ CM 1,564.50	✓
1 pc	front windscreen rubble			\$ M 369.40	50% ✓
1 pc	air-con cooling coin			\$ 1,776.30	✓
1 pc	rear number plate brakel			\$ R 112.60	✓
2 pcs	rear number plate lamps		\$ 36.50	\$ R 73.00	✓
1 pc	o/s tail lamp brakel			\$ R 78.80	✓
1 pc	o/s tail lamp			\$ CM 227.70	✓
2 pcs	tail gate lock pin		\$ 35.00	\$ R 70.00	X
	Less 25%			\$ 7,549.90	
				\$ 1,887.48	
				\$ 5,662.43	
1 pc	front windscreen iu bracket	S.Net		(B.11) \$ M 25.00	✓
1 pc	front panel co's logo sticker	S.Net		\$ M 380.00	200% ✓
1 pc	front number plate	S.Net		\$ 80.00	25% ✓
1 pc	front rear sensor	S.Net		\$ 200.00	✓
1 pc	70 km/h sticker	S.Net		\$ 20.00	X
2 pcs	power tail gate hydraulic pipes	S.Net	\$ 300.00	\$ R 600.00	✓
2 pcs	power tail gate hydraulic cylinder	S.Net	\$ 1,200.00	\$ 4,800.00	✓
1 pc	hydraulic oil	S.Net		\$ M 120.00	50% ✓
	To putty & spray paint			\$ 700.00	60% ✓
	To replace rear panel gate hydraulic cylinder, pipes & replace and realight rear panel			\$ 1,800.00	90% ✓
	To replace front windscreen glass			\$ 120.00	60% ✓
	To remove & refix front absorber assy, repair aircon cooling coil			\$ 350.00	100% ✓
	To Top up gas			\$ 80.00	✓
	Labour charge			\$ 800.00	60% ✓
TG/VL	TOTAL			\$ 15,737.43	

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Lim Tan Motor Pte Ltd
 Blk 176 Sin Ming Drive #03-09 Sin Ming Autocare Singapore 575721
 Tel: 65-64520893 Fax: 65-64569127 Email: sales@limtanmotor.com.sg
 Co. Reg No. 199307277D GST Reg No. M2-0019086-0

This document must not be reproduced, in whole or in part, or disclosed to third party or parties without prior written consent of Lim Tan Motor Pte Ltd

Date: