

ASS. REC. BY:

Steve

REF:

CS/LPC 20009422/Ey f3

ASSIGNMENT

From:

Date:

Estimated Cost:

☒ TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

☒	☒
N/S	O/S
☐	☐

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

XE 7767P

Yr Rogn:

17/2/17

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

☒ Truck / Tractor or

Make:

Mitsubishi Fuso

c.c

12882

Colour:

White

A/C:

Insured / Std / NI / NA

Sp.Ronding

59398

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

FV51SSA20064

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

295/80R225

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Front

Rear

R/Bal.

S

mm

R/Bal.

S

mm

L/Bal.

S

mm

U/Bal.

S

mm

D.O.A.

2/9/20

D.O.I.

4/9/20

Survey held at

Ken Fook Sin

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

MV-220K

Date/Time, File Pass to?

☐

: Prel. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Rep. Formed:

Lump Sum / L.B. / C.

Days Of Repair:

Resurvey No. of Trip:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Inve (\$

☐

: Weekend (\$

Survey Fee:


Transportation:

S + RS \$

Photos

Others

TOTAL

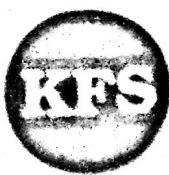

簡福星噴漆工廠 KAN FOOK SING MOTOR WORKSHOP

61 Defu Lane 12 Singapore 539147
 Tel : (65) 6747 9500, 6858 2126, 6858 4361
 Fax : (65) 6748 1006, 6281 8428
 E-mail: kants@pacific.net.sg • Website: www.carparts.com.sg

Business Reg No: 22100670E
 GST Reg No: M3 0006333-E

INSURER: **Lonpac Insurance Bhd (HQ)**

PARTICULARS OF CLAIM

Claim Type:	OD (OWN DAMAGE)	Ref. No:	
Policy No:	Z20VC05004503	Date of Loss:	02/09/2020
Vehicle Reg. No.:	XE7767P	Driveable?	
Driver Age/Info:	34 / MALE	Party At Fault:	UNKNOWN
TP Injury Involved?	NO	Third Party Involved?	YES
Insured/Claimant:	HAYRER PTE LTD		
Driver:	CHENG KAI		
Make/Model:	MITSUBISHI FUSO, 12.0 D FV51SS3VDEA (M)	Vehicle Reg. Date:	17/02/2017
Vehicle Colour:	WHITE	Chassis No:	OM457LA457972C0331851
Engine No:	FV51SSA20064		
Odometer:	0 KM		
Paint Type:			
Total Loss?	NO		
Est. Duration of Repair (day)	6		
Description of Accident/Loss	REFER WITH ATTACH.		
Present Location:	KAN FOOK SING MOTOR WORKSHOP (DEFU)		

COST OF CLAIMS	Amount
Parts	12,996.15
Miscellaneous Items	30.00
Labour	1,010.00
Paintwork Labour	820.00
Towing	0.00
Calculated Gross Total (\$\$)	14,856.15
- Excess (\$\$)	1,000.00
(\$\$)	13,856.15
+ GST 7.00% (\$\$)	969.93
Nett Amount (\$\$)	14,826.08

This claim is handled by: MT TAN

Generated using Merimen e-Claims Internet Estimation & Adjusting System

REPAIR DETAILS**Reference**

Part Source: (Last Synchronised 03 Sep 2020)
 Parts: N/A MITSUBISHI FUSO 12.0 D FV51SS3VDEA (M) (Model not available in database)
 Labour: Repairer's (Price-denominated Standard List)
 Print Code: Kan Fook Sing Motor Workshop/XE7767P/03/09/2020 17:12
 Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
 Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*FRONT BONNET / DD	0.00	0.00	*2,250.00 F
2	1		*FRONT BONNET LOCK RH / ?	0.00	0.00	*90.00 F
3	1		*FRONT BONNET LOCK LH / ?	0.00	0.00	*90.00 F
4	1		*FRONT BONNET FUSO EMBLEM / MC	0.00	0.00	*120.00 F
5	1		*FRONT GRILLE TOP / DR	0.00	0.00	*300.00 F
6	1		*FRONT GRILLE LOWER / DR	0.00	0.00	*350.00 F
7	1		*FRONT GRILLE EMBLEM / MC	0.00	0.00	*65.00 F
8	1		*FRONT GRILLE SUPER GREAT EMBLEM / MC	0.00	0.00	*85.00 F
9	1		*FRONT CORNER PANEL RH / ?	0.00	0.00	*650.00 F
10	1		*FRONT CORNER PANEL LH / ?	0.00	0.00	*650.00 F
11	1		*FRONT BUMPER / DD (upper)	0.00	0.00	*185.00 F
12	1		*FRONT BUMPER TOP RH / DR	0.00	0.00	*140.00 F
13	1		*FRONT BUMPER TOP LH / DT	0.00	0.00	*140.00 F
14	1		*FRONT BUMPER (lower) / DT	0.00	0.00	*1,500.00 F
15	1		*FRONT BUMPER LOWER PANEL RH / DR	0.00	0.00	*150.00 F
16	1		*FRONT BUMPER LOWER PANEL LH / mi	0.00	0.00	*150.00 F
17	1		*FRONT BUMPER REINFORCEMENT / ?	0.00	0.00	*840.00 F
18	1		*FRONT BUMPER BRACKET RH / ?	0.00	0.00	*98.00 F
19	1		*FRONT BUMPER BRACKET LH / ?	0.00	0.00	*98.00 F
20	1		*FRONT BUMPER CENTRE GARNISH / (black) / CUT	0.00	0.00	*120.00 F
21	1		*FRONT BUMPER LAMP RH / ?	0.00	0.00	*185.00 F
22	1		*FRONT BUMPER LAMP LH / ?	0.00	0.00	*185.00 F
23	1		*FRONT BUMPER LAMP RIM RH / CR4 DR	0.00	0.00	*90.00 F
24	1		*FRONT BUMPER LAMP RIM LH / 3 / CUT	0.00	0.00	*90.00 F
25	1		*FRONT HEADLAMP RH / ?	0.00	0.00	*650.00 F
26	1		*FRONT HEADLAMP LH / ?	0.00	0.00	*650.00 F
27	1		*FRONT HEADLAMP RIM RH / CR4	0.00	0.00	*95.00 F
28	1		*FRONT HEADLAMP RIM LH / ?	0.00	0.00	*95.00 F
29	1		*AIR CON CONDENSER / X	0.00	0.00	*1,190.00 F

F=Franchise part.

Sub Total (S\$)

11,301.00

+ Margin on L,N Items 15.00% (S\$)

1,695.15

Total Parts (S\$)

12,996.15

Kan Fook Sing Motor Workshop/XE7767P/03/09/2020 17:12 Not valid without Reference section.
 Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

No	Qty	Particulars	Amount
<u>Miscellaneous Items</u>			
1	1	FRONT NUMBER PLATE / 01	30.00
Sub Total (\$\$)			30.00

Estimates on Labour

No	Particulars	Lab.Type	Amount
<u>Paintwork Labour</u>			
1	SPRAYPAINTING CHARGES	New 700	820.00
<u>Labour Items</u>			
2	TO CHECK WIRING SYSTEM	New	30.00 ✓
3	TO REMOVE/REFIT/REFILL AIR CON GAS	New	80.00 X
4	TO REMOVE ALL NECESSARY AFFECTED PARTS WELD CUT PANEL BEAT AND FITTING NEW PARTS	New 600	900.00
Gross Labour Cost (\$\$)			1,830.00

Kan Fook Sing Motor Workshop/XE7767P/03/09/2020 17:12. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

Steve (LKK) OD - Not Authorize
EX cost - \$1000
L/S
Ry Ak m
4/9/20, 2.00pm
5 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: