

ASS. REC. BY: Steve

REF:

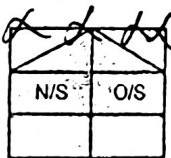
CC3/AIG2009424/Esf3

Eqf3

ASSIGNMENT

From: _____ Date: _____
Estimated Cost: _____
OD/TP/WS/TP RES/OD RES/EVA/INV/MV
To Inspect Vehicle No: _____
at Workshop m/s _____
of _____
Insured: _____
Policy No. 1800009207
Claims No. 0777168472SG
Sum Insured: _____ Excess: _____
(Client's Record)
Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____
IDAC Accident Rpt: _____ Consistent? : Yes or No
GIA / PR Seen: _____ Consistent? : Yes or No
Est. Repairs: _____ days Res.: Yes or No
Lum Sum: _____ % 3 Val.: Yes or No
CA / REV / REP. / 24 HRS
Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SMF 7733L Yr Regn: 2/2/18
Type: (M.Car) M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Tractor or
Make: Audi Q2 c.c. 1395
Colour: Red A/C: Insured / Std / NI / NA
Sp. Reading: 60284 T/Radio: Insured / Std / NI / NA
Eng/No: _____
C/No: WVAUZZZGA4JA04689
Gen. Cond: Good Fair / Poor / Burnt
Steering: In order / Jammed / Leaked / Burnt or
Brake: In order / Jammed / Leaked / Burnt or
Mod: Nil / S/Rim / STD A/Rim or
Tyre Size: F: 215/60R16
R: 11
BS / DUN / EXNOVA / GY / FS / LIZA / (MIC) / OHTSU / PIR / SUMI /
TOYO / YOKO or
Front Rear
R/Bal. 5 mm R/Bal. 5 mm
L/Bal. 5 mm L/Bal. 5 mm
D.O.A. 3/9/20 D.O.I. 4/9/20
Survey held at Premium
Des. of Damages (Frt) / Rear / O/S / N/S / U/C / Rooftop or
The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

MV-87K

07/09/20@3.16pm revert to Victor via Merimen.
07/09/20@5.23pm Victor informed C/A via Merimen.
08/09/20@6.02pm Informed Kee Siang C/A & ex: \$400.
07/01/21@10.50am Confirm with Jia Yee final fig \$24,566.88, 11 repair days.
(Red \$19805.12, 45%)

Date/Time, File Pass to?



: Prell. Report

1)



: Final Report

Date/Time, File Return to?

2)

Days Of Repair: 11Resurvey No. of Trip: 2

Add Fee:



: Site Insp (\$



: Interview (\$



: Tech. Invs (\$



: Weekend (\$

Survey Fee:

Transportation:

S + RS, SI

Photos

Others

TOTAL

Rep. Formed:

MER-OD

Total Sum / L.E.I. /

24566.88

PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

WIP : 47981

Telefax

Estimate	:	Accident Repairs
Workshop	:	Ubi Road 1
Contact No	:	6366 2323
Fax No	:	6841 1183
Reference	:	PA/OD/0630/2020/NS
Date	:	4-Sep-20

Vehicle IN workshop. Please arrange for survey

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name	:	Ms Oh Lay Fong
Address	:	Blk 3 Haig Road
	:	#03-531
	:	Singapore 430003
Telephone	:	Hp +65 97620666
Type of Claim	:	Own Damage Claims
Policy No.	:	1800009207-02
Vehicle No	:	SMF 7733 L
Model Code	:	Audi Q2 1.0 TFSI S TRONIC
Model / Year	:	Sep-20
Engine No	:	CHZ 598898
Chassis No	:	WAUZZZGA4JA041689
Mileage	:	60284
Date In	:	3-Sep-20
Estimated By	:	Johnny Boo / Allan Wu
Accident Date	:	3-Sep-20
Place of Accident	:	North Bridge Road

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6941 1183

Telefax

Estimated Labour Charges for Accident Vehicle SMF 7733 L

S/N	Nature of Jobs	Estimated Charges	Survivor's Recommendations
1	To remove, check and reinstall front wire harness for headlights, horns, outside temperature sensor and headlight washer assy.	S/N \$ 280.00 /	
2	To remove and transfer both headlight control units and power modules.	S/N \$ 800.00	?
3	To renew front windscreen.	S/N \$ 480.00 /	
4	To install solar film for front windscreen.	S/N \$ 400.00 /	
5	To carry out water seepage test for front windscreen.	S/N \$ 200.00 /	
6	To remove and renew aircon condenser, radiator and additional radiator. Check electrical fans and control unit. Pressurise cooling system. To carry out vacuum and regas.	S/N \$ 1,400.00	?
7	To dismantle and renew front bumper, both front fenders, bonnet and both headlights. To renew front lock carrier and align to position. Re-organise crash management components. Reinstall all parts removed.	\$ 6,400.00	2900
8	To respray front bumper, bonnet, hinges, rhs upper A-pillar and both front fenders.	\$ 5,500.00	2750
9	To carry out diagnostic check.	S/N \$ 192.00 /	
TOTAL LABOUR CHARGES		: \$ 15,652.00	

PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMF 7733 L

		Damage Parts & Prices	
S/N	Parts Description	S/NETT	REMARKS
1	FRONT BUMPER / DEF	\$ 1,854.00	
2	FRONT BUMPER FIXING PARTS ?	\$ 343.00	
3	FRONT BUMPER GRILLE - CENTRE ?	\$ 195.00	
4	FRONT BUMPER AIR GUIDE GRILLE - LH / RH ?	2, \$ 334.00	
5	FRONT BUMPER END CAP - LH / RH X	2 \$ 68.00	
6	FRONT BUMPER SPOILER X	\$ 296.00	
7	FRONT BUMPER CLOSING ELEMENT ?	\$ 154.00	
8	WHEEL SPOILER - LH / RH X	2 \$ 68.00	
9	FRONT BUMPER ADAPTER - LH ?	35 \$ 35.00	
10	FRONT BUMPER ADAPTER - RH ?	\$ 42.00	
11	RADIATOR GRILLE / BR	\$ 1,395.00	
12	RADIATOR GRILLE STRIKER PLATE ?	\$ 123.00	
13	FRONT BUMPER CARRIER / BT	\$ 679.00	
14	FRONT BUMPER COVER / CRU	\$ 99.00	
15	FRONT BUMPER FOAM FILLER PIECE / BR	\$ 77.00	
16	FRONT BUMPER DISTANCE PIECE ?	\$ 14.00	
17	FRONT BUMPER GUIDE SECTION - LH / RH ?	2 \$ 70.00	
18	CAUTION SIGN STICKER -	NEC \$ 14.00	
19	AIRCON STICKER ?	NEC \$ 8.00	
20	HORN - LH LOW TONE X	\$ 283.00	
SUB TOTAL SPARE PARTS CHARGES		:	<u>\$ 6,151.00</u>

PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMF 7733 L

S/N	Parts Description	Damage Parts & Prices		REMARKS
		S/NETT		
21	SIGNAL HORN - RH HIGH TONE X	\$	180.00	
22	SPRING SHACKLE - LH / RH X	2 \$	62.00	
23	FRONT FENDER - LH / RH / 00	2 \$	2,268.00	
24	FRONT FENDER ATTACHMENT PARTS ?	\$	40.00	
25	FRONT FENDER BRACKET - LH / RH ?	2 \$	32.00	
26	FRONT FENDER BRACKET - LH / RH ?	2 \$	94.00	
27	FRONT FENDER BRACKET - LH / RH ?	2 \$	32.00	
28	FRONT FENDER BRACE - LH / RH ?	2 \$	74.00	
29	FRONT FENDER BRACKET - LH / RH ?	2 \$	46.00	
30	WHEEL HOUSING LINER SEAL - UPPER X	2 \$	73.00	
31	BONNET / 00	\$	2,757.00	
32	BONNET ATTACHMENT PARTS / APC	\$	163.00	
33	BONNET LID HINGE - LH / RH ?	2 \$	122.00	
34	BONNET GAS FILLED STRUT X	\$	101.00	
35	BONNET STRIKER - LH / RH ?	2 \$	218.00	
36	BONNET SOUND ABSORBER ?	\$	217.00	
37	BONNET IMPACT PROTECTION - CENTRE / LH / RH ?	3 \$	90.00	
38	FRONT FENDER TOP COVER - LH / RH X	2 \$	82.00	
39	FRONT FENDER INNER TOP COVER - LH / RH X	2 \$	32.00	
40	PLENUM CHAMBER COVER - FRONT / (1st (121st))	\$	156.00	
SUB TOTAL SPARE PARTS CHARGES		:	<u>\$ 6,839.00</u>	

PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMF 7733 L

S/N	Parts Description	Damage Parts & Prices		REMARKS
		S/NETT		
41	BONNET LID LOCK ?	2	\$ 423.00	
42	BONNET BOWDEN CABLE - CENTRE ?		\$ 57.00	
43	BONNET LID LOCK CABLE ?		\$ 73.00	
44	BONNET RELEASE ELEMENT ?		\$ 57.00	
45	BONNET BOWDEN CABLE - LH / RH ?	2	\$ 114.00	
46	BONNET RELEASE LEVER ?		\$ 13.00	
47	HEADLIGHT MOUNTING - LH / RH ?	2	\$ 234.00	
48	LED HEADLIGHT - LH / RH ?	2	\$ 9,718.00	
49	LIFT CYLINDER - LH / RH X	2	\$ 282.00	
50	LIFT CYLINDER HOSE X		\$ 175.00	
51	LOCK CARRIER ?		\$ 983.00	
52	AIRCON CONDENSER X		\$ 545.00	
53	READY MIX COOLANT X		\$ 91.00	
54	RADIATOR AIR GUIDE - LH / RH / CUT	2 /	\$ 60.00	
55	RADIATOR AIR GUIDE - UPPER CENTRE ?		\$ 22.00	
56	WHEEL HOUSING LINER - LH / RH X	2	\$ 388.00	
57	WHEEL HOUSING LINER ATTACHMENT PARTS X		\$ 57.00	
58	FRONT WHEEL COVER - LH / RH / NPC	2	\$ 636.00	
59	FRONT WINDSCREEN / DR		\$ 990.00	
60	RAIN SENSOR GEL FOIL. / N/A		\$ 132.00	
61	RETAINING SPRING / N/A		\$ 20.00	
62	FRONT WINDSCREEN SEALANT / N/A	S/N	\$ 200.00	
63	FRONT NO PLATE / MIS	S/N	\$ 60.00	
64	SUNDRIES ?		\$ 400.00	

TOTAL SPARE PARTS CHARGES

: **\$ 28,720.00**

TOTAL LABOUR CHARGES

: **\$ 15,652.00**

GRAND TOTAL

: **\$ 44,372.00**

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Steve CLKK)
83228813

4/9/22, 11.00 am

OD - Not Authorise, Excess - ?

P/P

Ry Bel SM

8 days

Please Note

- : This estimate is based on visual inspection of the affected vehicle. Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
- For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant