



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

EQ INSURANCE COMPANY LTD

INV No. AC2103565

5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEX
SINGAPORE 069110

INV Date 19/05/2021
Reference CC4/EQI20009551/Dga3q2
Code EQI

PROFESSIONAL SERVICE FEE

Vehicle No. SH 6002M
Insured Veh. YN 5536T
Claim No. DM20HO01305/JT
Policy No. DMCPHQ20-0022
Accident Date 05/09/2020
Inspection Date 08/09/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

EQ INSURANCE COMPANY LTD
5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEXSINGAPORE 069110

Ref: CC4/EQI20009551/Dga3q2

Date: 19/05/2021

Code: EQI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	YN 5536T	Veh. Inspected	SH 6002M
Policy No.	DMCPHQ20-0022	Coverage (\$)	0.00
Claim No.	DM20HO01305/JT	Excess (\$)	0.00
Assign From	JAIME TAY	Assign Date	07/09/2020

2. Vehicle Particulars & Condition

Make & Model	TOYOTA PRIUS	c.c	1798
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	JTDKB3FUX03564039	Colour	BLUE
Odometer	455630 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	DAVANTI	5 mm
L/H Front Tyre	195/65 R15	DAVANTI	5 mm
R/H Rear Tyre	195/65 R15	DAVANTI	5 mm
L/H Rear Tyre	195/65 R15	DAVANTI	5 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION AND N/S BODY.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	05/09/2020	Inspection Date	08/09/2020
Survey held at	BIFROST AUTO PTE LTD 8 KAKI BUKIT AVENUE 4 #01-49 PREMIER @ KAKI BUKIT SINGAPORE 415875		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	8 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SH 6002M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR FENDER ,LH	DENTED	836.70	836.70
1	REAR FENDER INNER PANEL (LH)	NOT NECESSARY	728.00	-
1	REAR FENDER REINFORCEMENT ,ROCKER PANEL ,LH	NOT NECESSARY	552.30	-
1	PANEL SUB-ASSY ,REAR DOOR ,LH	DENTED	1,258.30	1,258.30
1	REAR DOOR HINGE UPPER	NOT NECESSARY	82.30	-
1	REAR DOOR HINGE LOWER	NOT NECESSARY	82.30	-
1	REAR DOOR CHECK	NOT NECESSARY	153.00	-
1	REAR DOOR TRIMBOARD	NOT NECESSARY	725.00	-
1	MOTOR ,POWER WINDOW REGULATOR FRT LH	NOT NECESSARY	941.80	-
1	REGULATOR ,FRONT DOOR WINDOW REAR ,LH	NOT NECESSARY	228.40	-
1	DOOR CENTRE PILLAR OUTER (LH)	DENTED	1,590.60	1,590.60
1	DOOR CENTRE PILLAR ENFORCEMENT (LH)	NOT NECESSARY	863.30	-
1	PANEL SUB-ASSY ,FRONT DOOR ,LH	DENTED	1,264.00	1,264.00
1	FRONT DOOR OUTER HANDLE (LH)	CUT	378.90	378.90
1	FRONT DOOR HANDLE BASE	NOT NECESSARY	287.70	-
1	SET FRONT DOOR KEY LOCK	NOT NECESSARY	428.90	-
1	FRONT DOOR WHETHER STRIP	SERVICEABLE	457.90	-
1	FRONT DOOR RUBBER SEAL	CUT / DEFORMED	257.00	257.00
1	MOTOR ASSY ,POWER WINDOW FRT ,LH	NOT NECESSARY	941.80	-
1	REGULATOR ,FRONT DOOR WINDOW FRT ,LH	NOT NECESSARY	228.40	-
1	MIRROR ASSY ,OUTER REAR VIEW ,LH	BROKEN	1,728.70	1,728.70
1	GLASS SUB-ASSY ,FRONT DOOR ,LH	CRACKED	780.50	780.50
1	MOULDING ,DOOR WINDOW ,FRONT LH	BENT	69.20	69.20
1	KEY LOCK ANTENNA	NOT NECESSARY	312.00	-
1	REAR TYRE RIM (LH)	DISTORTED	1,555.00	1,555.00
1	REAR WHEEL HUB CAP (LH)	CUT	177.70	177.70
1	REAR WHEEL BEARING & HUB ASSY	DENTED	610.20	610.20
1	REAR CROSS MEMBER	NOT NECESSARY	2,200.40	-
1	REAR SHOCK ABSORBER	DISTORTED	118.30	118.30
1	REAR SHOCK ABSORBER MOUNTING	NOT NECESSARY	125.30	-
1	REAR LOWER ARM	DISTORTED	497.50	497.50

Report Ref No. CC4/EQI20009551/Dga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR UPPER ARM	DISTORTED	356.80	356.80
1	REAR KNUCKLE ARM	DISTORTED	810.60	810.60
1	REAR COIL SPRING	NOT NECESSARY	191.40	-
1	REAR COIL SPRING MOUNTING	NOT NECESSARY	125.70	-
1	REAR BRAE ABS SENSOR (WIRE)	NOT NECESSARY	278.80	-
1	REAR STABILIZER BAR	NOT NECESSARY	311.50	-
1	REAR STABILIZER LINK	NOT NECESSARY	151.60	-
1	REAR TRAILING ARM	DISTORTED	314.20	314.20
1	REAR ASSIST ARM	DISTORTED	342.20	342.20
1	REAR HEIGHT SENSOR LH ONLY	NOT NECESSARY	789.30	-
1	FENDER SUB-ASSY ,FROTN LH (ADDITIONAL)	DENTED	945.30	945.30
1	FRONT FENDER HYBRID EMBLEM ,LH (ADDITIONAL)	NECESSARY	86.50	86.50
1	FRONT WHEEL RIM RH (ADDITIONAL)	TO REPAIR SEE LABOUR	1,570.55	-
1	FRONT WHEEL HUB BEARING & HUB ASSY (RH) (ADDITIONAL)	DAMAGED	678.50	678.50
1	FRONT SUSPENSION LOWER ARM(RH)(ADDITIONAL)	DISTORTED	631.90	631.90
1	FRONT SHOCK ABSORBER (RH)(ADDITIONAL)	DISTORTED	398.20	398.20
1	ABSORBER TOP MOUNTING (ADDITIONAL)	NOT NECESSARY	196.20	-
1	KNUCKLE STEERING RH (ADDITIONAL)	DISTORTED	580.80	580.80
1	JOINT ASSY ,LOWER BALL,FRONT (RH) (ADDITIONAL)	NOT NECESSARY	199.98	-
1	END SUB-ASSY ,TIE ROD ,RH (ADDITIONAL)	DISTORTED	159.30	159.30
	LESS 20% DISCOUNT		-5,916.15	-
	LESS 25% DISCOUNT		-	-4,106.73
			23,664.58	12,320.17
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT DOOR COMFORT LOGO (SN)	NECESSARY	75.00	75.00
1	FRONT TYRE (RH) (SN) (ADDITIONAL)	NOT NECESSARY	216.00	-
1	REAR DOOR COMFORT & APPS STICKER (SN)	NECESSARY	80.00	80.00
1	REAR TYRE (LH) (SN)	NOT NECESSARY	216.00	-
			587.00	155.00

Report Ref No. CC4/EQI20009551/Dga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF FRONT WHEEL RIM RH .		1,400.00	800.00
	SPRAY PAINTING CHARGE.		1,200.00	800.00
	WIRING CHARGE.	NOT NECESSARY	140.00	-
	TUFF KOTE.		160.00	40.00
	TOWING CHARGE.	NOT NECESSARY	80.00	-
	REMOVE/REFIX CUSHION & UPHOLSTERY REAR .		150.00	80.00
	REMOVE/REFIX UNDERCARRIAGE (RR).		400.00	150.00
	RE-SET REAR ABS SYSTEM.	NOT NECESSARY	400.00	-
	TRANSFER OF DOOR MECHANISM FRONT .		80.00	60.00
	RE-SET FRT POWER WINDOW SYSTEM.	NOT NECESSARY	200.00	-
	TRANSFER OF DOOR MECHANISM REAR.		80.00	60.00
	RE-SET REAR POWER WINDOW SYSTEM.	NOT NECESSARY	200.00	-
	FOUR WHEEL ALIGNMENT .		120.00	60.00
	DIAGNOSTIC & RESETTING TO ERASE FAULT CODE.		550.00	150.00
			5,160.00	2,200.00
	GRAND TOTAL		29,411.58	14,675.17
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			11,700.00

Report Ref No. CC4/EQ120009551/Dga3q2

ANG BRYAN TANI

Automotive Assessor / Investigator

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SH 6002M

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

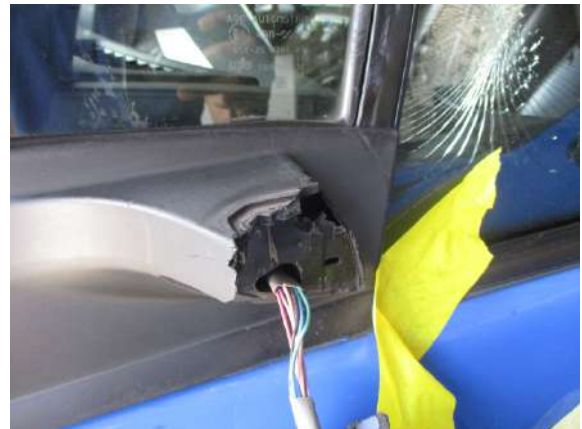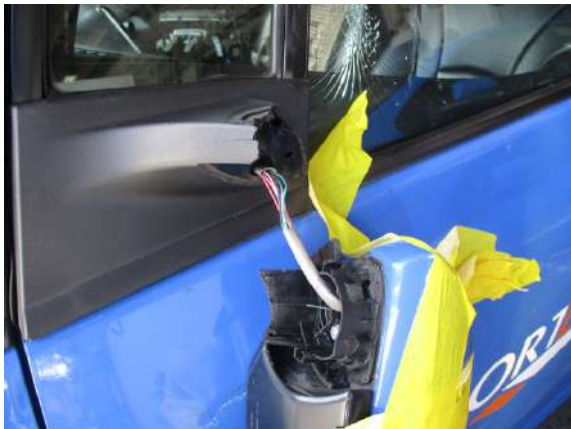



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

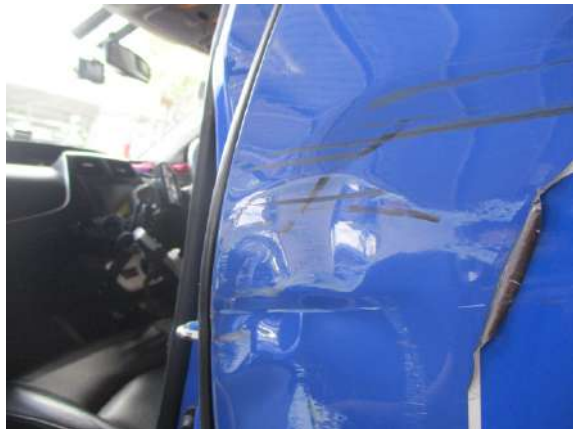



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SH 6002M

RE-INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

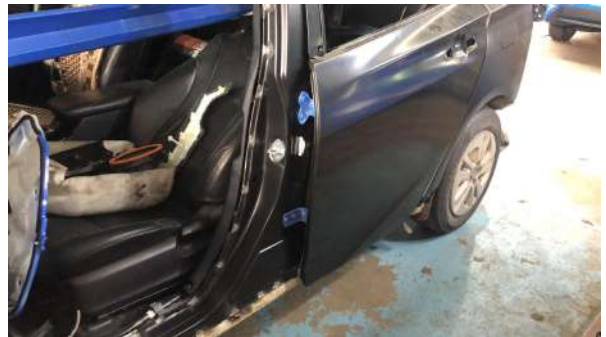



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SH 6002M

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

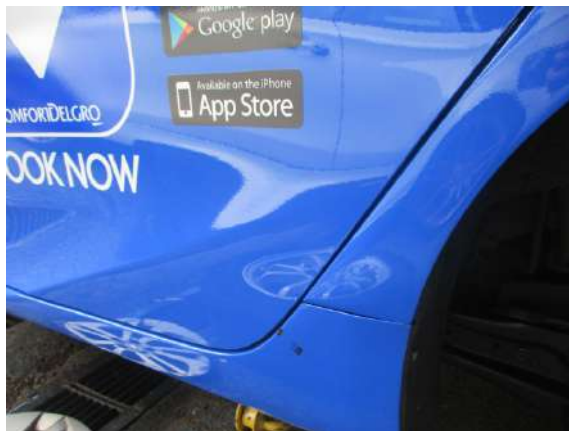




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

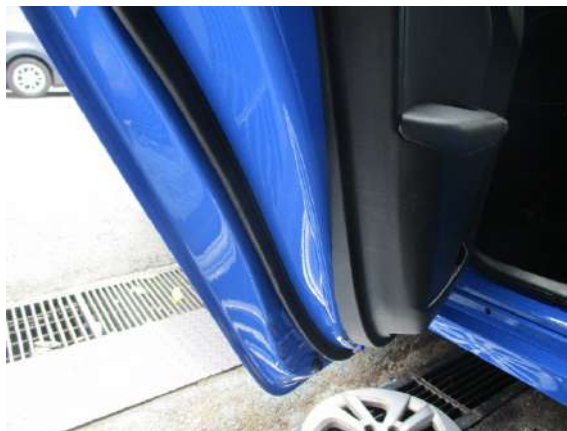



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

