



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

AUTO & GENERAL INSURANCE (S) PL  
(BUDGET DIRECT INSURANCE)  
190 CLEMENCEAU AVENUE #03-01  
SINGAPORE SHOPPING CENTRE  
SINGAPORE 239924

INV No. AC2007867  
INV Date 23/11/2020  
Reference CS/AGI20009588/T1sf3n2  
Code AGI



#### PROFESSIONAL SERVICE FEE

Vehicle No. SJY 8773A  
Insured Veh. SGZ 1325L  
Claim No. C10007211  
Policy No.  
Accident Date 05/09/2020  
Inspection Date 08/09/2020

Description	Total
Survey Inspection	450.00
Resurvey Inspection	
Digital Photographs	
Transportation	
<b>Subtotal</b>	<b>450.00</b>
<b>GST (7%)</b>	<b>31.50</b>
<b>Grand Total</b>	<b>481.50</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

*HYN*



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## Affiliated to Federation Internationale Des Experts En Automobile

AUTO & GENERAL INSURANCE (S) PL

Ref : CS/AGI20009588/T1sf3n2

(BUDGET DIRECT INSURANCE)  
190 CLEMENCEAU AVENUE #03-01  
SINGAPORE SHOPPING CENTRESINGAPORE  
239924

Date : 23-11-2020



Code : AGI

### 1. Policy Particulars :- THIRD PARTY CLAIM

<b>Insured Veh.</b>	SGZ 1325L	<b>Veh. Inspected</b>	SJY 8773A
<b>Policy No.</b>		<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	C10007211	<b>Excess (\$)</b>	0.00
<b>Assign From</b>	IVY RATILLA	<b>Assign Date</b>	08/09/2020

### 2. Vehicle Particulars & Condition

<b>Make &amp; Model</b>	KIA CERATO EX	<b>c.c</b>	1591
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2010
<b>Chassis No.</b>	KNAFU411MA5260299	<b>Colour</b>	GREY
<b>Odometer</b>	245862	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	SPORTS RIM
<b>General</b>	GOOD		

### 3. Conditions of Tyres

	Size	Make	Balance
<b>R/H Front Tyre</b>	205/45 R17	WEST LAKE	6 mm
<b>L/H Front Tyre</b>	205/45 R17	WEST LAKE	6 mm
<b>R/H Rear Tyre</b>	205/45 R17	WEST LAKE	6 mm
<b>L/H Rear Tyre</b>	205/45 R17	WEST LAKE	6 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.  
DAMAGES SEE DETAILS.

### 5. General Information

<b>Accident Date</b>	05/09/2020	<b>Inspection Date</b>	08/09/2020
<b>Survey held at</b>	YI HENG MOTOR WORKSHOP BLK 1 KAKI BUKIT AVE 6 #02-19 SINGAPORE 417883		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.  
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **7 Working Days**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJY 8773A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	BOOT LID	BENT	843.50	843.50
2	BOOT LID REFLECTOR @\$283.00	NOT NECESSARY	566.00	-
1	BOOT LID WEATHERSTRIPE	TWISTED	247.20	198.00
1	BOOT LID BADGE	NECESSARY	48.00	48.00
1	BOOT LID EMBLEM "CERATO"	NECESSARY	52.00	52.00
1	BOOT LID EMBLEM "FORTE"	NECESSARY	52.00	52.00
1	BOOT LID EMBLEM "C&C"	NECESSARY	50.20	50.20
2	BOOT LID STOPPER @\$10.50	NECESSARY	21.00	21.00
2	BOOT LID HINGE @\$247.30	TO REPAIR SEE LABOUR	494.60	-
1	BOOT LID LOCK	BENT	286.00	286.00
1	BOOT LID STRIKER	TO REPAIR SEE LABOUR	32.00	-
1	BOOT LID INNER LINNING	NOT NECESSARY	281.00	-
9	BOOT LID INNER LINNING CLIP @\$6.50	NECESSARY	58.50	58.50
2	TAIL LAMP ASSY @\$386.50	CRACKED	773.00	773.00
2	TAIL LAMP BASE PANEL @\$253.00	TO REPAIR SEE LABOUR	506.00	-
2	TAIL LAMP CLIP @\$10.50	NECESSARY	21.00	21.00
1	REAR BUMPER	DEFORMED	731.00	695.00
1	REAR BUMPER SPONGE	CRACKED	256.00	256.00
8	REAR BUMPER CLIP @\$6.50	NECESSARY	52.00	52.00
2	REAR BUMPER SIDE ATTACHMENT @\$68.00	DEFORMED	136.00	136.00
1	REAR BUMPER LOWER SPOILER	CRACKED	1,321.00	650.00
1	REAR BUMPER REINFORCEMENT	CRACKED	461.00	461.00
2	REAR BUMPER REINFORCEMENT BRACKET @\$171.00	NOT NECESSARY	342.00	-
3	REAR BUMPER REINFORCEMENT PLASTIC BRACKET @\$52.00	NOT NECESSARY	156.00	-
2	REAR BUMPER SPLASH SHIELD @\$78.00	N/S TORN / O/S NOT NECESSARY	156.00	78.00
6	REAR BUMPER SPLASH SHIELD CLIP @\$6.50	N/S NECESSARY / O/S NOT NECESSARY	39.00	19.50

Report Ref No. CS/AGI20009588/T1sf3n2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR END PANEL	BENT	648.00	418.20
1	REAR PANEL INNER GARNISH	DEFORMED	186.00	186.00
1	SPARE TYRE BOARD	NOT NECESSARY	249.00	-
1	SPARE TYRE PANEL	TO REPAIR SEE LABOUR	687.00	-
1	SPARE TYRE NUT	NOT NECESSARY	38.00	-
2	REAR CHASSIS MEMBER @\$601.25	NOT NECESSARY	1,202.50	-
2	REAR FENDER @\$1513.00	TO REPAIR SEE LABOUR	3,026.00	-
2	REAR FENDER INNER BOARD @\$289.30	NOT NECESSARY	578.60	-
10	REAR FENDER INNER BOARD CLIP @\$6.50	NOT NECESSARY	65.00	-
1	REAR WINDSCREEN MOULDING	NOT NECESSARY	151.00	-
	LESS 10% DISCOUNT		-1,481.31	-535.49
			13,331.79	4,819.41
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	REAR LICENCE PLATE (EMBOSS)(SN)	NOT NECESSARY	55.00	-
1	SPARE TYRE PANEL INSULATOR CLOTH (SN)	NOT NECESSARY	350.00	-
1	REAR WINDSCREEN INNERSEAL (SN)	NOT NECESSARY	60.00	-
1	REAR WINDSCREEN GUM (SN)	NOT NECESSARY	60.00	-
			525.00	-
	<b><u>LABOUR</u></b>			
	TO CHECK WIRING SYSTEM.		50.00	30.00
	TO APPLY UNDER SEALING ON AFFECTED AREAS.		120.00	40.00
	TO MOUNT VEHICLE ON CAR O-LINER.		380.00	200.00
	TO REMOVE AND REFIX REAR WINDSCREEN.	NOT NECESSARY	320.00	-
	TO REMOVE AND REFIX PETROL TANK,PIPING SYSTEM,BRACKET AND ETC.	NOT NECESSARY	220.00	-
	TO REMOVE AND REFIX BOOT LID FIXING AND REALIGNMENT.		220.00	60.00
	TO REMOVE AND REFIX REVERSE CAMERA WITH WIRE HARDNESS.		180.00	30.00
	TO REMOVE AND REFIX REAR EXHAUST SILENCER.	NOT NECESSARY	180.00	-
	TO REMOVE AND REFIX CUSHION,FLOOR BOARD,ROOF LINNING,TRIM ,GARNISH,UPHOLSTERY AND ETC.		220.00	60.00

Report Ref No. CS/AGI20009588/T1sf3n2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REPLACE NEW PART,CUT,WELD,KNOCK ETC.INCLUSIVE OF THE REPAIR OF BOOT LID HINGE,BOOT LID STRIKER,TAIL LAMP BASE PANEL,SPARE TYRE PANEL AND REAR FENDER. TO RESPRAY ON EFFECTED AREAS.		4,180.00	1,000.00
			2,200.00	1,200.00
			8,270.00	2,620.00
<b>GRAND TOTAL</b>			<b>22,126.79</b>	<b>7,439.41</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>5,950.00</b>

Report Ref No. CS/AGI20009588/T1sf3n2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJY 8773A

INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

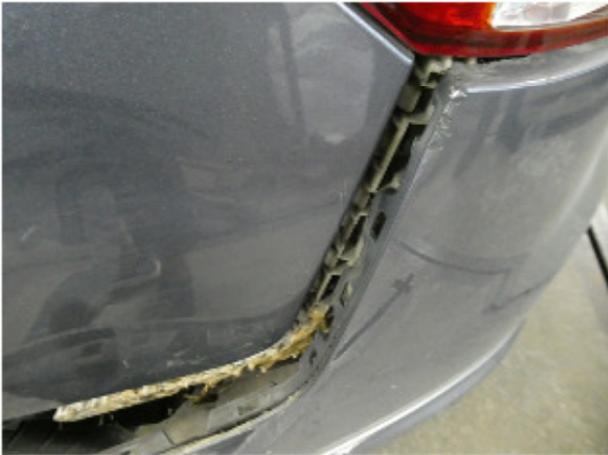



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJY 8773A

RE-INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No. 199607198R GST Reg. No. 19-9607198-R

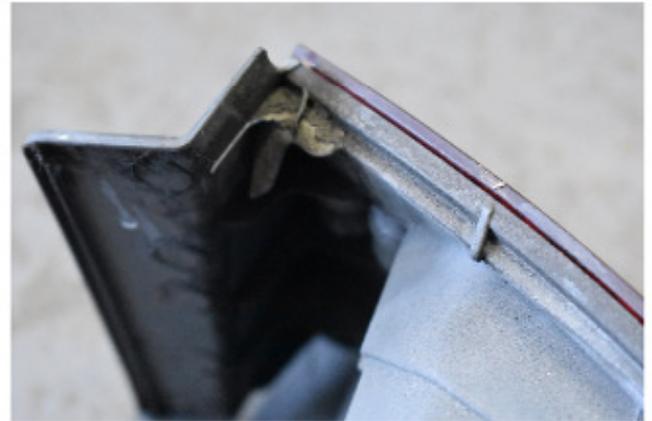



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

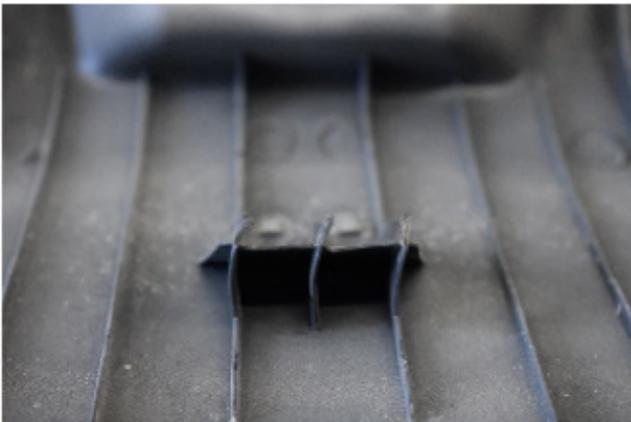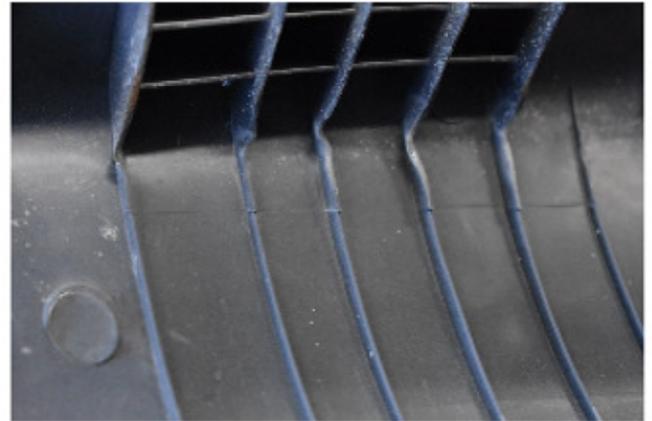



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

