



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2101200

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 26/02/2021
Reference CC4/FCI20009618/R1ga3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. YN 9679M
Insured Veh. SHB 3323T
Claim No. D20003574MFSH/1
Policy No. D-20094921MFSH
Accident Date 04/09/2020
Inspection Date 08/09/2020

Description	Total
Survey Inspection	317.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	317.00
GST (7%)	22.19
Grand Total	339.19

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSESINGAPORE 068877

Ref: CC4/FCI20009618/R1ga3q2

Date: 26/02/2021

Code: FCI2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHB 3323T	Veh. Inspected	YN 9679M
Policy No.	D-20094921MFSH	Coverage (\$)	0.00
Claim No.	D20003574MFSH/1	Excess (\$)	0.00
Assign From	MERINA CHIA	Assign Date	08/09/2020

2. Vehicle Particulars & Condition

Make & Model	MITSUBISHI CANTER FEB21	c.c	2998
Engine No.	HIDDEN	Year of Reg.	2015
Chassis No.	FEB21EA10742	Colour	WHITE
Odometer	131448 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	FAIR		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/85 R15	BRIDGESTONE	7 mm
L/H Front Tyre	195/85 R15	BRIDGESTONE	7 mm
R/H Rear Tyre	195/85 R15 (D)	BRIDGESTONE	7/7 mm
L/H Rear Tyre	195/85 R15 (D)	BRIDGESTONE	7/7 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	04/09/2020	Inspection Date	08/09/2020
Survey held at	15 FAN YONG ROAD		
Repairer	MOVA AUTOMOTIVE PTE LTD		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **7 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. YN 9679M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BUMPER	BENT	1,230.00	1,230.00
1	FRONT BUMPER BRACKET LH	NOT NECESSARY	480.00	-
1	FRONT BUMPER COVER LH	CRACKED	380.00	380.00
1	FRONT GRILLE ASSY	NOT NECESSARY	679.00	-
1	HEADLAMP LH	BROKEN	485.00	485.00
1	SIDE LAMP LH	BROKEN	210.00	210.00
1	SIGNAL LAMP LH	BROKEN	210.00	210.00
1	FRONT CORNER PANEL LH	NOT NECESSARY	350.00	-
1	FRONT DOOR LH	BENT	2,100.00	2,100.00
2	FRONT DOOR HINGE LH	BENT	260.00	260.00
1	FRONT DOOR CHECKER LH	NOT NECESSARY	130.00	-
1	FRONT DOOR RUBBER LH	NECESSARY	290.00	290.00
1	FRONT STEP PANEL LH	CRACKED	430.00	430.00
	LESS 25% DISCOUNT		-1,808.50	-1,398.75
			5,425.50	4,196.25
<u>SPECIAL NETT ITEMS</u>				
1	LH FRONT DOOR COMPANY STICKER (SN)	NECESSARY	150.00	100.00
1	TO REPLACE LH SIDE REINORCEMENT (SN)	TO REPAIR SEE LABOUR	800.00	-
1	LH SIDE TAILBOARD COMPANY STICKER (SN)	NECESSARY	600.00	400.00
			1,550.00	500.00
<u>LABOUR</u>				
	TO INSPECT FRONT LIGHTING WATER & LEAKAGE TEST.		40.00	40.00
	TO REMOVE & TRANSFER ITEMS TO NEW LH FRONT DOOR .		100.00	60.00
	TO STRAIGHTEN LH FRONT DOOR PILLAR AND RENEW DAMAGED PARTS.INCLUSIVE OF THE REPAIR OF TO REPLACE LH SIDE REINORCEMENT .		1,000.00	800.00
	TO APPLY RUST PROOF ON AFFECTED AREAS.		40.00	40.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO SPRAY PAINT ON REPLACED ,REPAIRED AREAS.		1,000.00	800.00
			2,180.00	1,740.00
GRAND TOTAL			9,155.50	6,436.25
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,150.00

Report Ref No. CC4/FCI20009618/R1ga3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. YN 9679M

INSPECTION








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

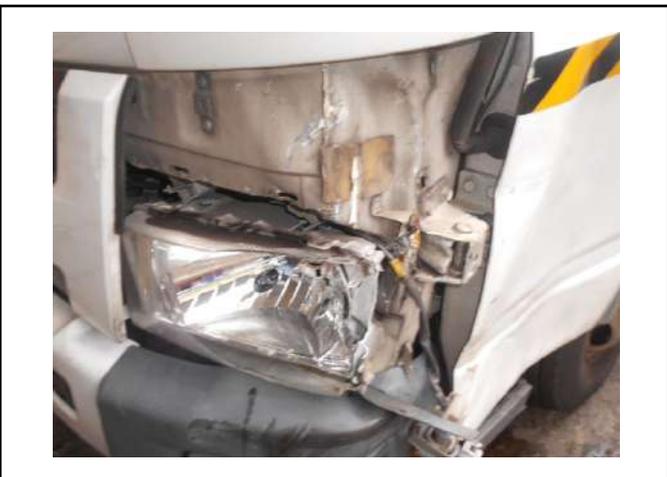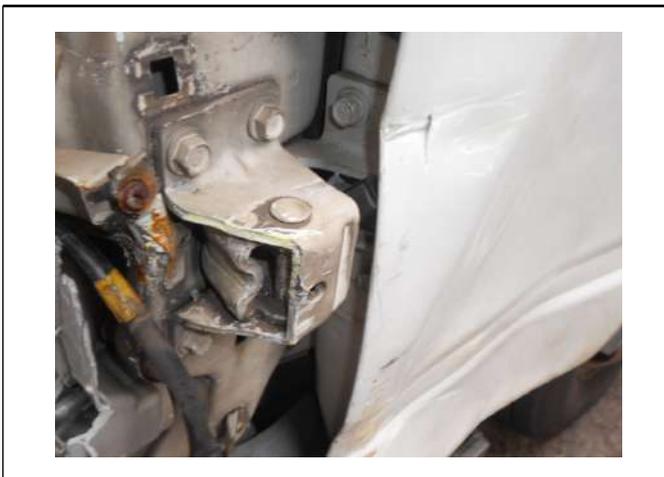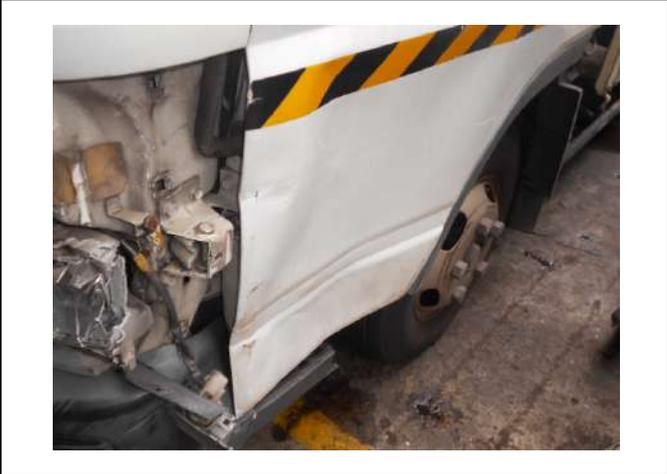



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

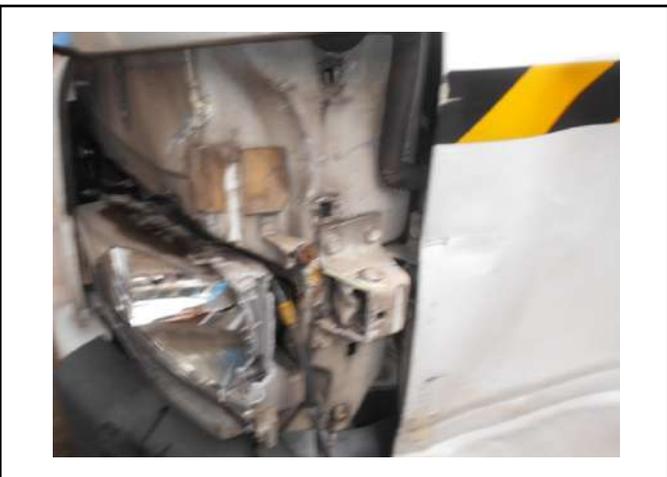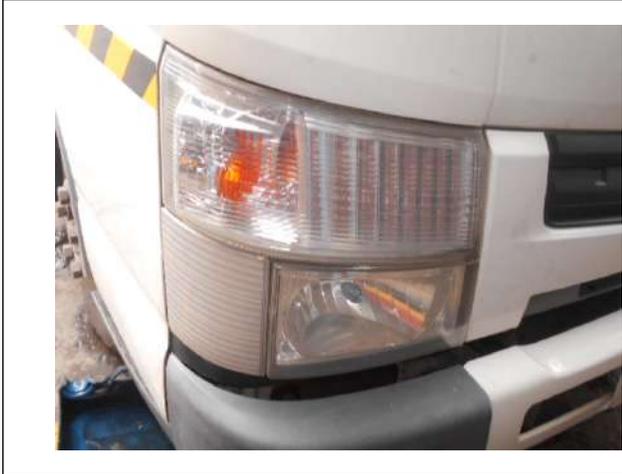



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. YN 9679M

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

