



Messer

FBG 6804 y

No: 2406

No: 2406

I/C No: _____ Tel / Hp: _____

Date _____

27/3/2019

總計
TOTAL \$

13,000-00	
-----------	--

收貨人 *Received by*

經手人 Issued by



LEE APPRAISAL SERVICES

220A Sumang Lane #06-75 (S)821220

Business Reg. No.: 53387981K

Tel: 9101 7844

Fax: 6996 6442

Email: dylanlee.as@gmail.com

Loss Adjuster, Automotive Inspection, Evaluation & Consultation

Our Reference : TP/1812/FBG6804Y/SW

VEHICLE APPRAISAL REPORT

Mr Sim Chee Wee

Report Date : 26 Mar 2019

452B Sengkang West Way #17-405

Fernvale Foliage, Singapore 792452

REFERENCE

Your Reference No	: Not Advised	Date of Inspection	: 31 Dec 2018
Type of Appraisal	: Third Party	Date of Re-inspection 1	: 24 Jan 2019
Date of Accident	: 15 Dec 2018	Date of Re-inspection 2	: 25 Mar 2019

PARTICULARS OF VEHICLE

Registration No.	: FBG6804Y	First Registration Date	: 15 Oct 2012
Make	: Honda	COE Expiry	: 14 Oct 2022
Model	: FJS400D	Odometer	: Damaged
Color	: White	Chassis No.	: JH2NF03979K000102
Manufacturing Year	: 2012	Engine No	: NF01E5221469

CONDITIONS OF VEHICLE (STATIC CHECK AT TIME OF INSPECTION ONLY)

Front Brake	: Serviceable	Steering	: Distorted
Rear Brake	: Serviceable	Modification	: None

TYRE / CONDITION

<u>Location</u>	<u>Make</u>	<u>Size</u>	<u>Thread</u>
Front	Timsun	120/70 R14	7 mm
Rear	Timsun	150/70 R13	7 mm

DAMAGE PROFILE

The vehicle sustained damages on all sides.

Please refer to photographs and assessment of repairs for details.

ASSESSMENT SUMMARY

Repair cost to the vehicle is assessed as **\$13,000.00** on **lump sum basis**

Estimated period required for repairs: **(10) days**

Survey conducted at: **Speedy Motor Cycle Service Centre**

Enclosed (83) photographs depicting damage to the vehicle

The survey was conducted on a *WITHOUT PREJUDICE* basis.



LEE APPRAISAL SERVICES

220A Sumang Lane #06-75 (S)821220

Business Reg. No.: 53387981K

Tel: 9101 7844

Fax: 6996 6442

Email: dylanlee.as@gmail.com

Loss Adjuster, Automotive Inspection, Evaluation & Consultation

Our Reference : TP/1812/FBG6804Y/SW

ASSESSMENT FOR REPAIR : FBG6804Y

Qty	Description	Condition	Repairer's Estimate	Our Assessment
1 pc	Handle bar	Bent	152.00	152.00
2 pcs	Handle bar balancer @35.00	Cut / Grazed	70.00	70.00
1 pc	Handle bar lever LH	Cut	18.00	18.00
1 pc	Handle bar lever RH	Usable	20.00	~
2 pcs	Mirror complete @95.00	LH Grazed	190.00	95.00
1 pc	Handle bar cover	Warped	135.00	135.00
2 pcs	Handle bar lower cover @23.00	Warped	26.00	26.00
1 pc	Handle bar post cover	Torn	30.00	30.00
1 pc	Combination meter assy	Button Broken	1,444.00	1,444.00
1 pc	Meter front panel	Warped	80.00	80.00
1 pc	Meter rear panel	Warped	154.00	154.00
1 pc	Windscreen	Cracked	756.00	756.00
1 pc	Windscreen moulding	Necessary	24.00	24.00
1 pc	Windscreen mark, HONDA	Necessary	28.00	28.00
1 pc	Windscreen garnish cover	Missing	391.00	391.00
1 pc	Front cover assy	Cracked	523.00	523.00
1 pc	Front cover stay	Bent	514.00	514.00
2 pcs	Headlight unit @842.00	Hldr Broken / Cut	1,684.00	1,684.00
2 pcs	Front winker complete @289.00	Broken / Missing	578.00	578.00
2 pcs	Fork assy @940.00	Repair	1,880.00	~
1 pc	Front fender	Grazed - Respray	276.00	~
1 pc	Front lower cover	Cut	142.00	142.00
1 pc	Front air cover	Cut	83.00	83.00
2 pcs	Inner upper cover @155.00	Missing / Deformed	310.00	310.00
1 pc	Inner lower cover	Torn	470.00	470.00
2 pcs	Inner pocket lid @44.00	Torn / Deformed	88.00	88.00
2 pcs	Outer pocket lid @45.00	Torn / Deformed	90.00	90.00
2 pcs	Pocket seal @12.00	Necessary	24.00	24.00
1 pc	Maintenance plug lid	Warped	36.00	36.00
2 pcs	Floor side panel @522.00	Cut / Cracked	1,044.00	1,044.00
2 pcs	Floor step complete @159.00	Cut / Cracked	318.00	318.00
2 pcs	Floor mat @145.00	RH Deformed	290.00	145.00
2 pcs	Floor stay complete @201.00	Bent	402.00	402.00
2 pcs	Floor skirt @191.00	Cut	382.00	382.00
1 pc	Floor under cover	Deformed	110.00	110.00
2 pcs	Pillion step holder @290.00	RH Cut	580.00	290.00
2 pcs	Pillion step assy @151.00	Cut	302.00	302.00
1 pc	Side stand complete	Usable	114.00	~
1 pc	Main stand complete	Bent	325.00	325.00
2 pcs	Body rear side cover set @471.00	LH Cut / RH Repair	942.00	471.00
2 pcs	Emblem, SW-T400 @96.00	Necessary	192.00	192.00
1 pc	Swingarm case complete, RH	Cut	795.00	795.00
1 pc	Drive rear outer cover complete, LH	Cut	301.00	301.00
1 pc	Drive rear outer cover emblem	Necessary	28.00	28.00
1 pc	Drive front cover assy	Usable	253.00	~



LEE APPRAISAL SERVICES

220A Sumang Lane #06-75 (S)821220

Business Reg. No.: 53387981K

Tel: 9101 7844

Fax: 6996 6442

Email: dylanlee.as@gmail.com

Loss Adjuster, Automotive Inspection, Evaluation & Consultation

Our Reference : TP/1812/FBG6804Y/SW

1 pc	Exhaust muffler complete	Dented	1,759.00	1,759.00
1 pc	Muffler protector	Cut / Dented	291.00	291.00
1 pc	Muffler inner guard	Bent	66.00	66.00
1 pc	Muffler tail cover assy	Bent	101.00	101.00
1 pc	Muffler tail cover stay complete	Bent	142.00	142.00
			<u>18,953.00</u>	<u>15,409.00</u>
			Less 10%	
			<u>1,895.30</u>	<u>1,540.90</u>
			<u>17,057.70</u>	<u>13,868.10</u>

Special Nett Items

2 pcs	Front number plate	Necessary	30.00	25.00
1 set	Steering cone & bearing	Necessary	180.00	150.00
1 pc	Rear top box	Broken	600.00	550.00
1 pc	Rear rack	Bent	150.00	120.00
			<u>960.00</u>	<u>845.00</u>

Total Parts 18,017.70 14,713.10

Labour Charges

1	Towing fee	80.00	60.00
2	Spray painting body covers and damaged areas	800.00	750.00
3	Repair and align body frame. Align front steering	350.00	300.00
4	Workmanship to repair & renew damaged areas	500.00	450.00
		<u>1,730.00</u>	<u>1,560.00</u>

Total Parts & Labours Concluded 19,747.70 16,273.10

Lump Sum Repair Adjustment 13,000.00

ADJUSTMENT/RECOMMENDATIONS


We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle. We have listed the breakdown of our findings and our recommendations as per assessment above.

Yours faithfully,
LEE APPRAISAL SERVICES






Lee Kah Pang


Dip Mech Engr, BCompSc

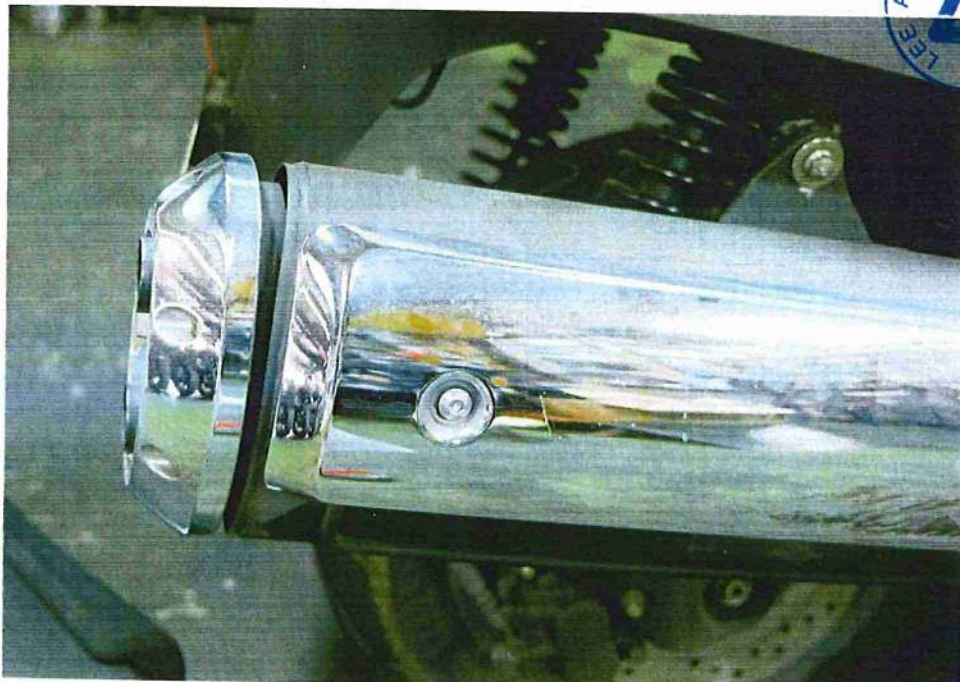





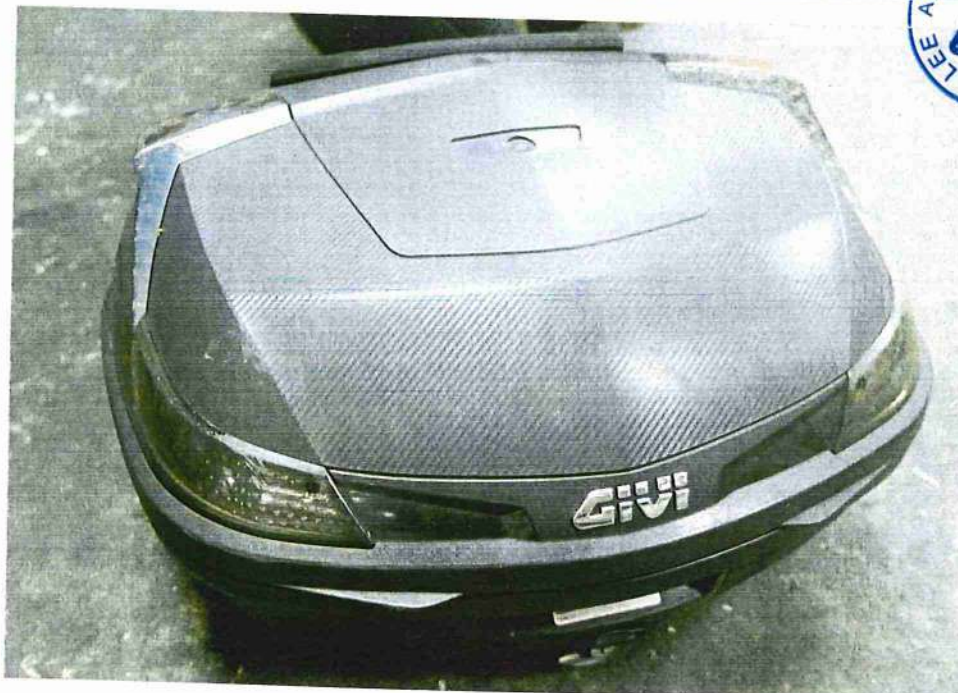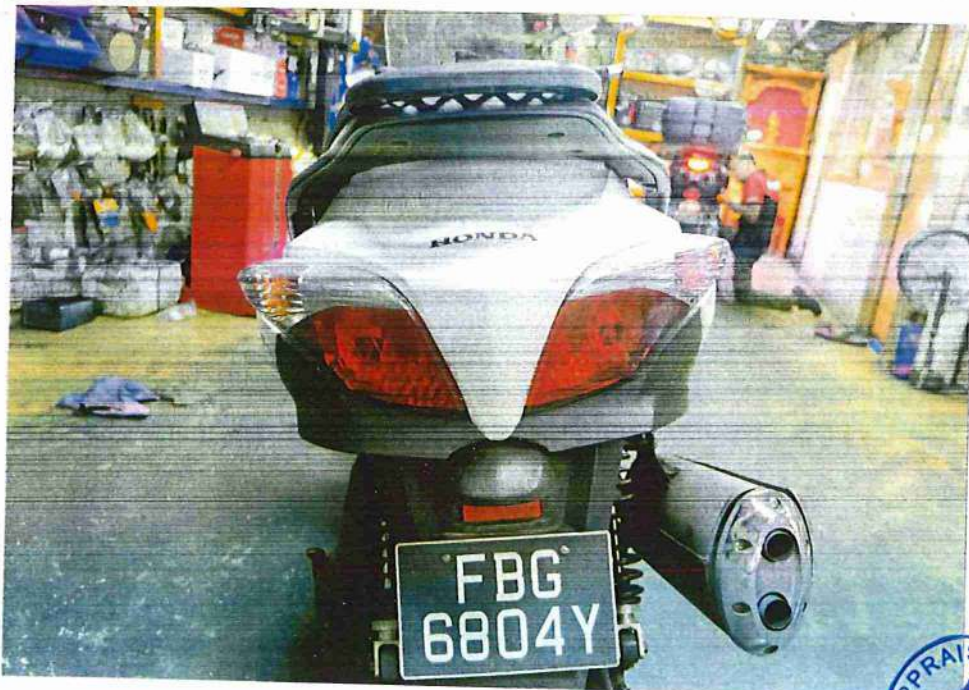


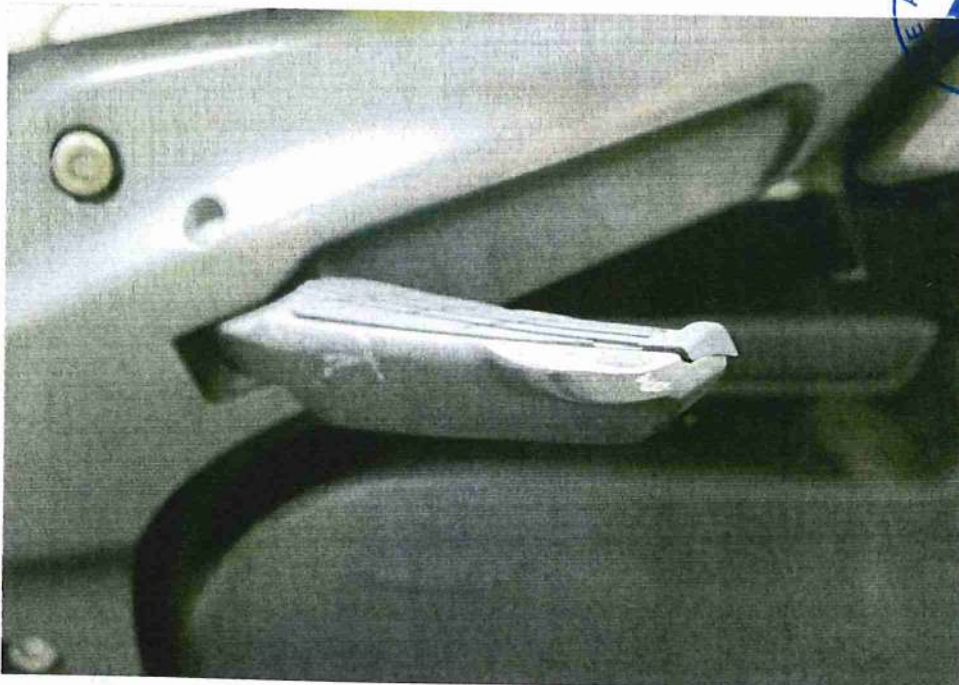


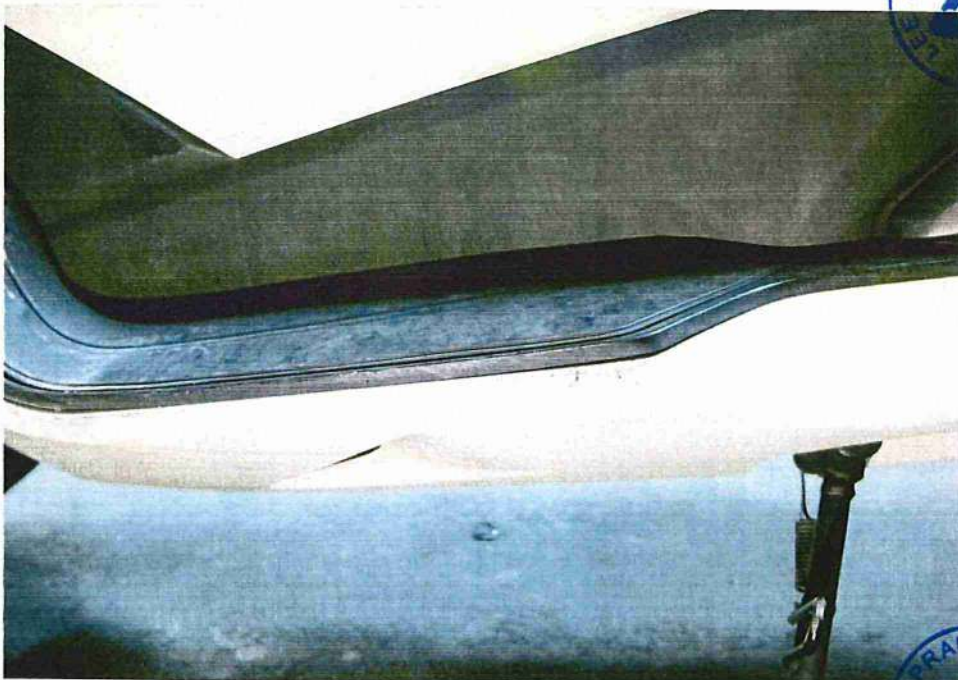

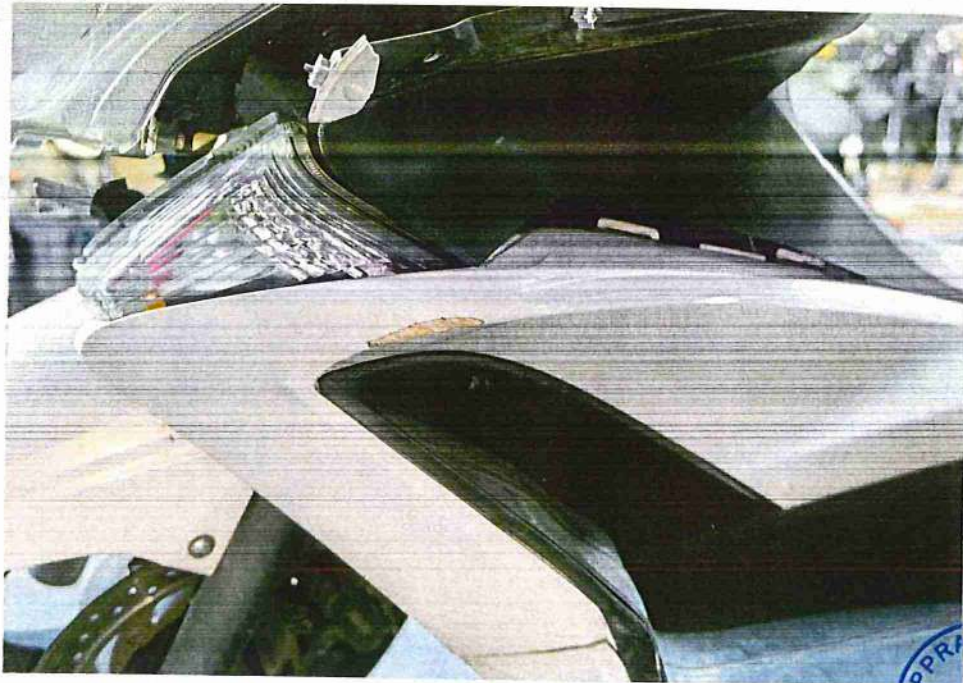

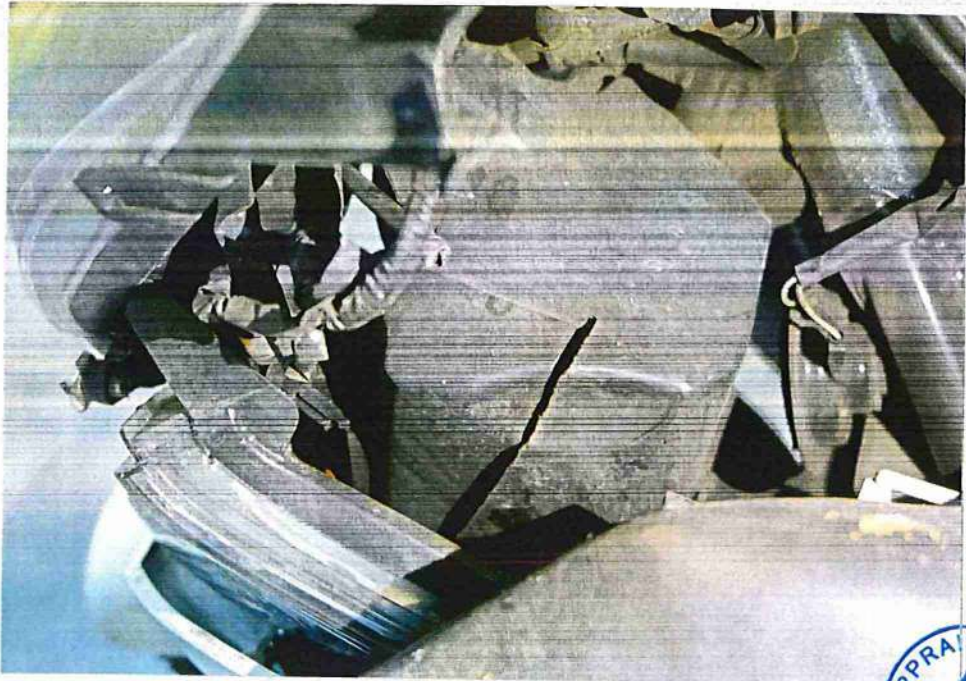


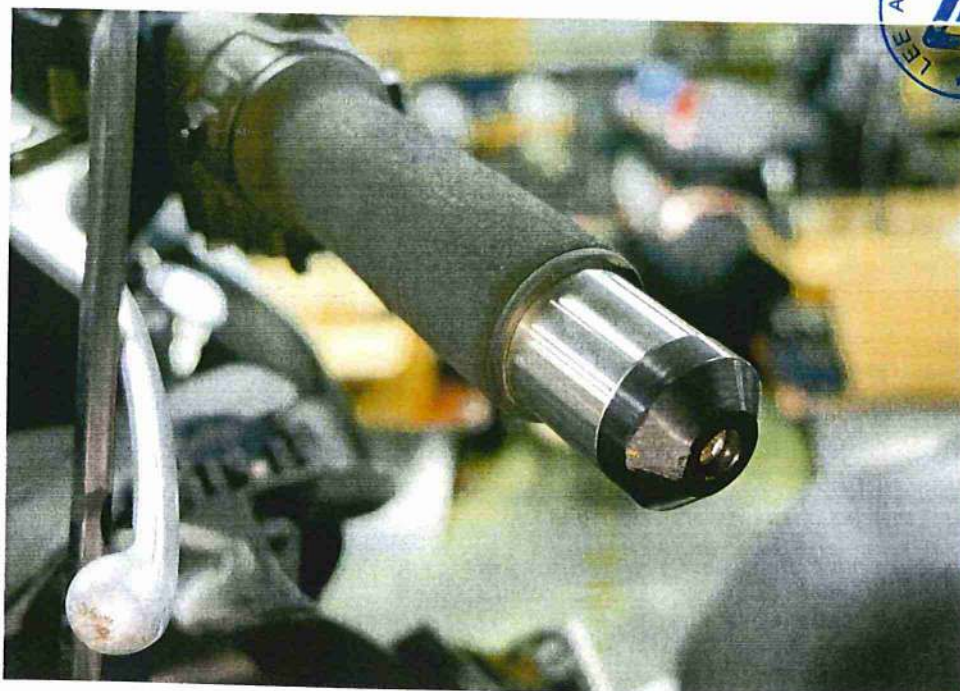

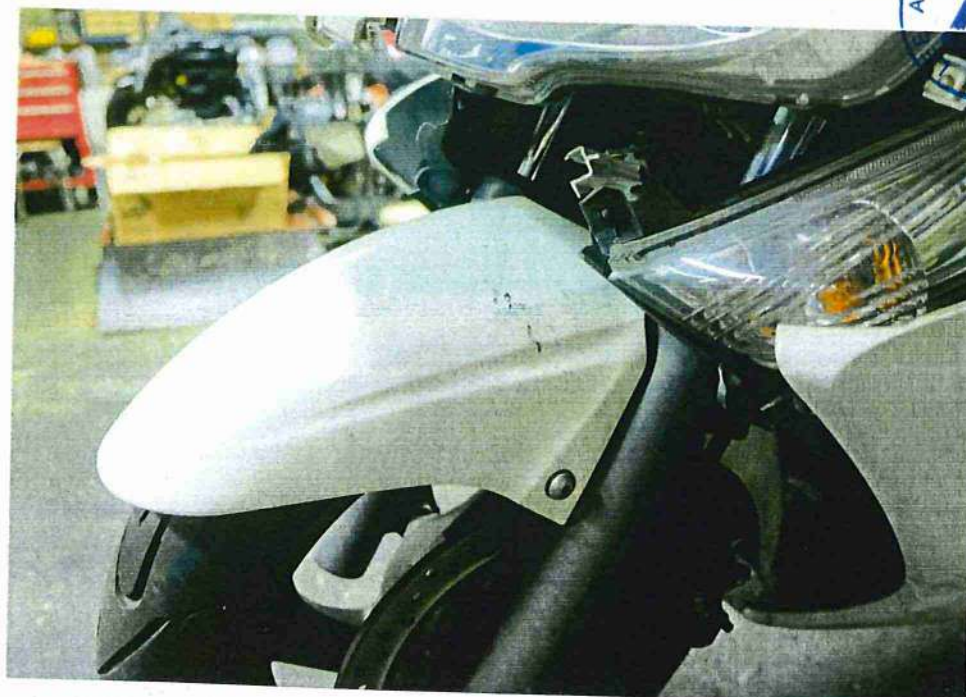



Re-Survey

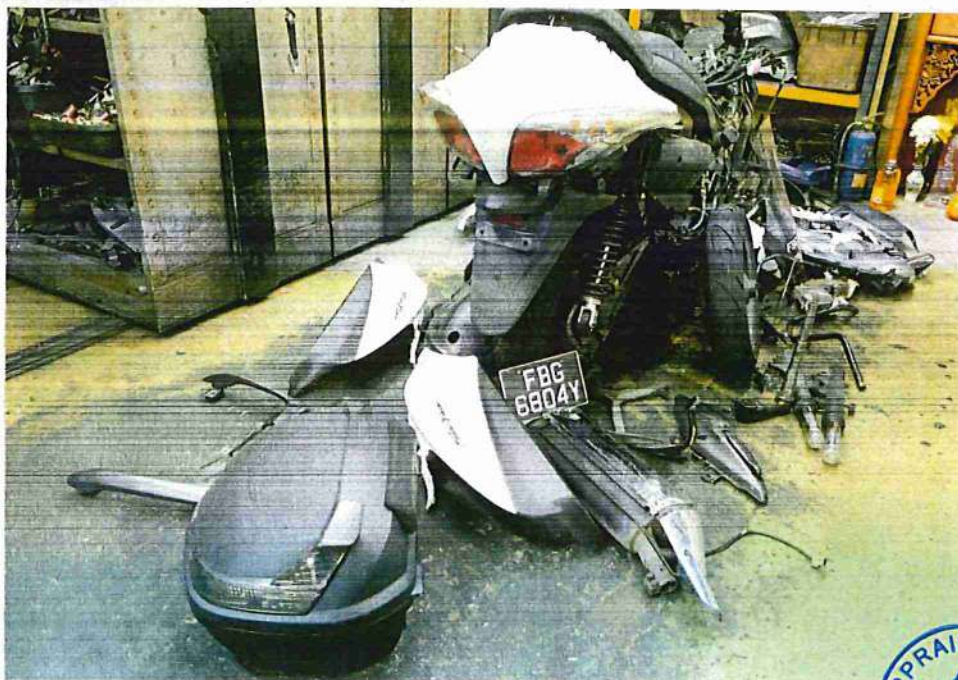

Re-Survey

