


ASS. REQ. BY: Sun Pin REF: NTUC NS/INC20009961/Qsf3

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No. _____
 Claims No. MT/1103401-002
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

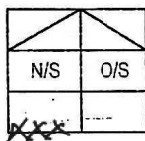

Bal. or Market Value: _____
 IDAC Accident Report: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: _____ days Res.: Yes or No
 Lum Sum: _____ % 3 Val.: Yes or No
 CA / REV / REP. / 24 HRS
 Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SHF 365X Yr Regn: 19/12/2017
 Type: M.Car / M.Cycle / Bus / Van / Lorry (Taxi) Prime Mover /
 Truck / Trailer or _____
 Make: Toyota Prius 4 c.c. 1796
 Colour: Maroon A/C: Insured / Std / NI / NA
 Sp. Reading: 348729 T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: JTDKB3F4803578442
 Gen. Cond: Good / (Fair) Poor / Burnt
 Steering: (In order) / Jammed / Leaked / Burnt or _____
 Brake: (In order) / Jammed / Leaked / Burnt or _____
 Mod: NII / S/RIM / STD A/RIM or _____
 Tyre Size: F: 195/65 R15
 R: 195/65 R15
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or Sailun
 Front: _____ Rear: _____
 R/Bal. 6 mm R/Bal. 6 mm
 L/Bal. 6 mm L/Bal. 6 mm
 D.O.A. 14/09/2020 D.O.I. 15/09/2020
 Survey held at SMRT
 Des. of Damages : Frt (Rear) / O/S / N/S / U/C / Rooftop or
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	SUN PIN CONFIRMED L/S \$ 1,250.00/2 DAYS WITH POH SUAN
	(\$ 5,648.59/RED - 82%)

Date/Time, File Pass to? 30/10/2020
 1) TYPIST
 Date/Time, File Return to?
 2) _____

☐ : Preli. Report
☒ : Final Report

Days Of Repair: 2
 Resurvey No. of Trip: 1

Add Fee: ☐ : Site Insp (\$ _____)
☐ : Interview (\$ _____)
☐ : Tech. Invs (\$ _____)
☐ : Weekend (\$ _____)

Survey Fee: _____
 Transportation: _____
 S+RS, SI _____
 Photos _____
 Others _____
 TOTAL _____

Report Format : _____
Lump Sum / I.B.I: (\$ L/S \$ 1,250.00)



Case Details

Case Reference Number :
TAX/09/20/2035

Type of Repair : Accident Repair

Vehicle Registration Number : SHF365X

Company Type : SMRT Taxis Pte Ltd

Estimation ID : EST-12622-ID

Assigned By : Taxi Claims Manager
Team

Insurance Company Name : NTUC Income Insurance Co-operative
Ltd

Accident Date and Time : 14/09/2020 11:30 AM

Vehicle Age(In Months) : -

Documents / Photographs

[View Documents / Photographs](#)

Total Documents: 0

Estimation Details

Spare Part's Cost Detail

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			COVER, RR BUMPER ASSY	1	423.90	423.90	25.00	317.92	Replace	1	0	Repair	✓ X R
One Time Key In	Main			REAR BUMPER REINFORCEMENT	1	318.80	318.80	25.00	239.10	Replace	0	0	Check	✓ X Svc
One Time Key In	Main			PAD, RR BUMPER, RH & LH, 1	1	3.80	3.80	25.00	2.85	Replace	0	0	Not Give	✓ X Svc
One Time Key In	Main			PAD, RR BUMPER, RH & LH, 2	1	3.80	3.80	25.00	2.85	Replace	0	0	Not Give	✓ X Svc
One Time Key In	Main			PAD, RR BUMPER, RH & LH, 3	1	3.80	3.80	25.00	2.85	Replace	1	0	Old Dam	✓ X Svc
One Time Key In	Main			SEAL, RR BUMPER ARM, RH & LH	1	11.00	11.00	25.00	8.25	Replace	0	0	Not Give	✓ X Svc
One Time Key In	Main			STOPPER, RR BUMPER, RH & LH	1	4.30	4.30	25.00	3.22	Replace	0	0	Not Give	✓ X Svc
One Time Key In	Main			RETAINER, RR BUMPER, RH	1	112.70	112.70	25.00	84.53	Replace	0	0	Not Give	✓ X Svc
One Time Key In	Main			RETAINER, RR BUMPER, LH	1	111.50	111.50	25.00	83.63	Replace	0	0	Not Give	✓ X Svc

Total Spare Part Cost 5,434.43

Lump Sum Discount (%) 20.00

Final Spare Part Cost 4,347.54

Surveyor Total 718.72

Lump Sum Dis (%) 20

Final Sur Total 574.98

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			SEAL, RR BUMPER, RH	1	85.20	85.20	25.00	63.90	Replace	0	0	Not Give	✓ X SVC
One Time Key In	Main			SEAL, RR BUMPER, LH	1	85.20	85.20	25.00	63.90	Replace	0	0	Not Give	✓ X SVC
One Time Key In	Main			CLIPS PIECE, FRT & RR BUMPER	10	1.50	15.00	25.00	11.25	Replace	0	0	Not Give	✓ X SVC
One Time Key In	Main			GUARD, RR BUMPER, LOWER	1	558.30	558.30	25.00	418.72	Replace	1	418.73 418.72	Replace	✓ / CR4
One Time Key In	Main			FILLER, RR BUMPER, RH	1	119.90	119.90	25.00	89.93	Replace	0	0	Not Give	✓ X SVC
One Time Key In	Main			FILLER, RR BUMPER, LH	1	119.90	119.90	25.00	89.93	Replace	0	0	Not Give	✓ X SVC
One Time Key In	Main			COVER, GUARD RR BUMPER LOWER	1	14.80	14.80	25.00	11.10	Replace	0	0	Not Give	✓ X SVC
One Time Key In	Main			PAD, RR BUMPER, CTR	3	2.20	6.60	25.00	4.95	Replace	0	0	Not Give	✓ X SVC
One Time Key In	Main			PIXEL STICKER	2	60.00	120.00	0.00	120.00	Replace	2	120.00	Replace	✓ / NEC
One Time Key In	Main			SENSOR REVERSE	1	180.00	180.00	0.00	180.00	Replace	1	180.00	Replace	✓ / short
One Time Key In	Main			LENS & BODY, REAR COMBINATION LAMP, RH	1	438.10	438.10	10.00	394.29	Replace	0	0	Not Give	✓ X SVC
One Time Key In	Main			LENS & BODY, REAR COMBINATION LAMP, LH	1	438.10	438.10	10.00	394.29	Replace	0	0	Not Give	✓ X SVC
One Time Key In	Main			LENS & BODY ASSY, RR BUMPER, RH	1	486.80	486.80	10.00	438.12	Replace	0	0	Check	✓ X SVC
One Time Key In	Main			LENS & BODY ASSY, RR BUMPER, LH	1	486.80	486.80	10.00	438.12	Replace	0	0	Check	✓ X SVC
One Time Key In	Main			COVER, REAR FLOOR UNDER, RH	1	169.50	169.50	25.00	127.13	Replace	0	0	Not Give	✓ X SVC

Total Spare Part Cost 5,434.43

Surveyor Total 718.72

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 4,347.54

Final Sur Total 574.98

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			COVER, REAR FLOOR UNDER, LH	1	234.30	234.30	25.00	175.73	Replace	0	0	Check	✓ X Svc
One Time Key In	Main			COVER, REAR FLOOR UNDER CENTER	1	222.60	222.60	25.00	166.95	Replace	0	0	Check	✓ X Svc
One Time Key In	Main			SPOILER SUB-ASSY, REAR	1	1,322.10	1,322.10	25.00	991.57	Replace	0	0	Not Give	✓ X Svc
One Time Key In	Main			END PANEL SUB-ASSY, BODY LOWER BACK	1	629.80	629.80	25.00	472.35	Replace	0	0	Check	✓ X Svc
One Time Key In	Main			SEALANT SIKAFLEX	1	37.00	37.00	0.00	37.00	Replace	0	0	Not Give	✓ X Svc
Total Spare Part Cost									5,434.43	Surveyor Total 718.72				
Lump Sum Discount (%)									20.00	Lump Sum Dis (%) 20				
Final Spare Part Cost									4,347.54	Final Sur Total 574.98				

Labour's Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPAIR REAR PORTION	507.00	200	✓
Total:			507.00	200.00	

Spray Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO RESPRAY REAR BUMPER	378.00	200	✓
2	Main	TO RESPRAY BUMPER BEAM	180.00	0	
3	Main	TO RESPRAY FILLER RR BUMPER LH	180.00	0	
4	Main	TO RESPRAY FILLER RR BUMPER RH	180.00	0	
5	Main	TO RESPRAY REAR SPOILER	180.00	0	
6	Main	TO RESPRAY REAR PANEL	180.00	0	
Total:			1,278.00	200.00	

Other Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	30	/
2	Main	TO REPLACE SUNDRY PARTS	100.00	0	
3	Main	TO CHECK WIRING AND SYSTEM FUNCTION	80.00	20	/
4	Main	TO WASH AND VACUUM	60.00	0	
Total:			360.00	50.00	

Summary

	Estimator Assesment(\$)	Surveyor Assesment(\$)
Total Spare Part Detail	4,347.54	574.98
Total Labour Cost	507.00	200.00
Total Spray Painting	1,278.00	200.00
Other	360.00	50.00
Overall Total	6,492.54 6,898.59	1,024.98
Lump Sum Repair Option		☒
Lump Sum Total	6,500.00	1,000.00
Surveyor Approved Amount		1,000.00
No of Repair Days*	5	2
Remarks		L/S, after paint photo.
Surveyor Name		Sun Pin (LKK)
Signature		

2 days.

Survey Date:

LKK Auto Consultants hence notify

the Repairer of the following:

15/09/2020

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Save

Clear

	5256547900	FILLER, RR BUMPER , RH	0.00	\$119.90	0.00	\$0.00	Replace	Not Given X
	5256647900	FILLER, RR BUMPER , LH	0.00	\$119.90	0.00	\$0.00	Replace	Not Given X
	5216947020	COVER, GUARD RR BUMPER LOWER	0.00	\$14.80	0.00	\$0.00	Replace	Not Given X
	5246147010	PAD, RR BUMPER, CTR	0.00	\$2.20	0.00	\$0.00	Replace	Not Given X
		PIXEL STICKER	2.00	\$50.00	0.00	\$120.00	Replace	Replace ✓
		SENSOR REVERSE	1.00	\$180.00	0.00	\$180.00	Replace	Replace ✓
	8155147281	LENS & BODY, REAR COMBINATION LAMP , RH	0.00	\$438.10	0.00	\$0.00	Replace	Not Given X
	8156147151	LENS & BODY, REAR COMBINATION LAMP , LH	0.00	\$438.10	0.00	\$0.00	Replace	Not Given X
	8158147010	LENS & BODY ASSY , RR BUMPER , RH	0.00	\$486.80	0.00	\$0.00	Replace	Check X
	8159147010	LENS & BODY ASSY , RR BUMPER , LH	0.00	\$486.80	0.00	\$0.00	Replace	Check X
	5839847050	COVER, REAR FLOOR UNDER , RH	0.00	\$169.50	0.00	\$0.00	Replace	Not Given X
	5839947030	COVER, REAR FLOOR UNDER , LH	0.00	\$234.30	0.00	\$0.00	Replace	Check X
	6625947010	COVER, REAR FLOOR UNDER CENTER	0.00	\$222.60	0.00	\$0.00	Replace	Check X
	7608547916	SPOILER SUB-ASSY, REAR	0.00	\$1,322.10	0.00	\$0.00	Replace	Not Given X
	5830747090	END PANEL SUB-ASSY, BODY LOWER BACK	0.00	\$629.80	0.00	\$0.00	Replace	Check X
		SEALANT SIKAFLEX	0.00	\$37.00	0.00	\$0.00	Replace	Not Given X
Total				\$6,685.70		\$718.73		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
		5202347030	REAR BUMPER REINFORCEMENT	1.00	\$318.80	25.00	\$239.10	Replace	Replace ✓
		6625947010	COVER, REAR FLOOR UNDER CENTER	1.00	\$222.60	25.00	\$166.95	Replace	Replace ✓
Total					541.40		406.05		

BT SUPP
CRA SUPP

1124.78 /
+ 200.00 /
+ 250.00 /

1574.78 /
- 202

1259.83 ✓
Ls \$1250/-

2 days