



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2103186

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 07/05/2021
Reference CC6/CTI20010121/Ara3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SGR 6118C
Insured Veh. SLD 72D
Claim No. SNM20D203426/LKKDS
Policy No. DMPCSN3116641903
Accident Date 16/09/2020
Inspection Date 18/09/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI20010121/Ara3q2 Date: 07/05/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLD 72D	Veh. Inspected	SGR 6118C	
Policy No.	DMPCSN3116641903	Coverage (\$)	0.00	
Claim No.	SNM20D203426/LKKDS	Excess (\$)	0.00	
Assign From		Assign Date	18/09/2020	
2. Vehicle Particulars & Condition				
Make & Model	SEAT TARRACO	c.c	1395	
Engine No.	HIDDEN	Year of Reg.	2020	
Chassis No.	VSSZZZKNZLW016200	Colour	BEIGE	
Odometer	8704 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	235/50 R19	HANKOOK	6 mm	
L/H Front Tyre	235/50 R19	HANKOOK	6 mm	
R/H Rear Tyre	235/50 R19	HANKOOK	6 mm	
L/H Rear Tyre	235/50 R19	HANKOOK	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	16/09/2020	Inspection Date	18/09/2020	
Survey held at	KANG CAR REPAIRERS PTE LTD NO.1 KAKI BUKIT AVE 6 #02-06 AUTOBAY @ KAKI BUKIT SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SGR 6118C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BOOT LID	DENTED	2,275.00	2,275.00
1	BOOTLID LOGO	NECESSARY	80.00	80.00
1	BOOTLID 'TARRACO' EMBLEM	NECESSARY	75.00	75.00
1	BOOTLID 'R/H EMBLEM	NECESSARY	60.00	60.00
1	BOOT LID CHROME	DENTED	320.00	320.00
1	BOOT LID LAMP RH	CRACKED	505.00	505.00
1	REAR BUMPER CENTRE REFLECTOR LIGHT	CRACKED	495.00	495.00
1	REVERSE CAMERA	NOT NECESSARY	850.00	-
1	BOOT LID RUBBER	NOT NECESSARY	225.00	-
1	BOOT LID LOCK	NOT NECESSARY	210.00	-
1	TAIL LAMP -RH	NOT NECESSARY	595.00	-
1	REAR PANEL	TO REPAIR SEE LABOUR	750.00	-
1	REAR PANEL TRIM	NOT NECESSARY	230.00	-
1	REAR BUMPER	DEFORMED	1,945.00	1,945.00
1	REAR LOWER BUMPER	DEFORMED	570.00	570.00
4	REVERSE SENSORS	DAMAGED (2 PCS ONLY)	1,184.00	592.00
1	REAR LOWER BUMPER REFLECTOR -RH	CRACKED	75.00	75.00
1	REAR BUMPER REINFORCEMENT	BENT	670.00	670.00
2	REAR BUMPER SIDE RETAINER	NECESSARY	190.00	190.00
2	REAR BUMPER SIDE CHROME	NECESSARY	260.00	260.00
1	REAR CENTRE PAD	DEFORMED	690.00	690.00
1	REAR BUMPER SPONGE	DEFORMED	175.00	175.00
1	REAR BLIND SPOT SENSOR	DAMAGED	780.00	780.00
1	BOOT LID LOCK SENSOR	DAMAGED	190.00	190.00
	LESS 10% DISCOUNT		-1,339.90	-994.70
			12,059.10	8,952.30
	<u>SPECIAL NETT ITEMS</u>			
1	REAR NUMBER PLATE (SN)	CRACKED	50.00	50.00
1	REAR WINDSCREEN SEAL (SN)	NECESSARY	60.00	40.00

Report Ref No. CC6/CTI20010121/Ara3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	60.00	40.00
1	SET REAR PANEL TRIM CLIPS (SN)	NOT NECESSARY	60.00	-
			230.00	130.00
	LABOUR			
	TO CHECK WIRING .		50.00	30.00
	TO REMOVE AND REFIT REVERSE SENSOR .		100.00	50.00
	TO REMOVE AND REFIT REAR WINDSCREEN .		120.00	120.00
	TO REFIT THIRD BRAKE LIGHT .	NOT NECESSARY	100.00	-
	TO REMOVE AND REFIT INNER TRIM .		100.00	80.00
	TO REMOVE AND REFIT REVERSE CAMERA.		100.00	50.00
	TO SPRAY UNDERSEAL .		180.00	40.00
	TO SPRAY PAINTING .		1,200.00	700.00
	TO REMOVE AND REPLACE THE DAMAGED PARTS ,KNOCK OUT ACCIDENT DENTED PORTIONS ,AND FOR CUTTING/WELDING WORKS .INCLUSIVE OF THE REPAIR OF REAR PANEL .		1,200.00	600.00
	TO RE-PROGRAMME.		300.00	180.00
	TO APPLY PAINT PROTECTION .		600.00	400.00
			4,050.00	2,250.00
GRAND TOTAL			16,339.10	11,332.30
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				9,000.00

Report Ref No. CC6/CTI20010121/Ara3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGR 6118C

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

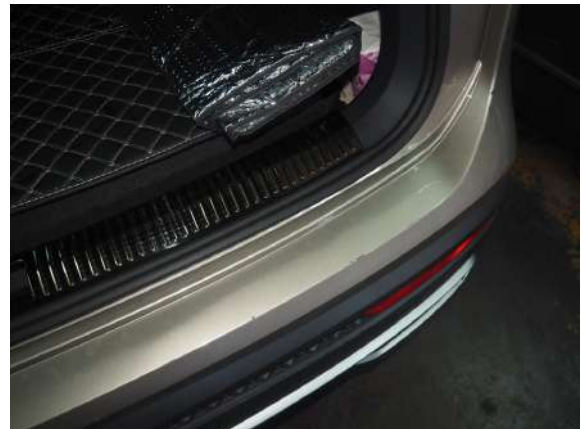



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGR 6118C

RE-INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

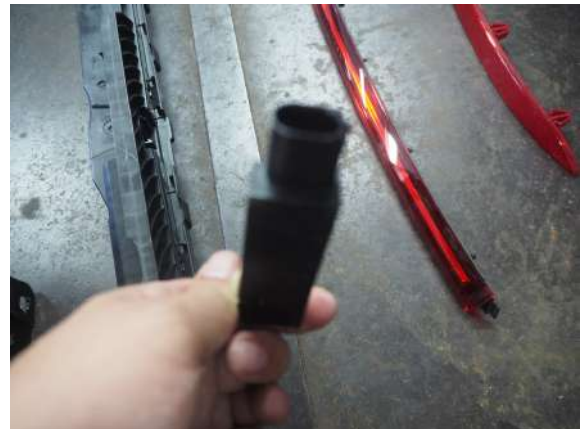



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

