


MBM WHEELPOWER PTE LTD

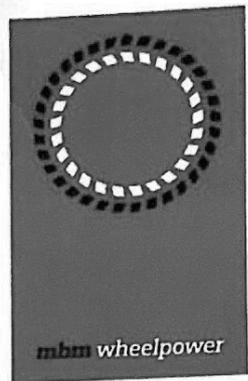

Your Ref: SJE1496B
 Our Ref: SMD5390R

Not Authorized
Henry Blopel

To: AIG

4 days

Date: 21/9/2020
 From: Danny
 Fax: 64525333
 Contact: 93288668
 Make / Model: MERCEDES GLE400
 Chassis No.: WDC2923562A078671
 Engine No.: 27682130597722
 Year of Make: 2017
 Accident Date: 17 September 2020

Fax

ESTIMATE FOR VEHICLE NO. : SMD5390R

DESCRIPTION	QTY	List Price	
FRONT RH FENDER	1	\$	R X 1,899.00
FRONT RH FENDER WHEEL ARCH MOULDING	1	\$	no ✓ 257.00
FRONT BUMPER	1	\$	Bad Car ✓ 2,037.00
FRONT BUMPER RH LOWER COVER	1	\$	sm X 175.00
FRONT BUMPER RH LOWER GRILLE	1	\$	sm X 157.00
FRONT BUMPER RH SIDE RETAINER	1	\$	sm X 166.00
FRONT BUMPER CENTER LOWER CARRIER	1	\$	R X 510.00
FRONT BUMPER SPONGE	1	\$? 237.50
HEAD LAMP RH	1	\$	Car ✓ 5,108.40
FRONT RH RIM	1	\$	R ✓ 2,871.00
FRONT RH KNUCKLE ARM	1	\$? 1,152.00
FRONT RH KNUCKLE ARM BEARING	1	\$? 990.00
FRONT RH UPPER ARM	1	\$? 882.00
FRONT RH LOWER ARM	1	\$? 1,404.00
FRONT RH SHOCK ABOSRBER	1	\$? 747.00
RIVETS @ \$8 EACH	15	\$	no ✓ 120.00
Total:		\$	18,712.90
LESS 10%		\$	(1,871.29)
Parts Total:		\$	16,841.61

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date:

SPECIAL NETT
BODY SEALANT

1

\$

80.00

LABOUR

TO REMOVE, REFIT & REPAIR AFFECTED DAMAGED PARTS. INCLUDING TO
KNOCK-OUT, WELD & STRAIGHTEN ON THE AFFECTED PARTS.

\$

500l 1,200.00

TO CONDUCT ALL WHEEL COMPUTERISED ALIGNMENT

\$

60l 100.00

TO REMOVE & REPLACE FRONT RH UNDERCARRIAGE

\$

? 350.00

TO RESET ENGINE WARNING LIGHT (ABS, SRS, ECU MEMORY & ETC)

\$

? 300.00

TO APPLY ANTI RUST COATING

\$

na X 150.00

TO REMOVE, REFIT & UPHOLSTERY TO FACILITATE REPAIRS

\$

na X 150.00

TO REMOVE & REPLACE BUMPER SENSORS

\$

✓ 60.00

TO CHECK & RECONNECT ALL NECESSARY WIRING

\$

20l 80.00

TO SPRAY PAINT ON THE AFFECTED AREAS

\$

660l 1,200.00

Total: \$ 20,511.61

7% GST: \$ 1,435.81

Grand Total: \$ 21,947.42

Mbm wheelpower pte ltd

160 SIN MING DRIVE

#06-02

SIN MING AUTOCITY

t 62628888 f 64525333

Company Registration Number : 200204110W