

# INFINITI

APPRAISAL SERVICE  
ROC No: 53196942L

c/o Hui Yang Motor Pte Ltd  
176 Sin Ming Drive Sin Ming Autocare  
#04-02 Singapore 575721

## VEHICLE DAMAGE INSPECTION REPORT

### CLAIM REFERENCE

Our Ref. No.	: 21740	Claim Number	: TBA
Accident Date	: 05-06-2018	Insured Vehicle	: VAQ6200
Survey Date	: 06-06-2018	Claim Type	: Third Party
Report Date	: 26-06-2018		

### DESCRIPTION AND IDENTIFICATION OF VEHICLE

Vehicle No.	: SJM7710B	Chassis No.	: JTDER12W403001637
Registration Date	: 15-01-2009	Engine No.	: 1ZZ3222588
Make	: TOYOTA	Engine Cap.	: 1794 cc
Model	: WISH 1.8 AUTO	Transmission	: Automatic
		Colour	: White

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

Foot Brake	: Serviceable	Steering	: Serviceable
Hand Brake	: Serviceable	Modification	: None
Odometer	: 162059		

<u>TYRES</u>	<u>SIZE</u>	<u>MAKE</u>	<u>BALANCE</u>
FRONT RH	195/60 R15	TOYO	5 mm
FRONT LH	195/60 R15	TOYO	5 mm
REAR RH	195/60 R15	TOYO	5 mm
REAR LH	195/60 R15	TOYO	5 mm

### SURVEY CONDUCTED PLACE

HUI YANG MOTOR PTE LTD  
BLK 176 SIN MING DRIVE  
#04-02 SIN MING AUTOCARE  
SINGAPORE 575721

### INSPECTION SUMMARY

Workshop Estimate	: S\$ 23838.11
Our Recommendation	: S\$ 14850.00 (lumpsum)
Estimated Repair Period	: 12 working days

We have not authorised repairs. This survey was carried out on without prejudice basis.

**'INFINITI APPRAISAL SERVICE**  
**RECOMMENDED SPARE PARTS**

SJM7710B-05062018

#	Qty	Parts Description	Condition	Repairer's Estimate (\$\$)	Our Adjustment (\$\$)
<b>LIST ITEM</b>					
1	1	Front Rhfender	Dented	690.50	690.50
2	1	Front Rhfender Lamp	Broken	145.80	145.80
3	1	Front Rhfender Inner Shield	Deformed	218.00	218.00
4	8	Front Rhfender Inner Shield Clips @\$12.90	Necessary	103.20	103.20
5	1	Front Rhwheel House	Bent	890.00	890.00
6	1	Front Rhknuckle Arm	Bent	448.00	448.00
7	1	Front Rhknuckle Arm Bearing	Affected	218.00	218.00
8	1	Front Rhlinkage	Bent	229.00	229.00
9	1	Front Rhabsorber	Bent	698.00	698.00
10	1	Front Rhpillar	Bent	758.00	758.00
11	1	Front Rhdoor	Buckled	1460.00	1460.00
12	2	Front Rhdoor Hinge @\$158.00	Bent	316.00	316.00
13	1	Front Rhdoor Side Mirror	Broken	971.45	971.45
14	1	Front Rhdoor Side Mirror Cover	Grazed	190.00	190.00
15	1	Front Rhdoor Handle	Broken	185.00	185.00
16	1	Front Rhdoor Handle Key Lock Cover	Broken	168.00	168.00
17	2	Front Rhdoor Handle Rubber @\$148.00	Necessary	296.00	296.00
18	1	Front Rhdoor Glass	Shattered	650.00	650.00
19	1	Front Rhdoor Glass Moulding	Necessary	190.00	190.00
20	1	Front Rhdoor Glass Motor	Malfunction	620.00	620.00
21	1	Front Rhdoor Glass Motor Gear	Bent	320.00	320.00
22	1	Front Rhdoor Moulding	Necessary	195.00	195.00
23	1	Front Rhdoor Inner Rubber	Necessary	295.00	295.00
24	1	Front Rhdoor Inner Lock	Jammed	580.00	580.00
25	1	Front Rhdoor Inner Trim	Deformed	785.00	785.00
26	1	Rear Rhdoor	Grazed	1350.00	1350.00
27	1	Rear Rhdoor Hinge @\$158.00	Bent	316.00	316.00
28	1	Rear Rhdoor Inner Rubber	Necessary	295.00	295.00
29	1	Rear Rhinner Lock	Reuse	580.00	0.00
30	1	Rear Rhside Centre Pillar	Bent	780.00	780.00
31	1	Rear Rhfender	Dented	1400.00	1400.00
32	1	Rear Rhfender Inner Shield	Deformed	320.00	320.00
33	8	Rear Rhfender Inner Shield Clips @\$12.90	Necessary	103.20	103.20
34	1	Rear Rhabsorber	Bent	350.00	350.00
35	1	Rear Axle	Reuse	3200.00	0.00
36	1	Rear Axle Rh Wheel Bearing	Affected	580.00	580.00
37	1	Rear Bumper	Deformed	985.00	985.00
38	1	Rear Bumper Rh Side Retainer	Necessary	185.00	185.00
			<b>Subtotal</b>	<b>22064.15</b>	<b>18284.15</b>
Less 25 %				<b>5516.04</b>	<b>4571.04</b>
			<b>TOTAL</b>	<b>16548.11</b>	<b>13713.11</b>
<b>SPECIAL NETT ITEM</b>					
1	1	Front Rh Door Glass Solar Film	Necessary	200.00	150.00

**INFINITI APPRAISAL SERVICE  
RECOMMENDED LABOUR**

SJM7710B-05062018

#	Job Description	Repairer's Estimate (S\$)	Our Adjustment (S\$)
1	Remove & refix undercarriage.	580.00	300.00
2	Remove & n refix dashboard.	380.00	250.00
3	Remove & refix front rh door glass.	120.00	60.00
4	Alignment.	100.00	80.00
5	Tuffkote.	300.00	120.00
6	Wiring.	250.00	120.00
7	Spray painting.	1800.00	1400.00
8	Labour charges.	2000.00	1400.00
<b>TOTAL LABOUR COST</b>		<b>5530.00</b>	<b>3730.00</b>

**COST OF CLAIM**

Description	Repairer's Estimate (S\$)	Our Adjustment (S\$)
<b>Total Recommended Parts</b>	<b>18308.11</b>	<b>14863.11</b>
<b>Total Recommended Labour</b>	<b>5530.00</b>	<b>3730.00</b>
<b>Total Cost of Claim</b>	<b>23838.11</b>	<b>18593.11</b>

**INFINITI APPRAISAL SERVICE**  
**OUR FINDINGS AND RECOMMENDATION**

SJM7710B-05062018

**OUR FINDINGS**

At the place of survey, we saw this vehicle sustained damage.

The damages seen during our survey were rhs & undercarriage and etc being damaged. The detailed description of the damages is listed as 'RECOMMENDED SPARE PARTS'.

**OUR RECOMMENDATION**

HUI YANG MOTOR PTE LTD estimated a repair cost of S\$23838.11. We adjusted it to S\$18593.11 on a part-by-part basis.

We recommend repairs to this vehicle be carried out on a lumpsum basis at S\$14850.00 .




repairs would require a period of 12 working days.

We submit our inspection report for your kind attention and would add the inspection was carried out to the best of our ability, knowledge and experience.


  
Edward Cho  
INFINITI APPRAISAL SERVICE

  
Cedric Ng  
INFINITI APPRAISAL SERVICE





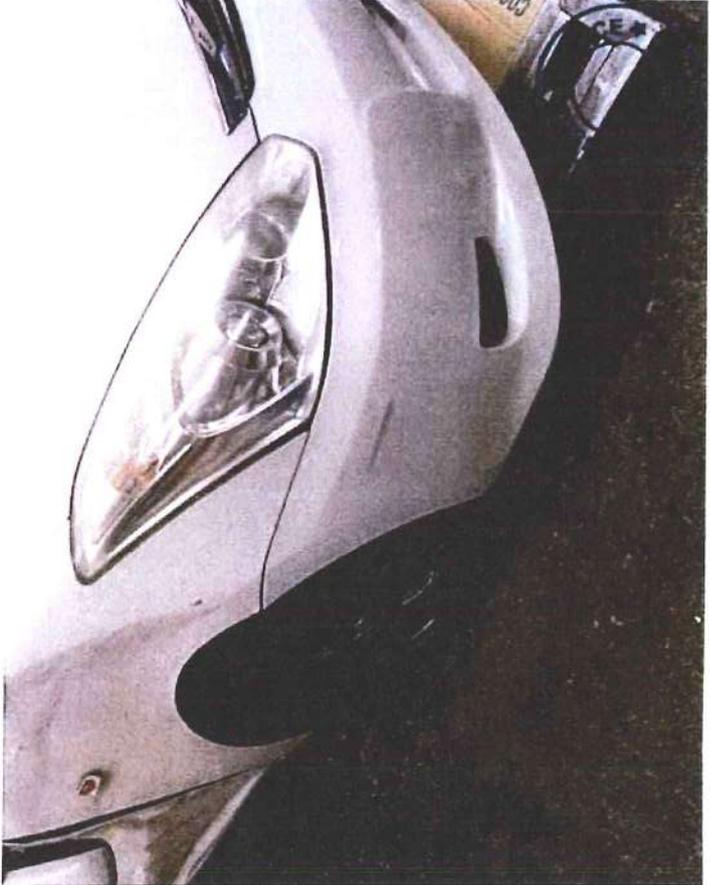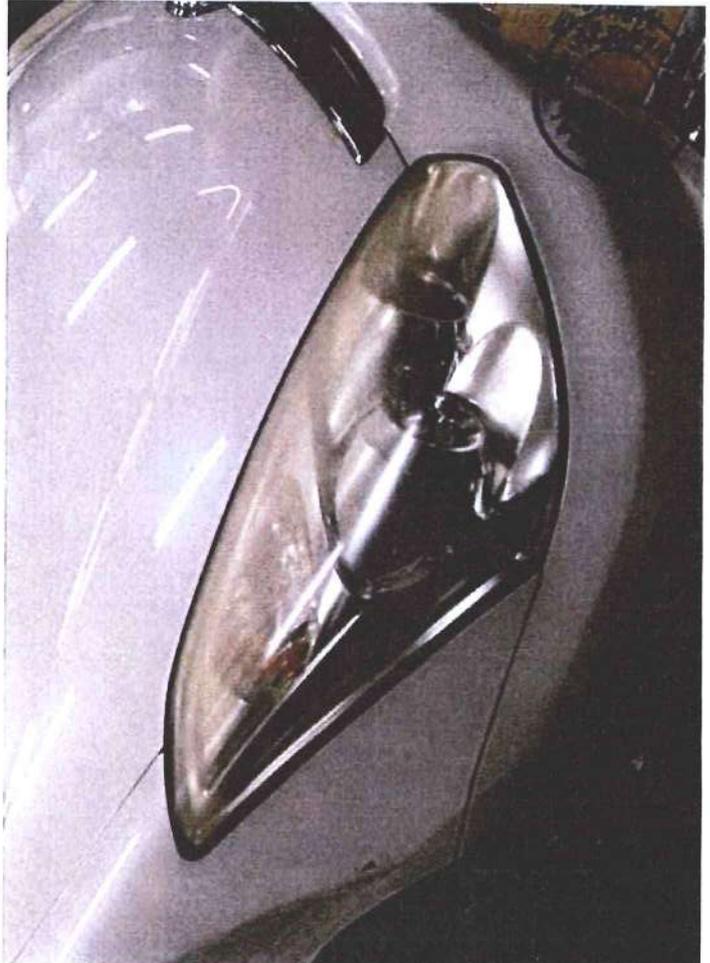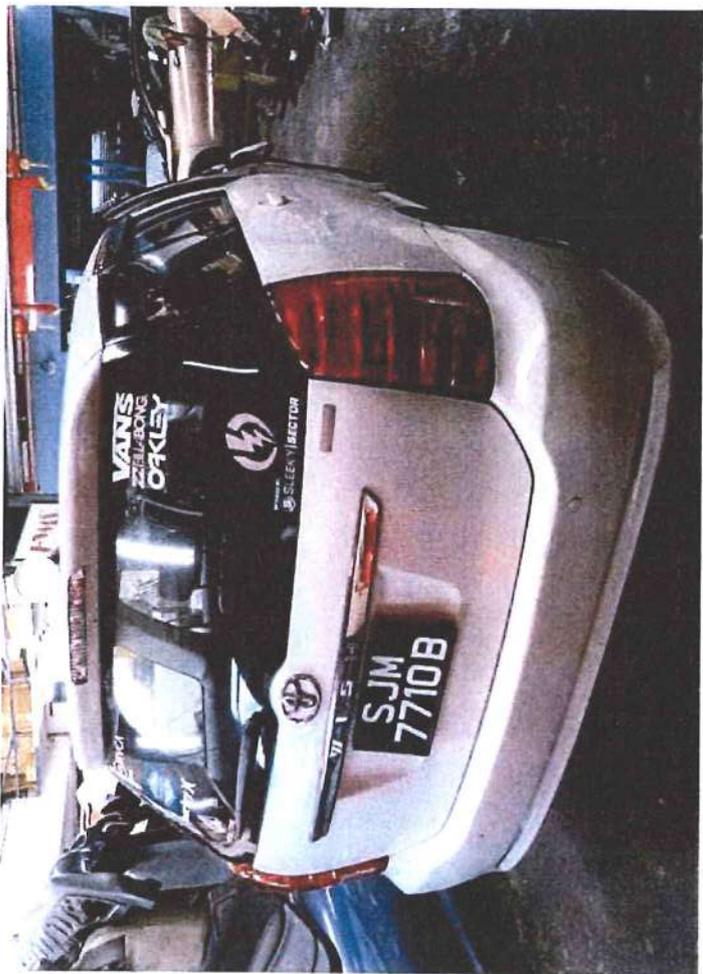


10

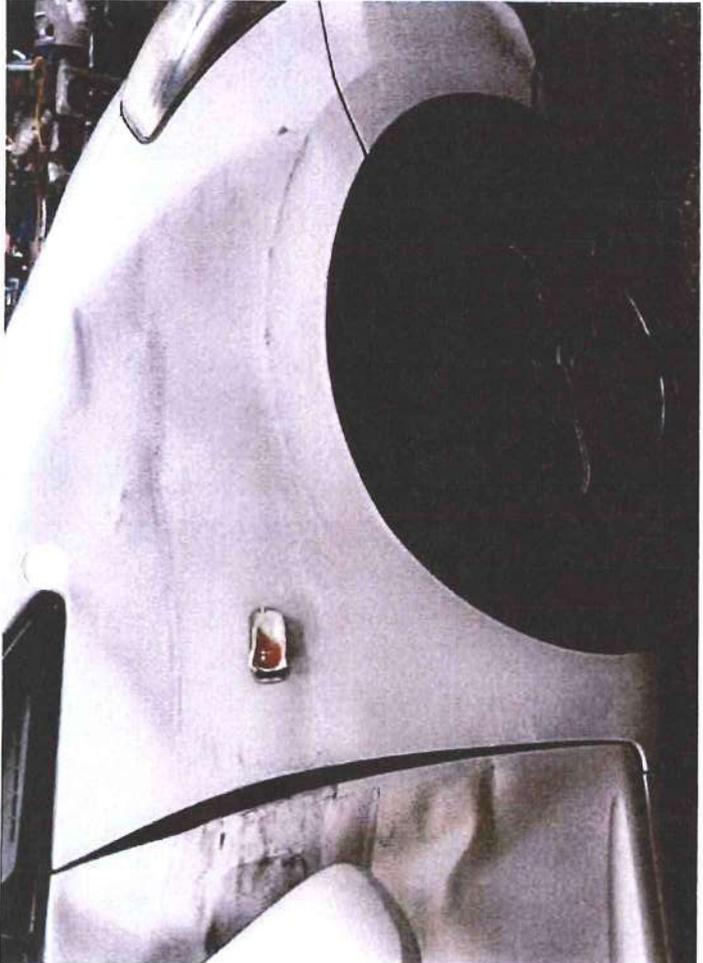

12

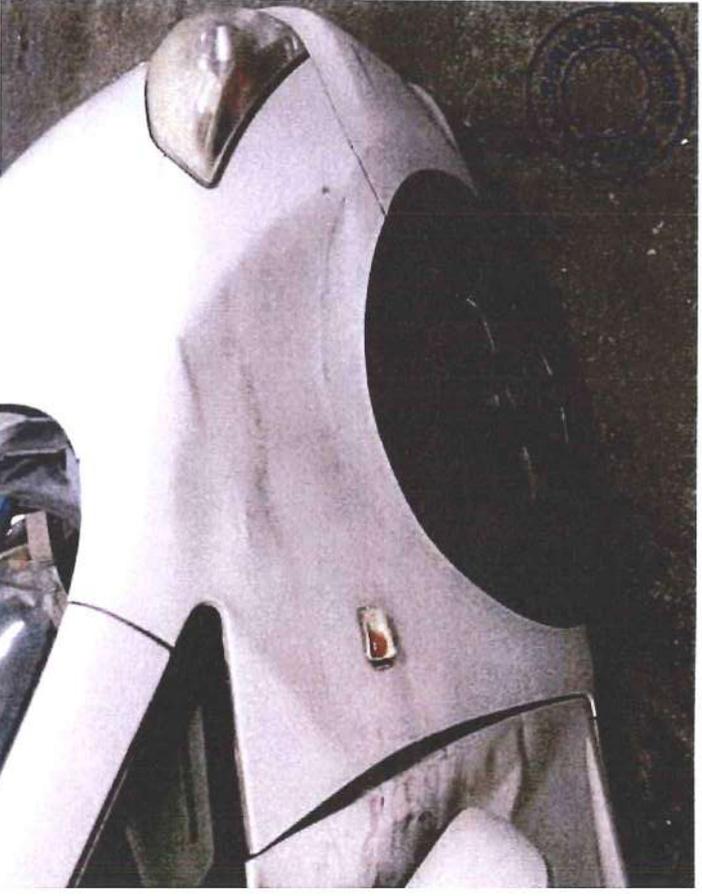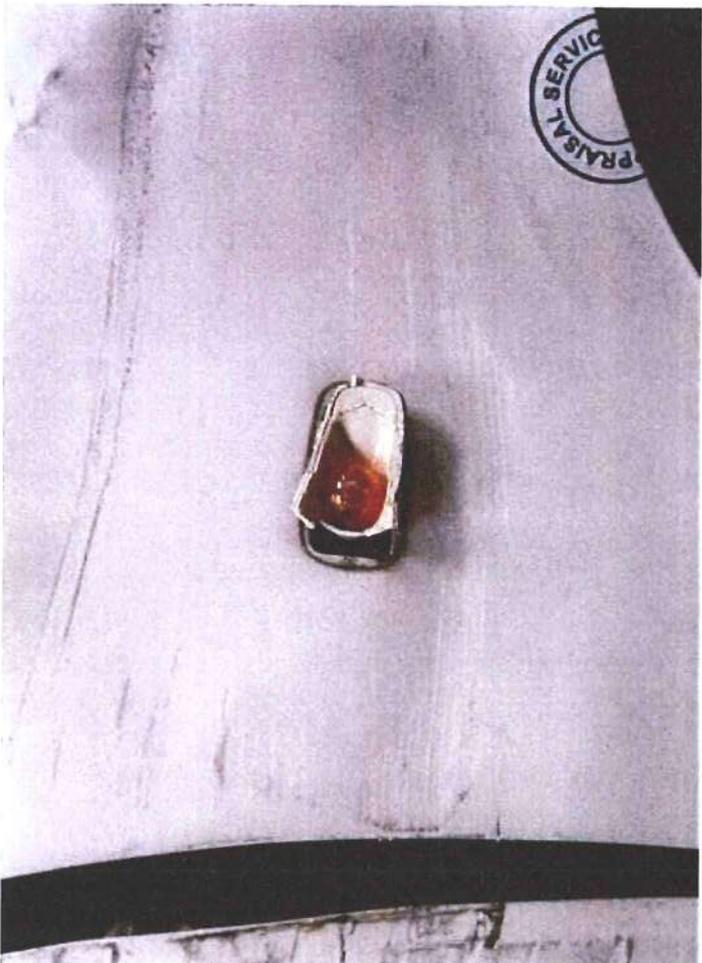



14

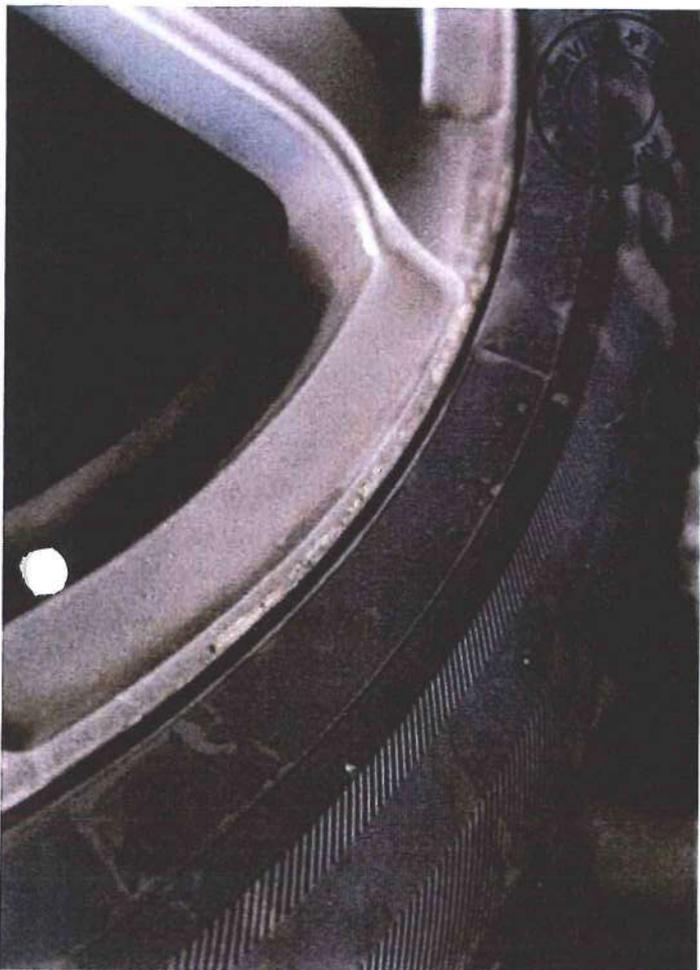




16






VEHICLE # : SJM7710B ACCIDENT DATE : 05-06-2018

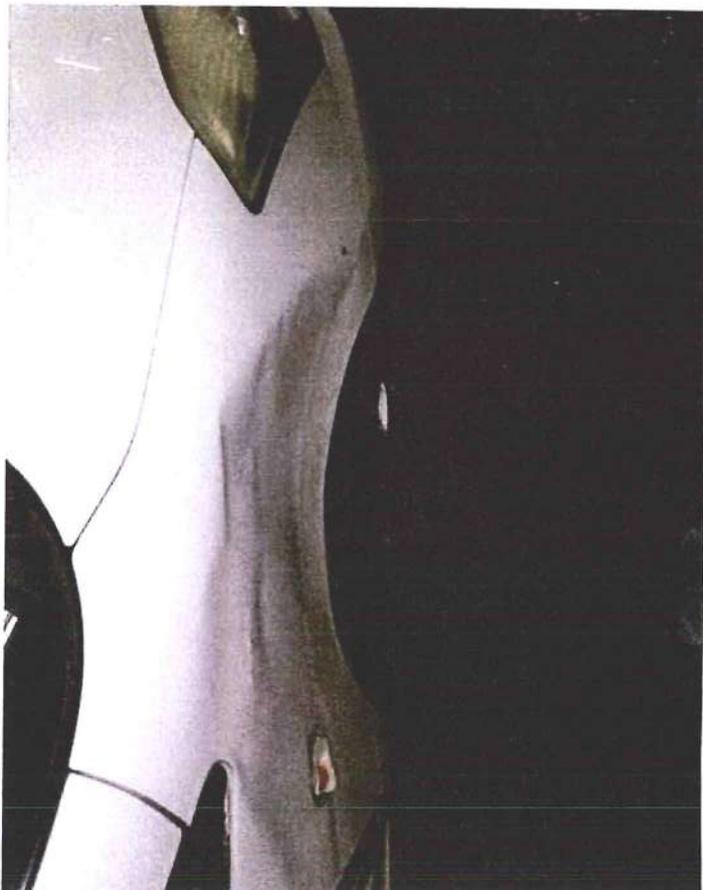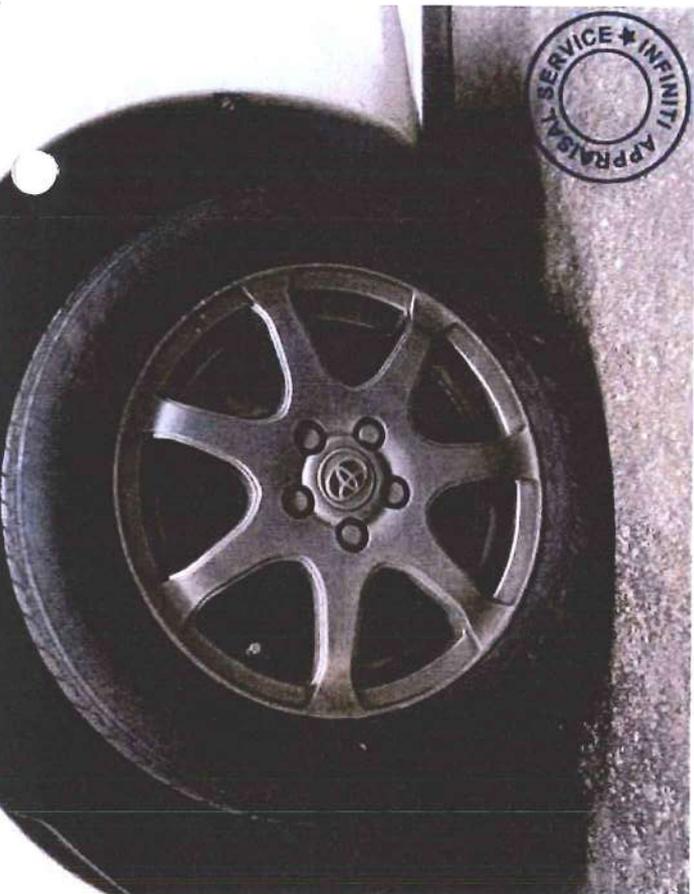


INFINITI APPRAISAL SERVICE

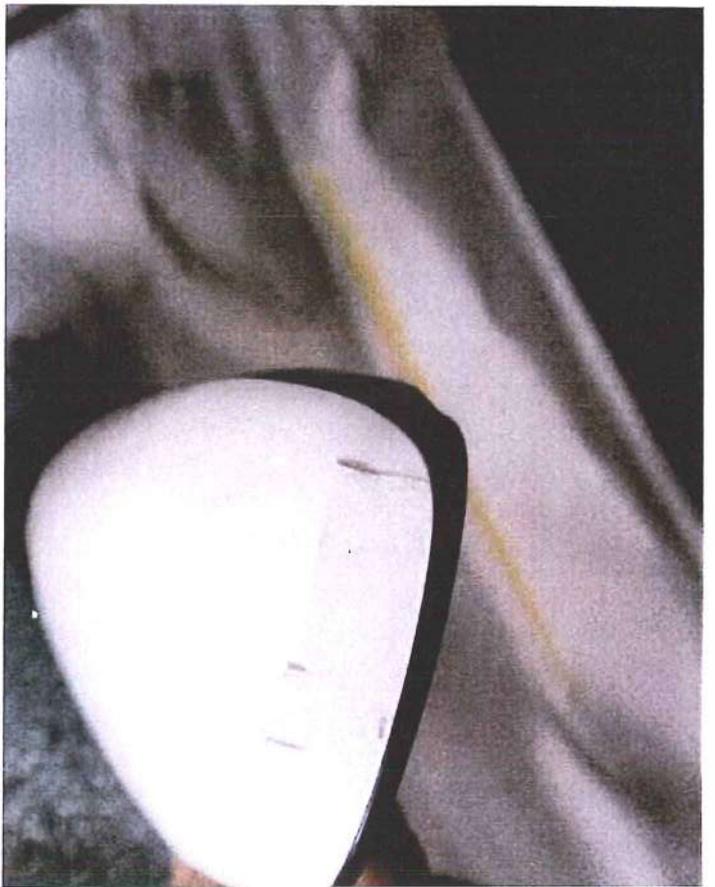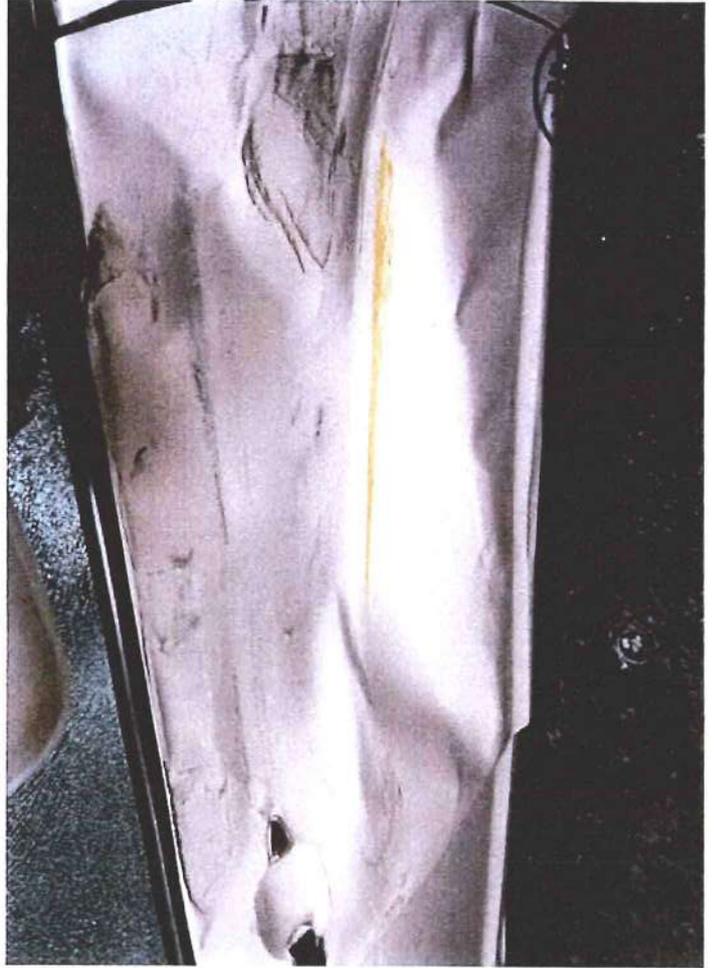
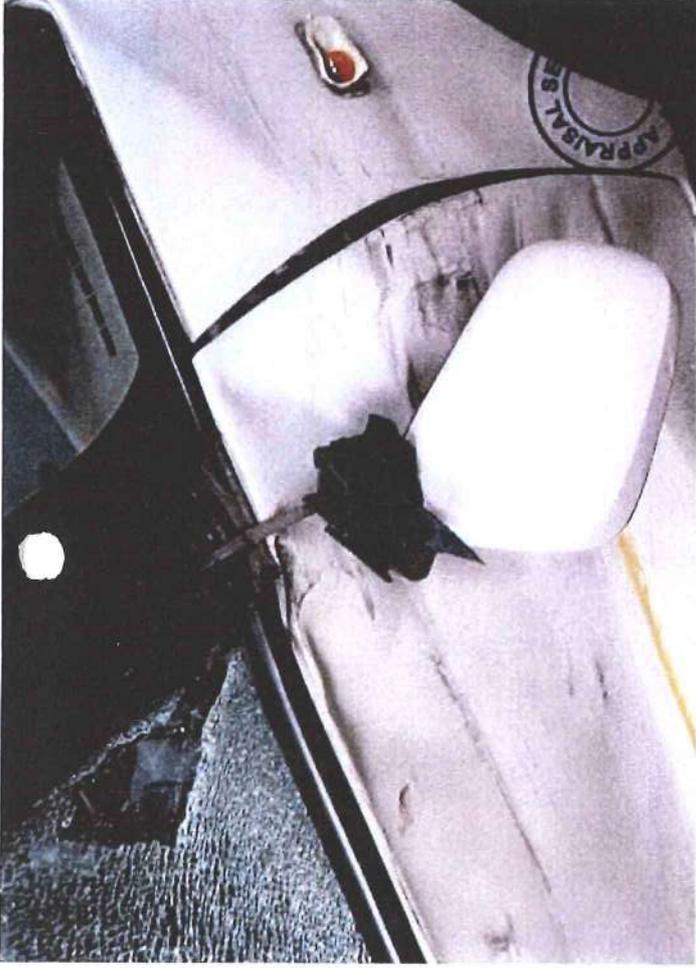



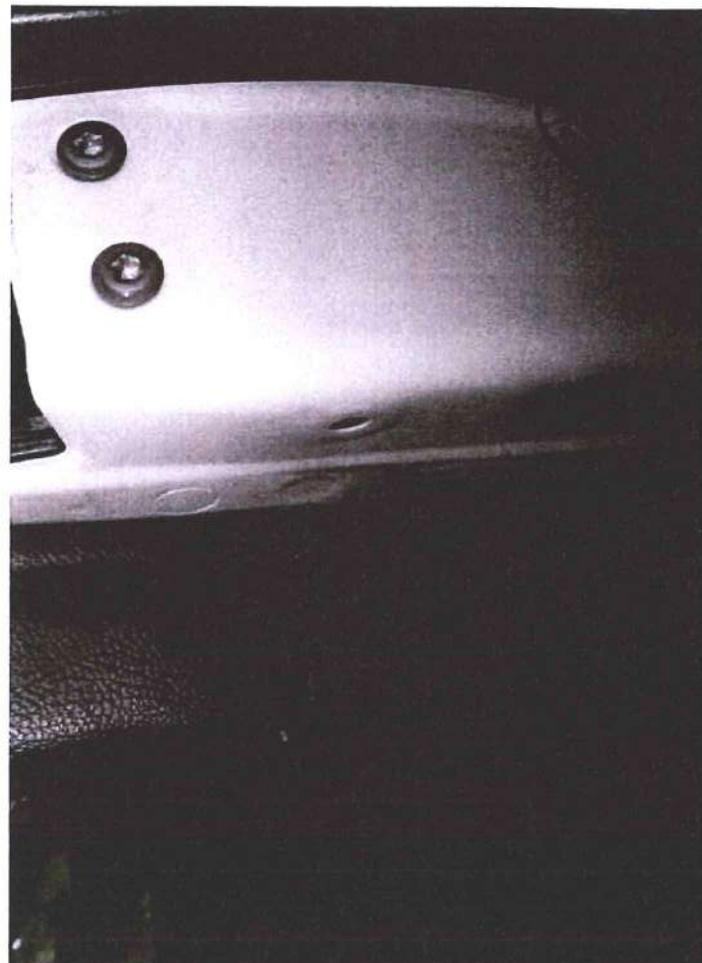
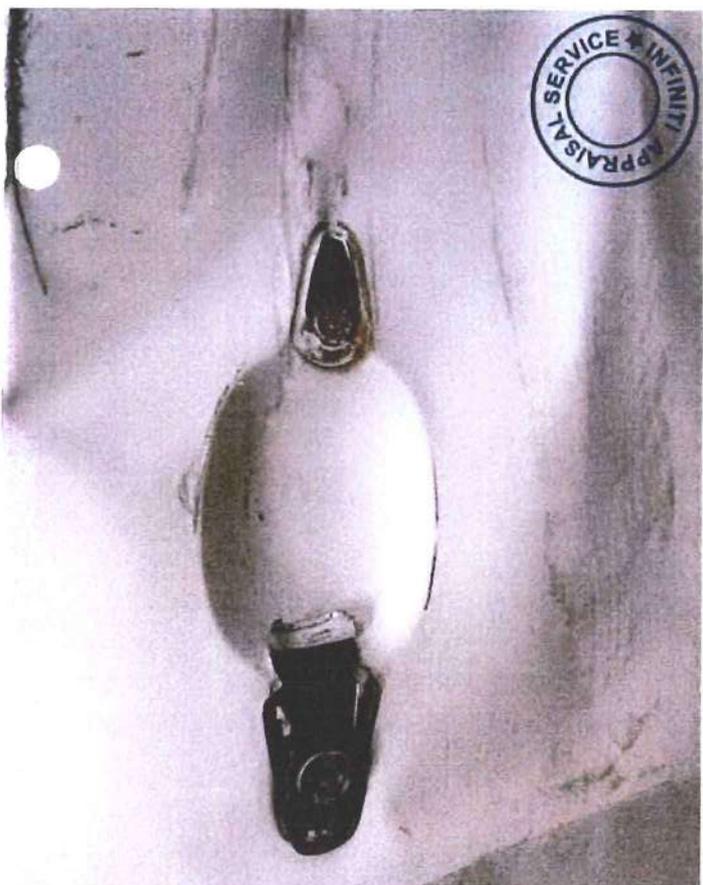
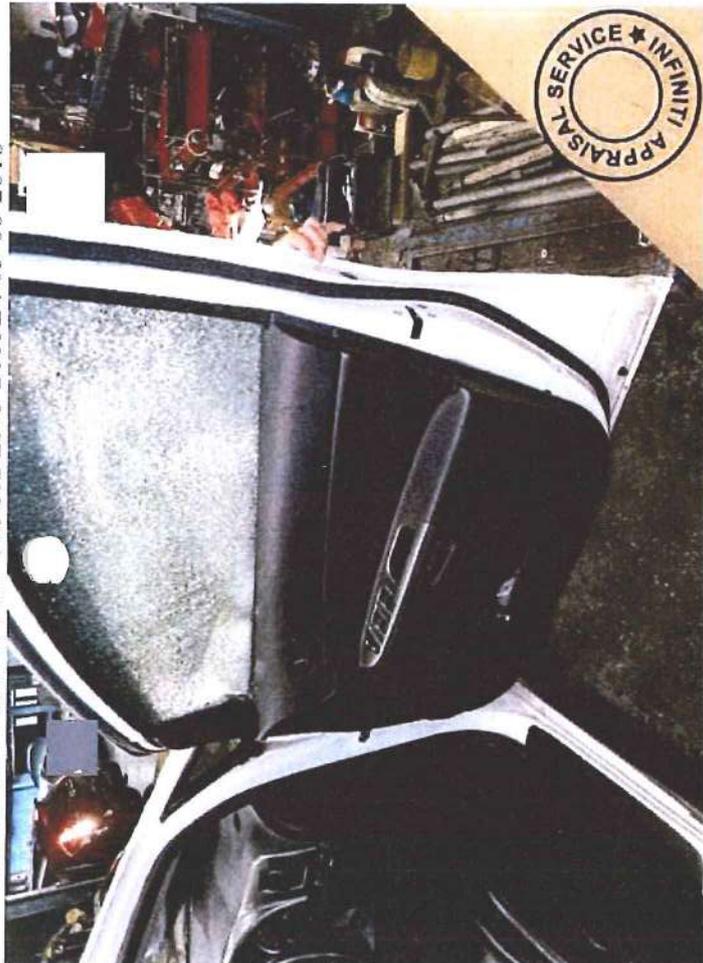


26


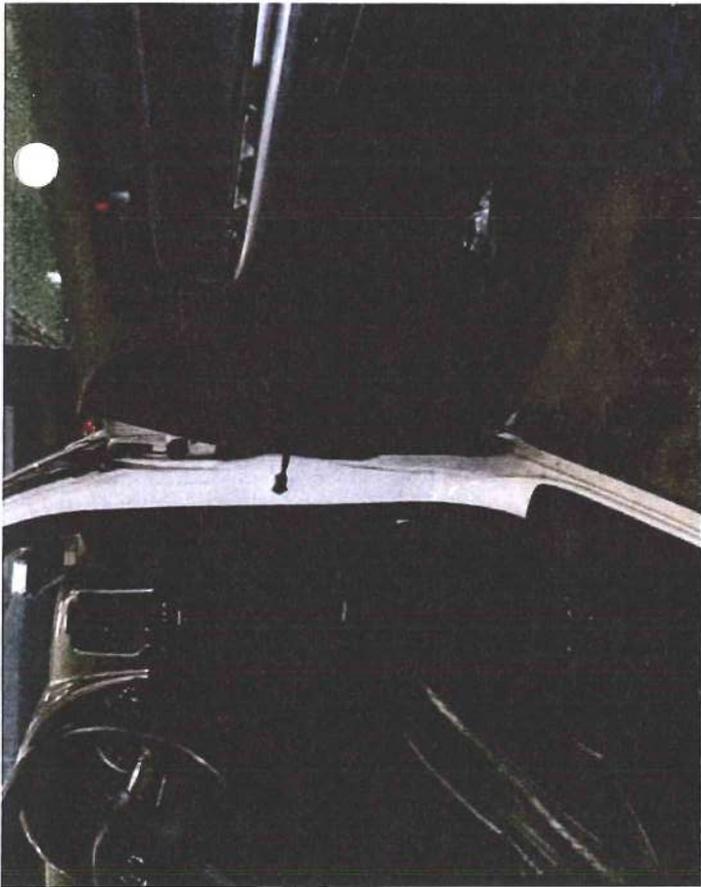


28

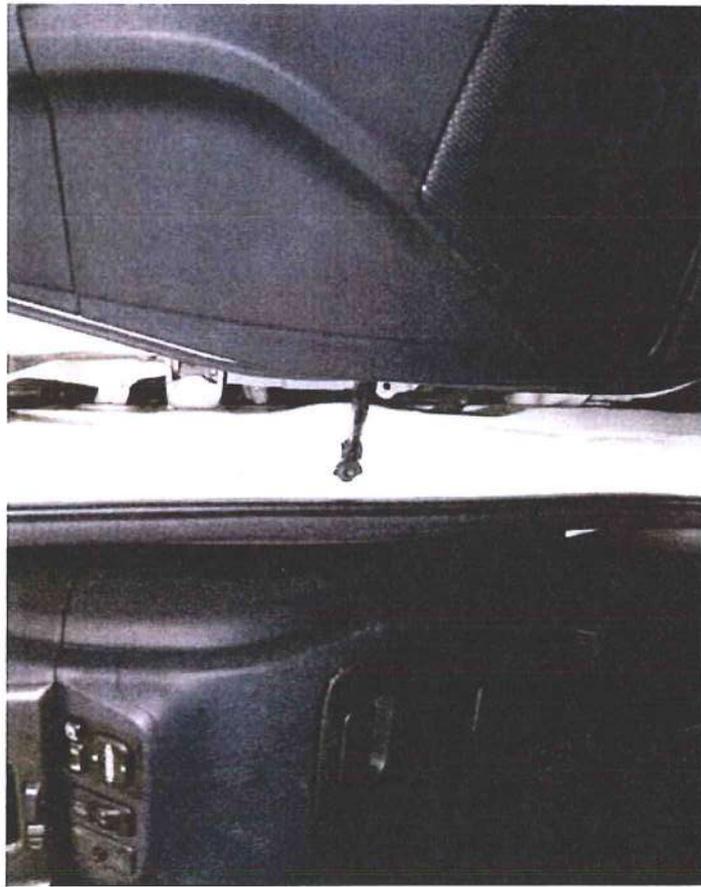
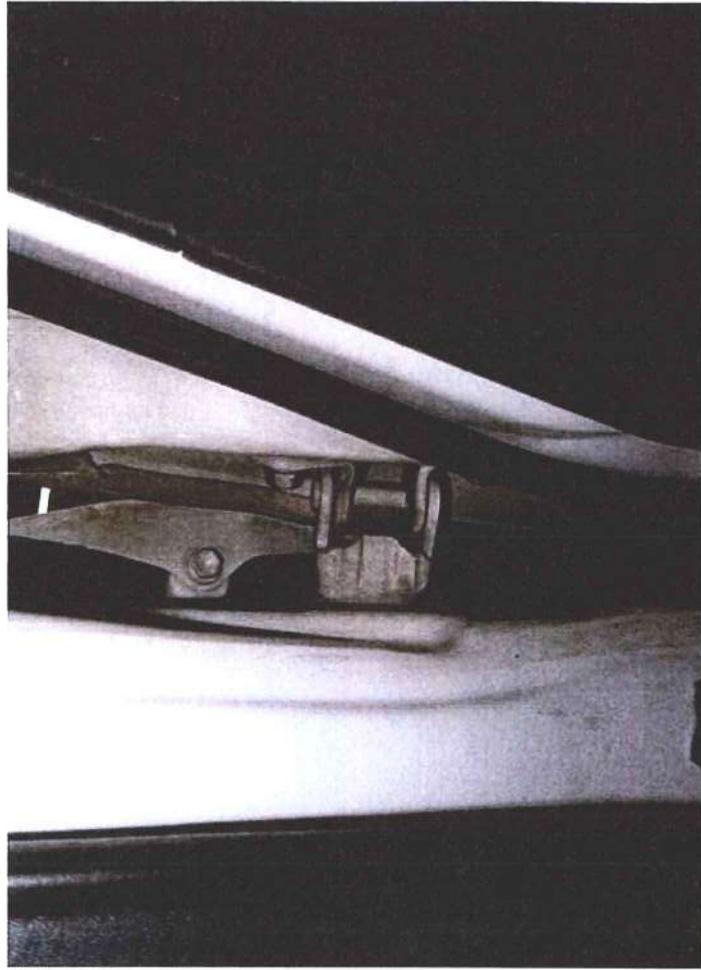


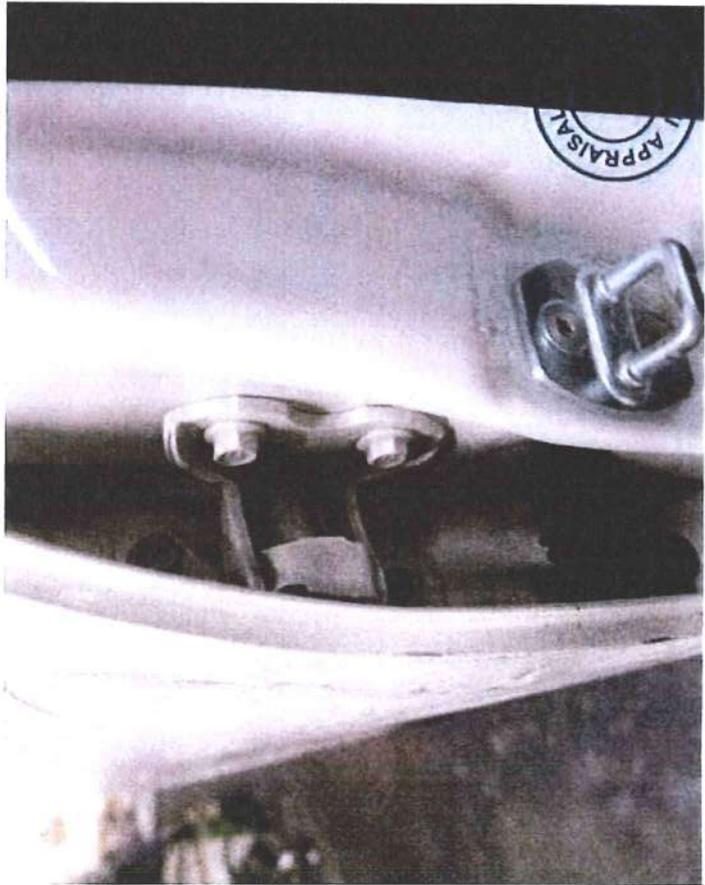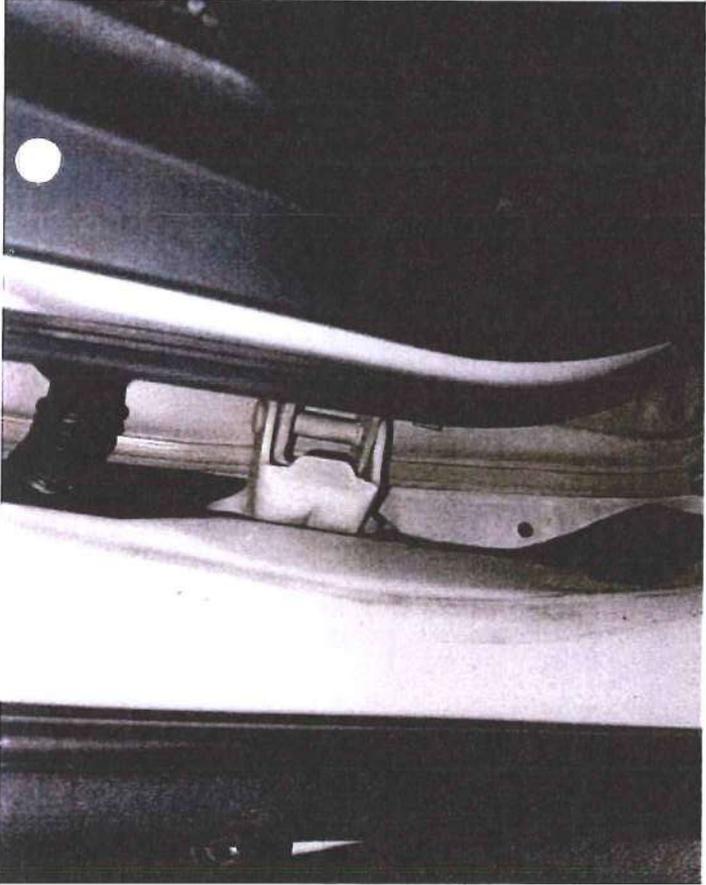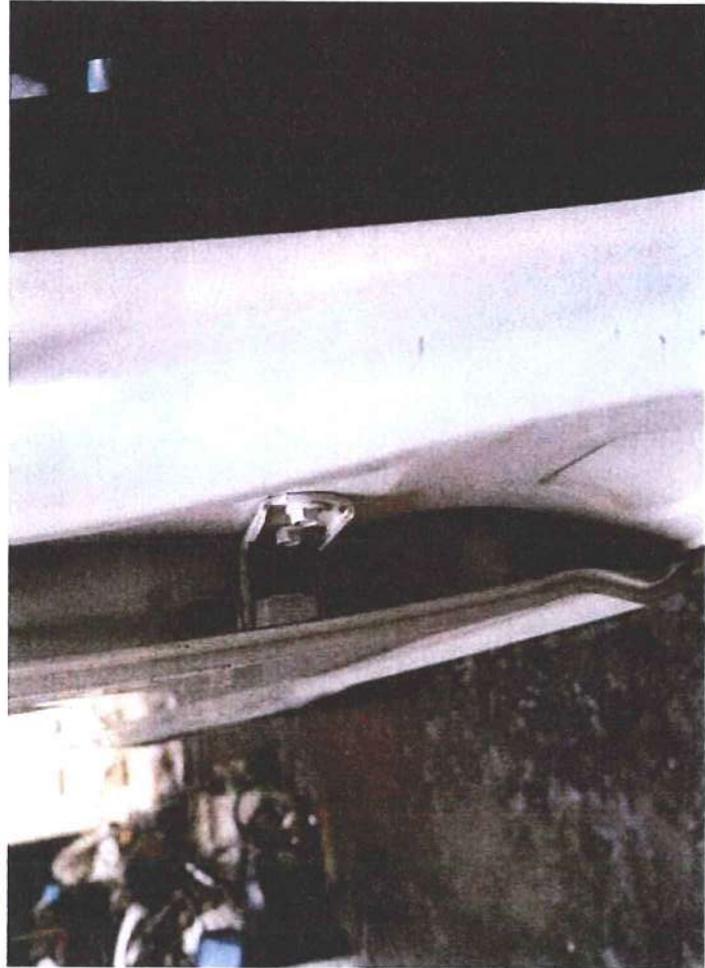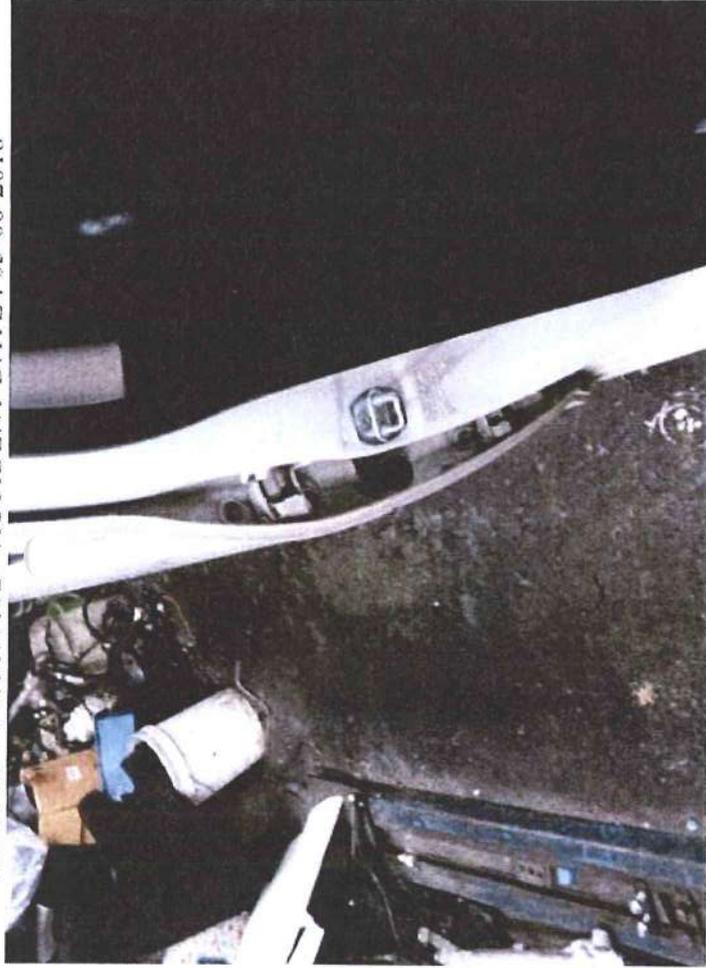


34

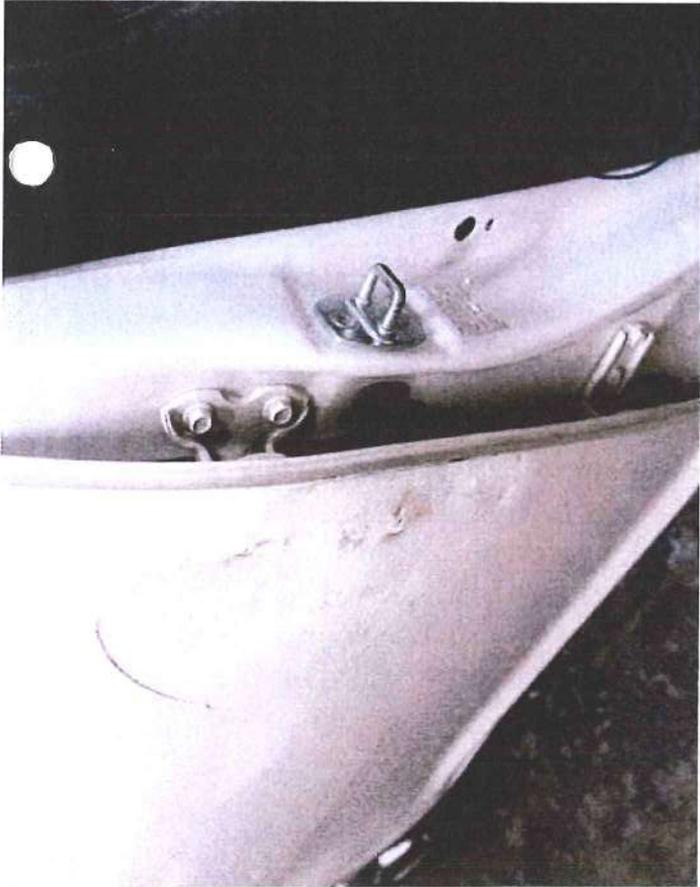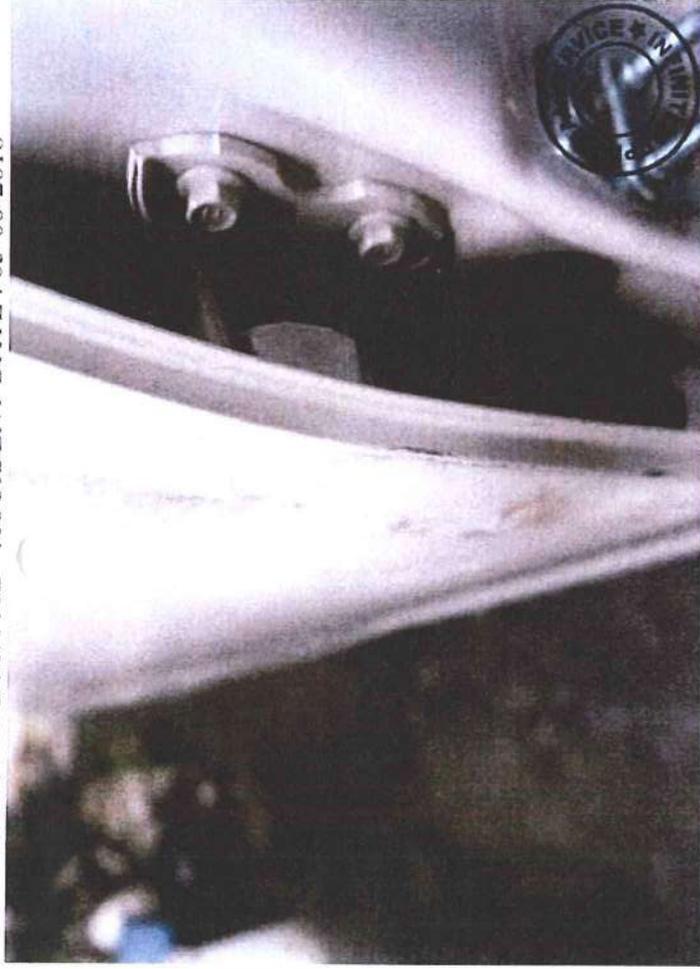



36

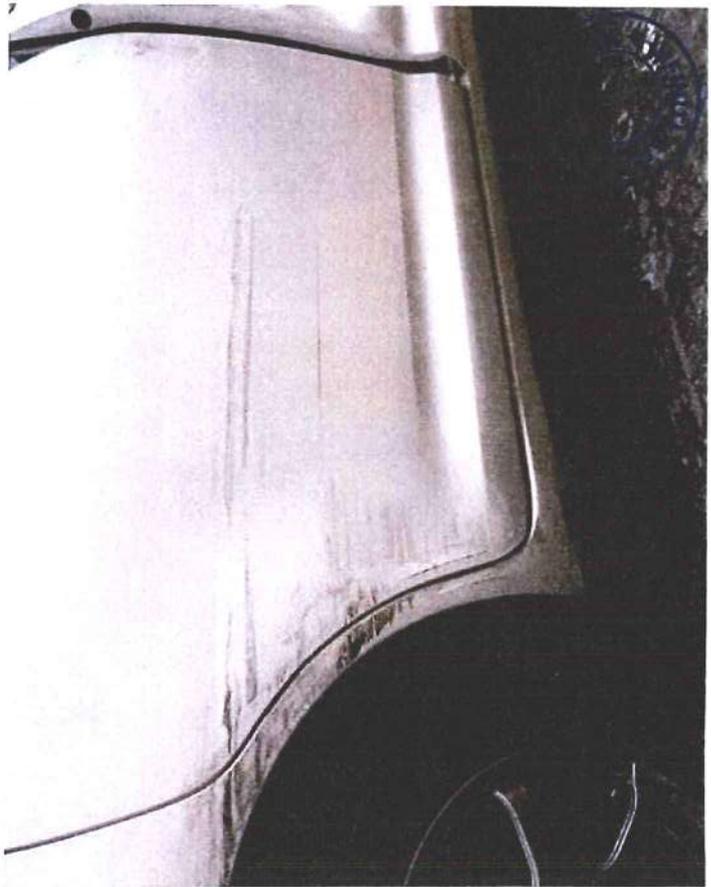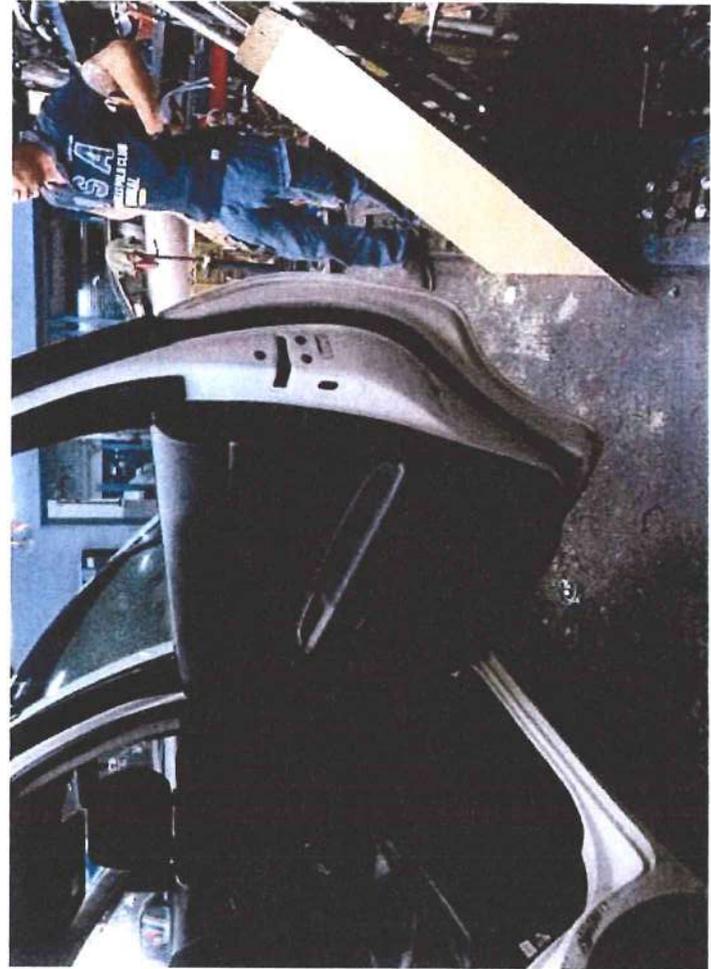

38

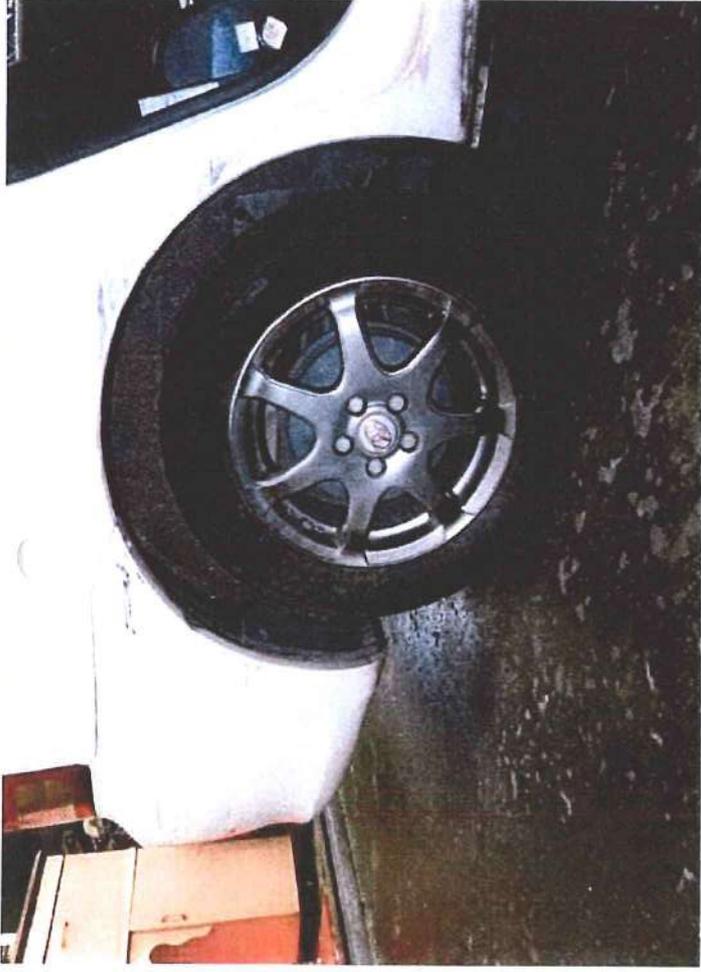



40

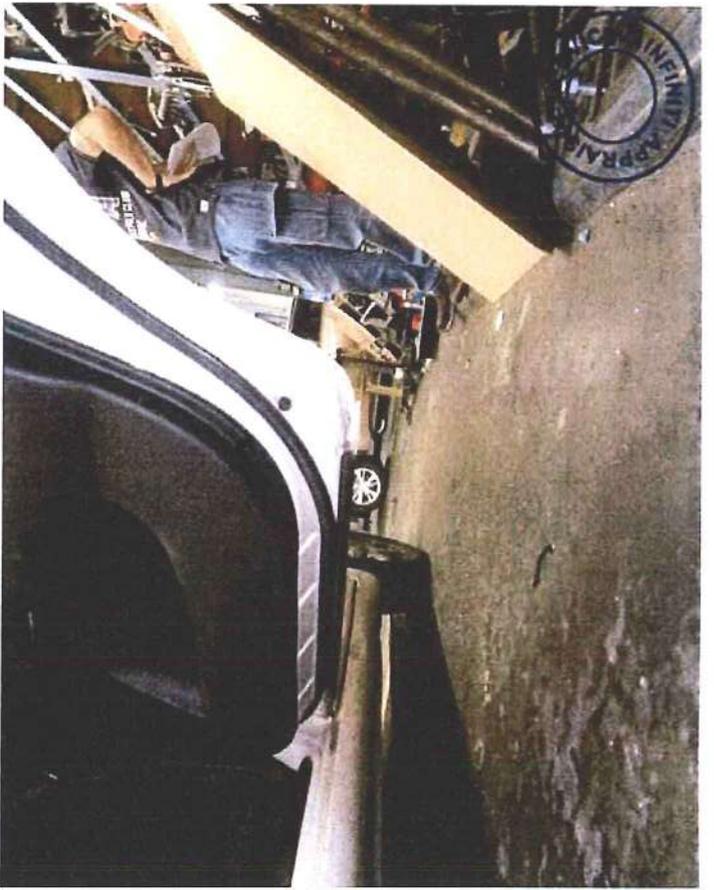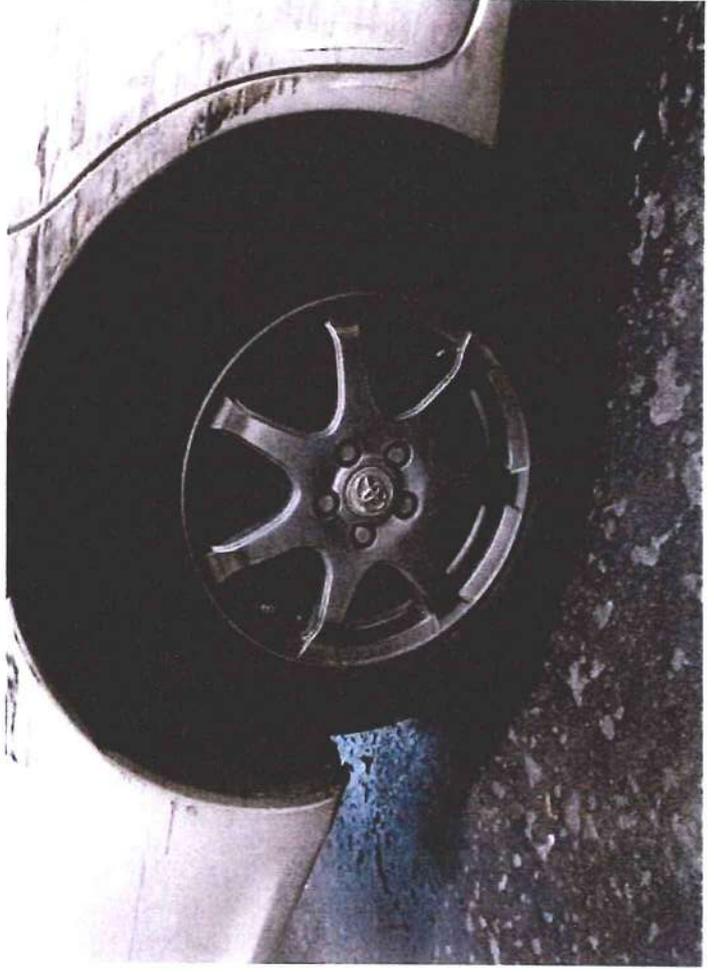

42






44


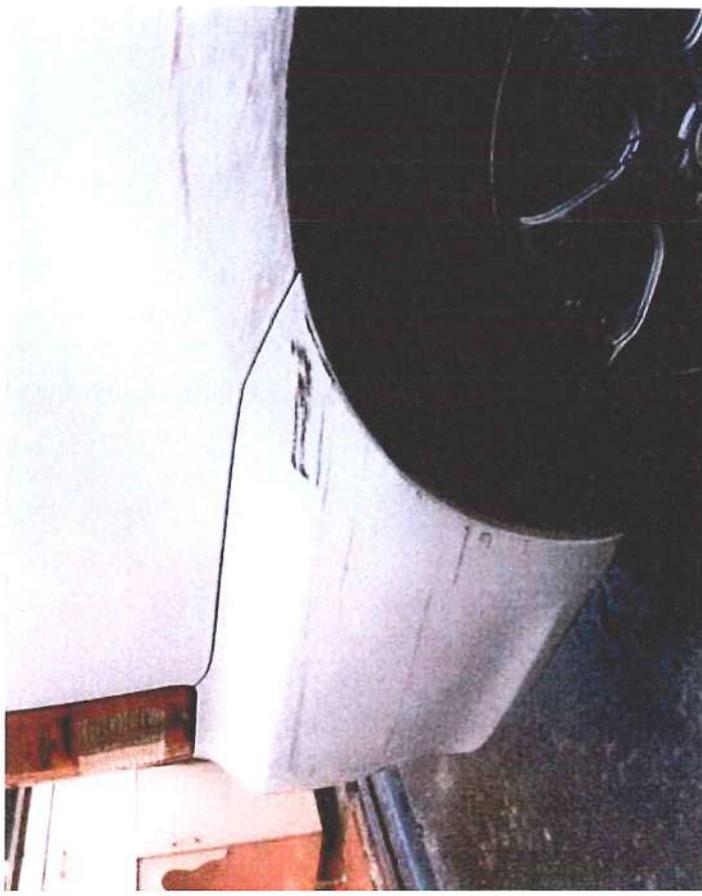
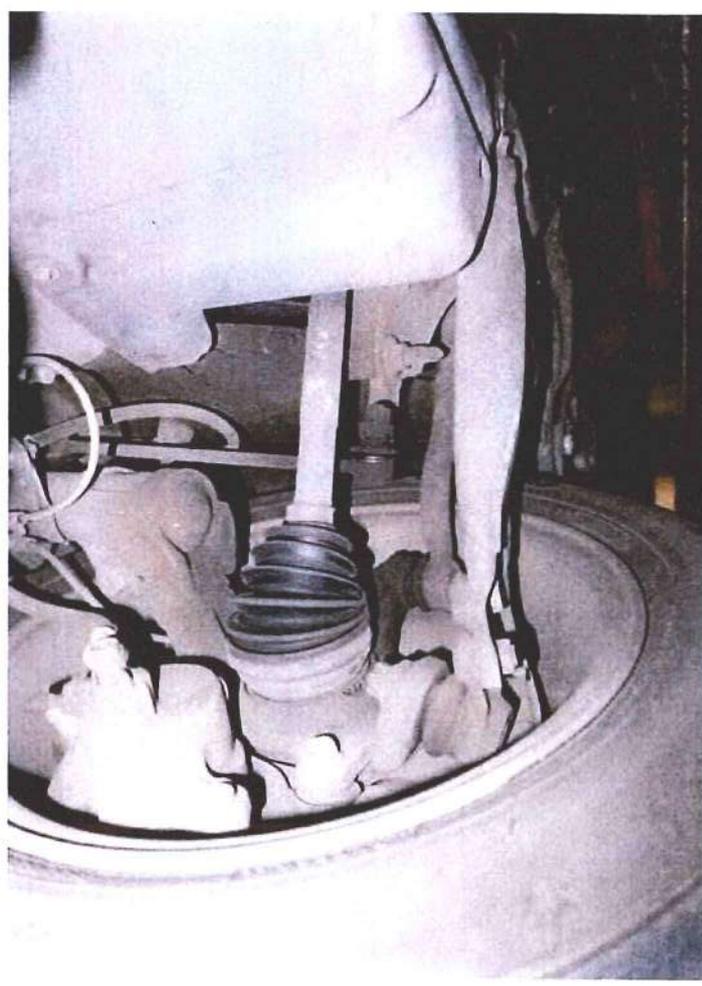


46




48

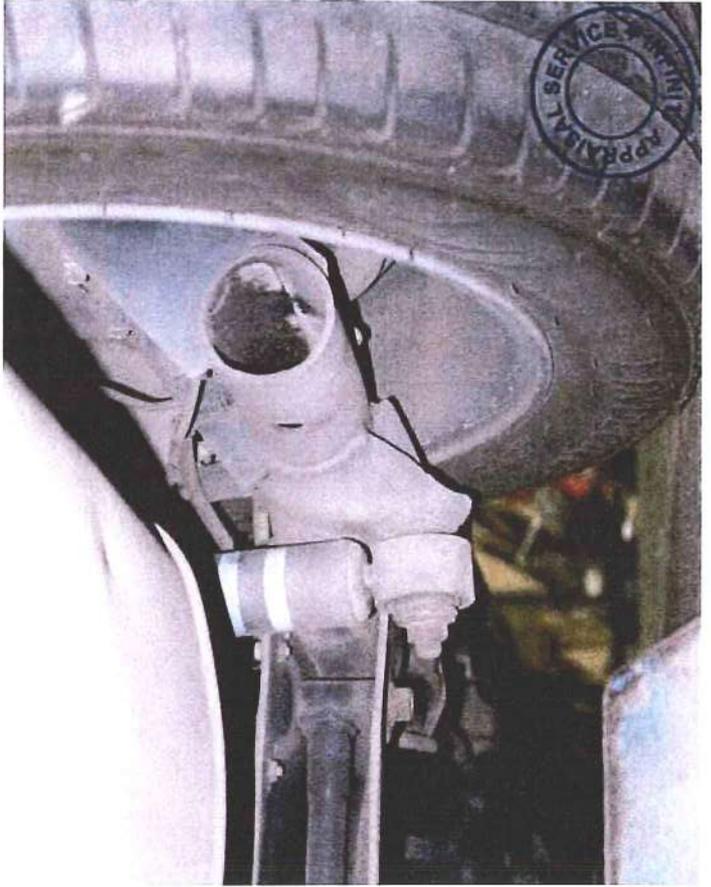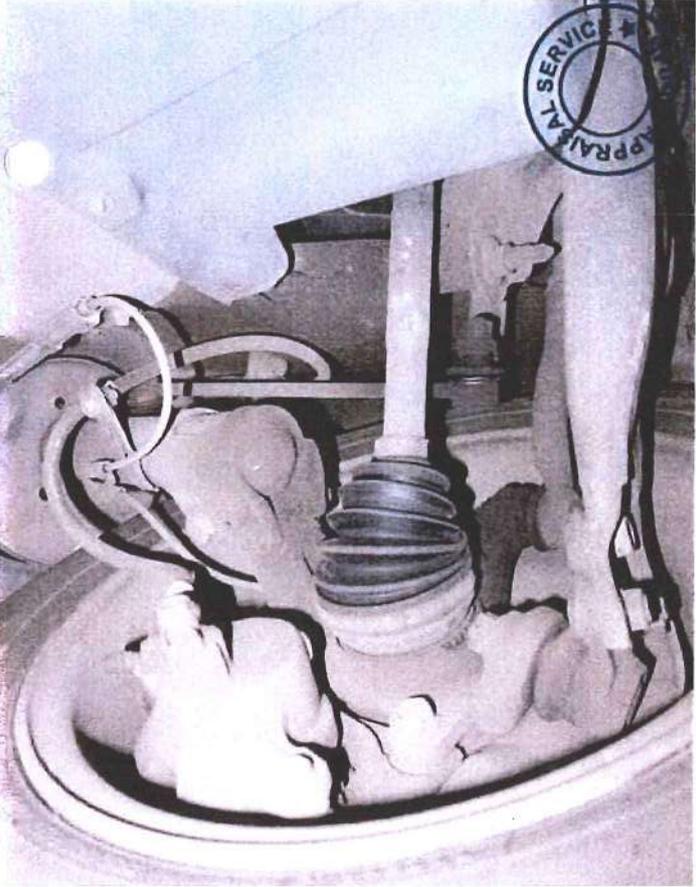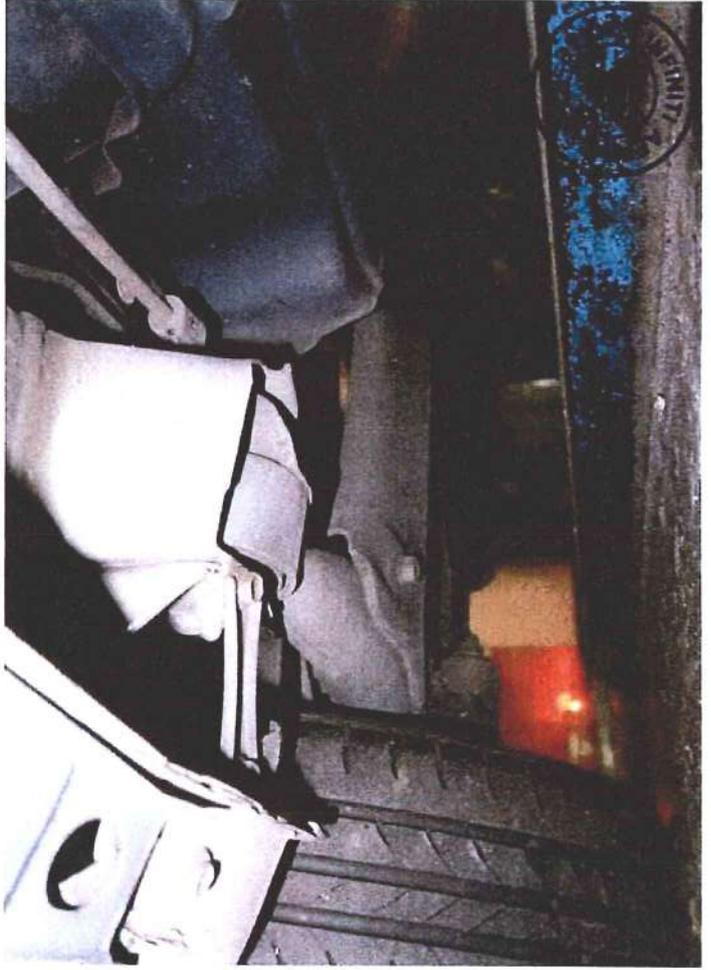


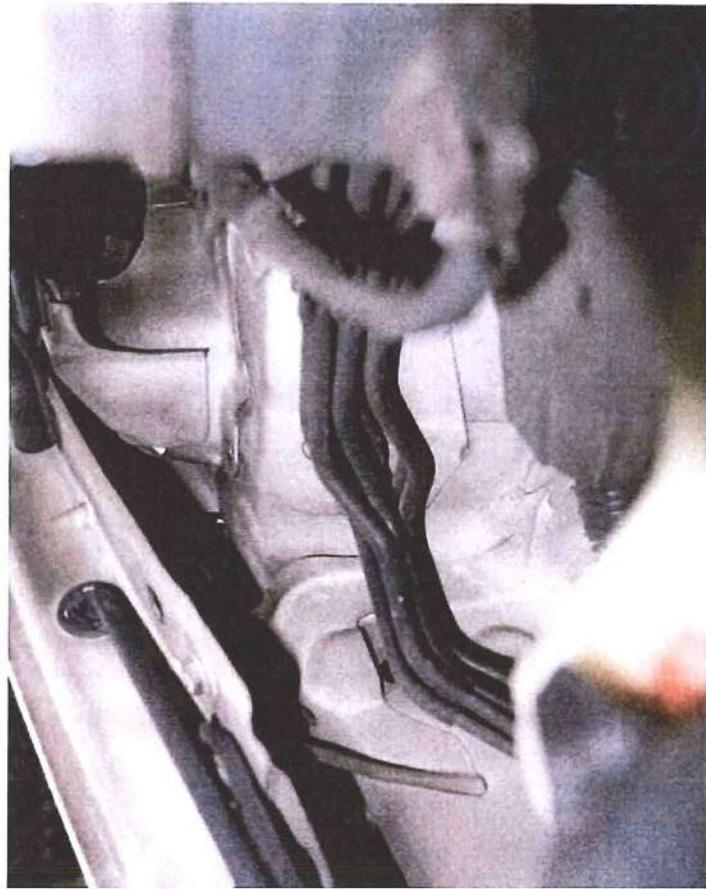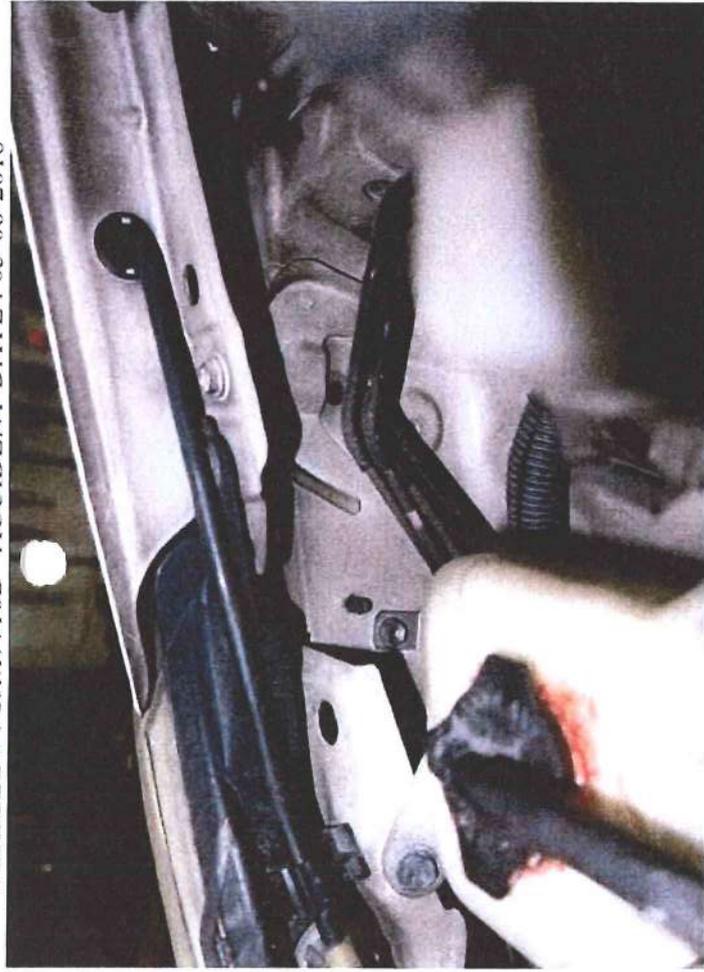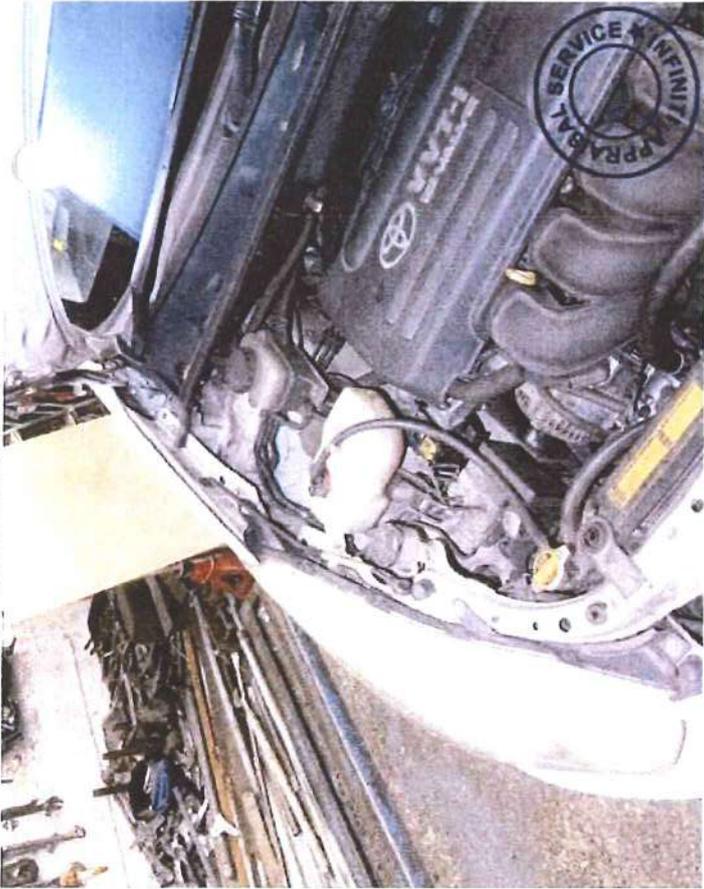

VEHICLE # : SJM7710B ACCIDENT DATE : 05-06-2018

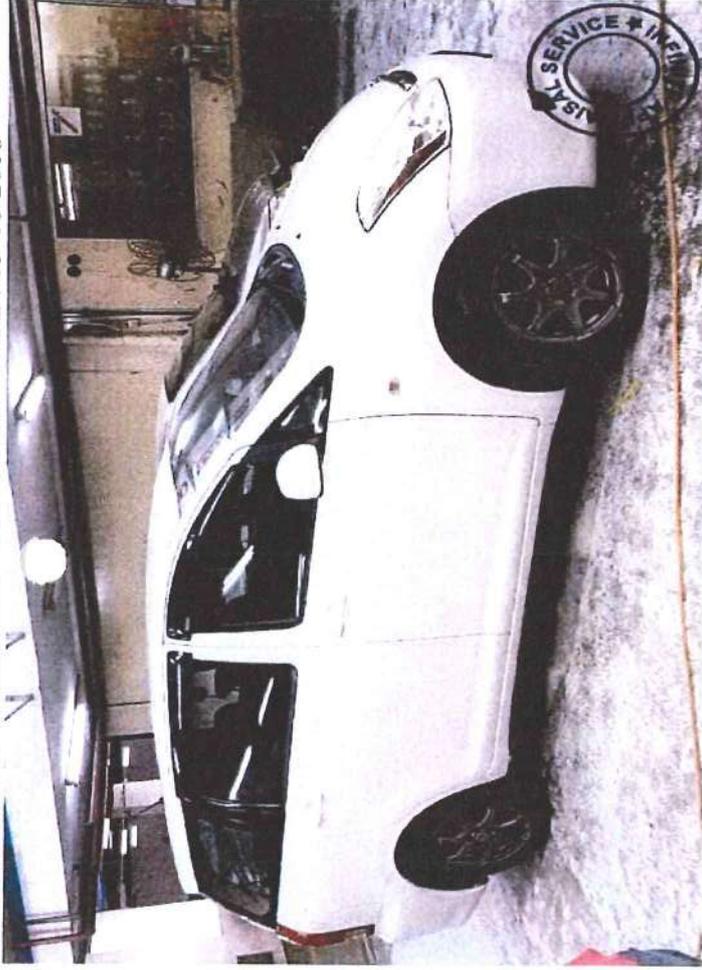

INFINITI APPRAISAL SERVICE

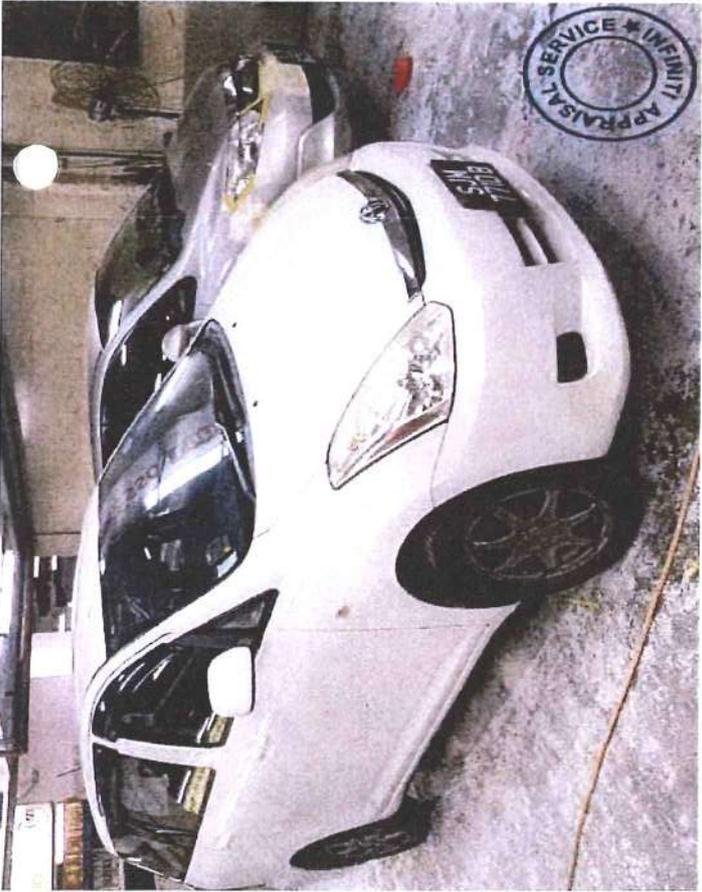

VEHICLE #: SJM7710B ACCIDENT DATE: 05-06-2018


2




4






INFINITI APPRAISAL SERVICE

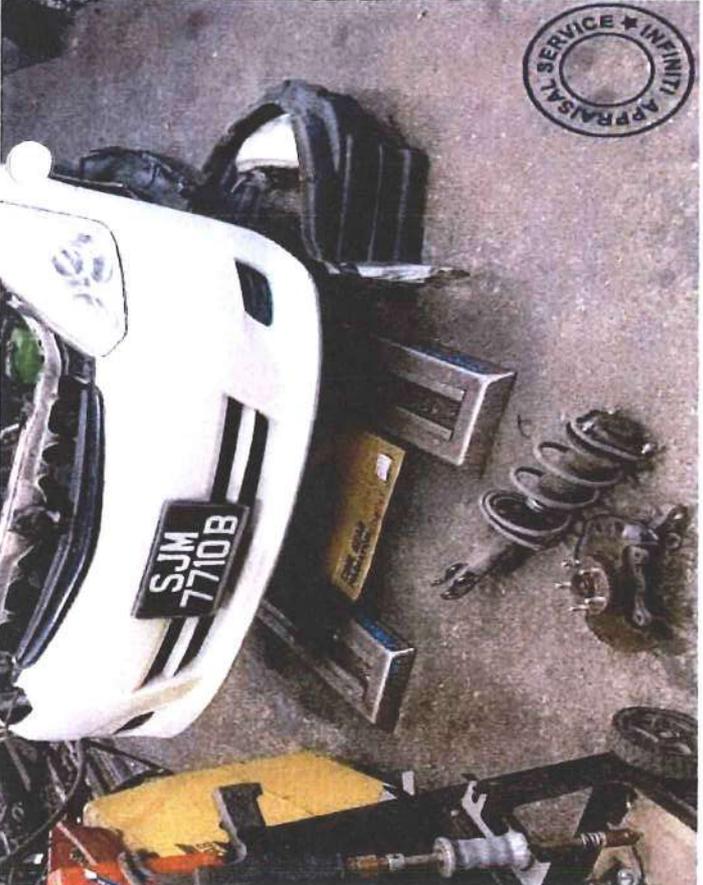

6

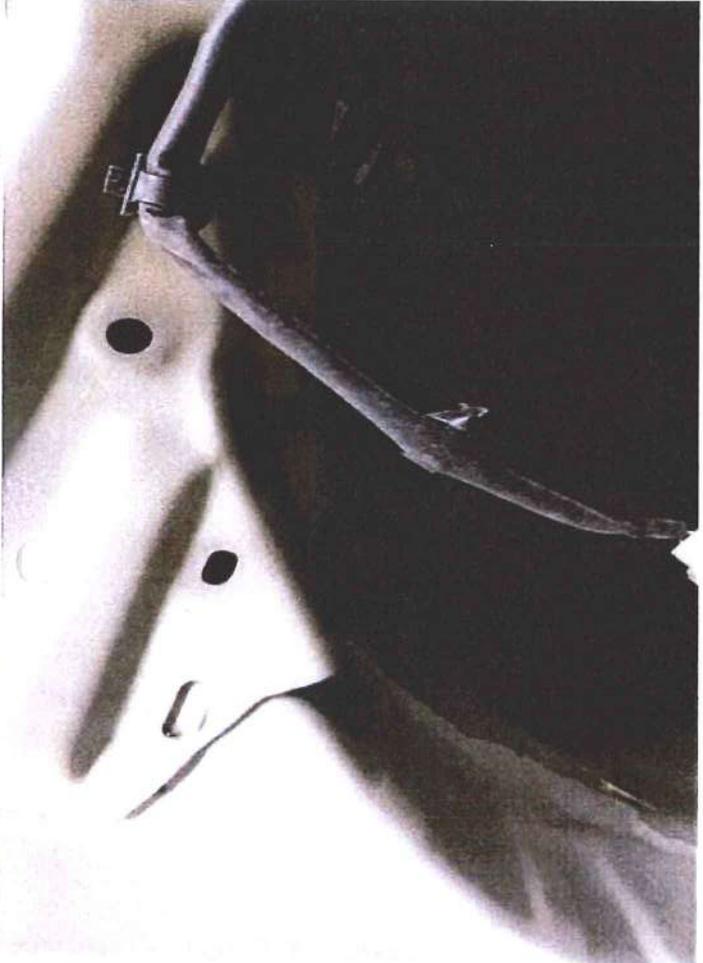

8

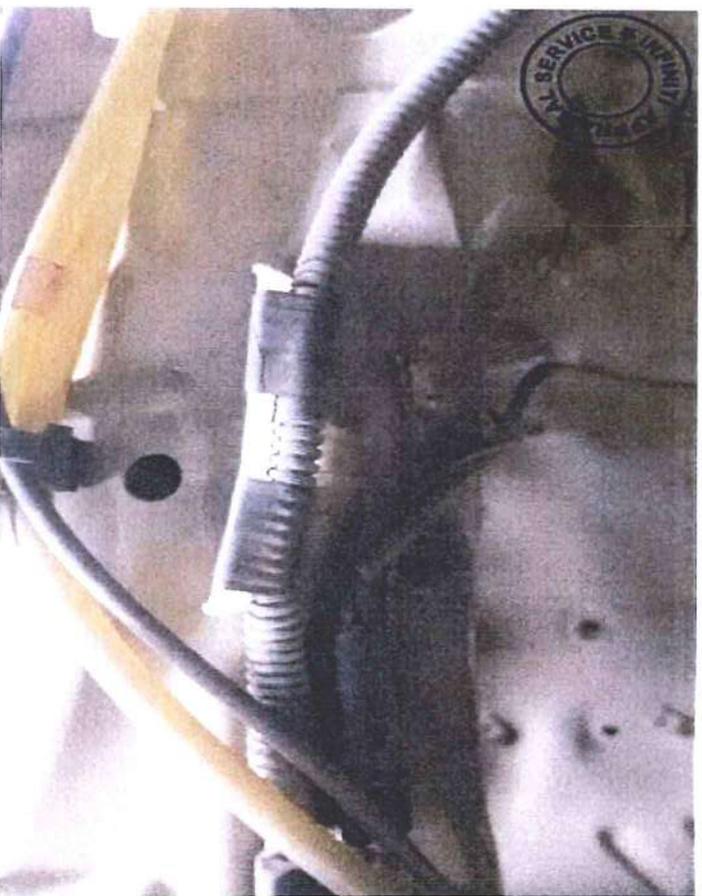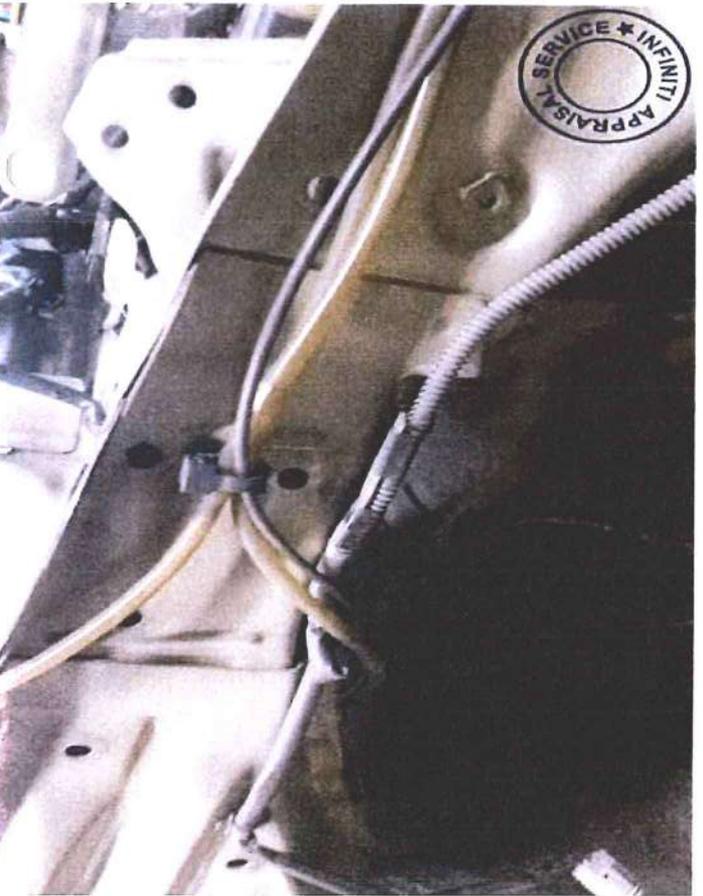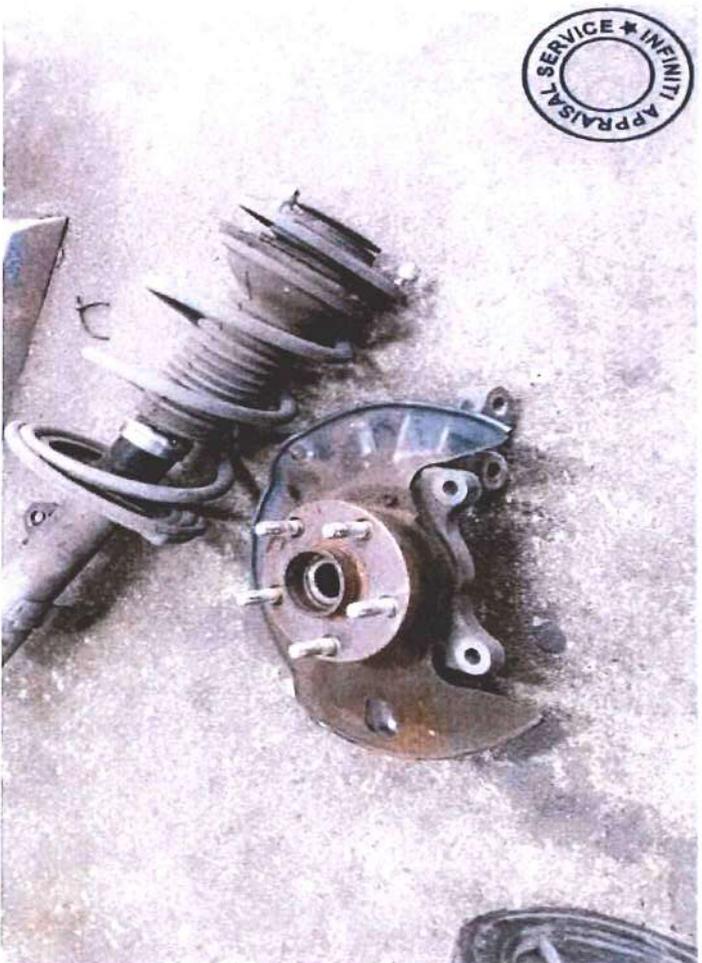

10



12

