



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2101201

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 26/02/2021
Reference CC4/FCI20010485/R1ea3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SBQ 8942R
Insured Veh. SHB 4057E
Claim No. D20003924MFSH
Policy No. D-20094922MFSH
Accident Date 25/09/2020
Inspection Date 07/10/2020

Description	Total
Survey Inspection	254.00
Digital Photographs	
Transportation	
Subtotal	254.00
GST (7%)	17.78
Grand Total	271.78

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20010485/R1ea3q2	
			Date: 26/02/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHB 4057E	Veh. Inspected	SBQ 8942R	
Policy No.	D-20094922MFSH	Coverage (\$)	0.00	
Claim No.	D20003924MFSH	Excess (\$)	0.00	
Assign From	CHRIS LIM	Assign Date	30/09/2020	
2. Vehicle Particulars & Condition				
Make & Model	MITSUBISHI PAJERO		c.c	2555
Engine No.	HIDDEN		Year of Reg.	1991
Chassis No.	JMAL047GWLJ450344		Colour	BLACK
Odometer	162470 KM		Steering	IN ORDER
Brakes	IN ORDER		Modification	SPORTS RIM
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	265/60 R15	TOYO	6 mm	
L/H Front Tyre	265/60 R15	TOYO	6 mm	
R/H Rear Tyre	265/60 R15	TOYO	6 mm	
L/H Rear Tyre	265/60 R15	TOYO	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT & O/S REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	25/09/2020	Inspection Date	07/10/2020	
Survey held at	AUTOSPRINT PTE LTD 24 LENG KEE ROAD #07-01/02 LENG KEE AUTOPOINT SINGAPORE 159096			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SBQ 8942R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	TAILLAMP RH	SCRATCHED	1,380.92	1,380.92
1	REAR BUMPER	NOT NECESSARY	952.20	-
10	REAR BUMPER CLIP	NOT NECESSARY	70.00	-
1	REAR BUMPER LOWER DIFFUSER RH	SCRATCHED	489.20	489.20
1	REAR FENDER RH	TO REPAIR SEE LABOUR	1,130.50	-
1	REAR FENDER ARCH COVER RH	SCRATCHED	298.61	298.61
1	REAR DOOR RH	NOT NECESSARY	998.43	-
1	REAR DOOR ARCH COVER RH	TO REPAIR SEE LABOUR	302.12	-
1	FRONT FENDER RH	TO REPAIR SEE LABOUR	1,128.21	-
	LESS 10% DISCOUNR		-675.02	-216.87
			6,075.17	1,951.86
	<u>LABOUR</u>			
	TO REMOVE ,REPAIR & INSTALL ALL ACCIDENT AFF PORTIONS.INCLUSIVE OF THE REPAIR OF REAR FENDER RH ,REAR DOOR ARCH COVER RH AND FRONT FENDER RH .		1,000.00	400.00
	TO CHECK ENGINE WARNING LIGHT (ABS,ECU,& ETC).	NOT NECESSARY	250.00	-
	TO CHECK ALL NECESSARY WIRING .		180.00	30.00
	TO PUTTY & RESPRAY ALL ACCIDENT AFF PORTIONS.		1,300.00	500.00
	TO APPLY ANTI-RUST COATING ON ALL ACCIDENT AFF.PORTIONS.	NOT NECESSARY	350.00	-
			3,080.00	930.00
GRAND TOTAL			9,155.17	2,881.86

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			2,300.00
---	--	--	-----------------

Report Ref No. CC4/FCI20010485/R1ea3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SBQ 8942R

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

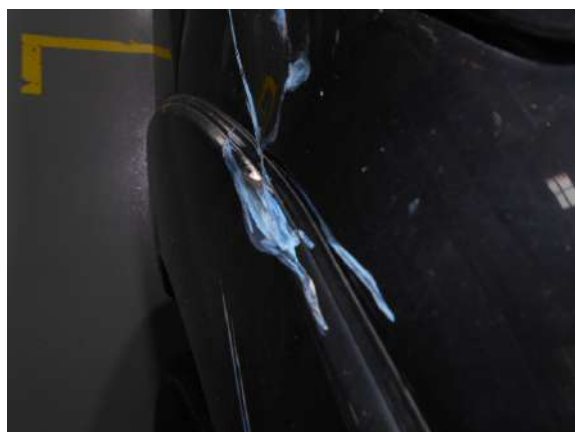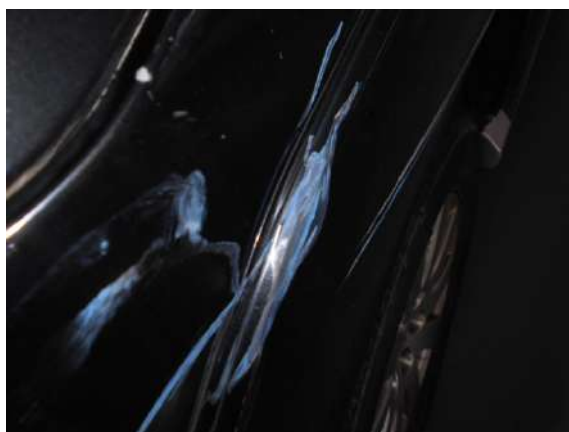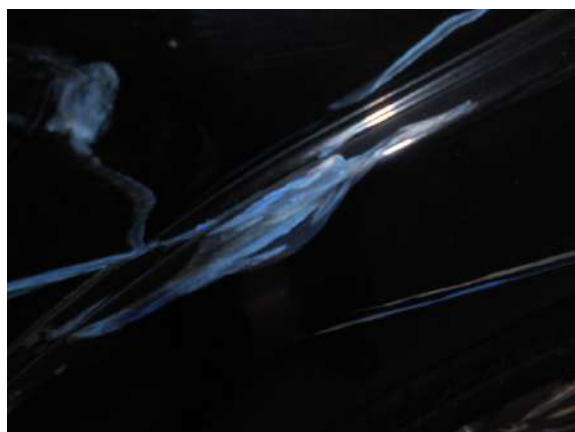



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

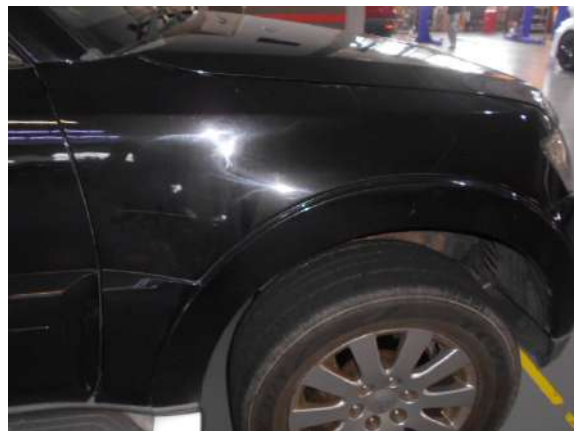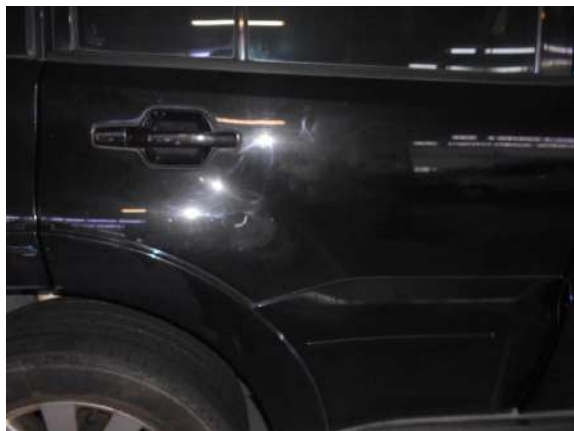



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

