



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2101360

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 05/03/2021
Reference CC4/FCI20010731/R1es3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SW 23M
Insured Veh. SH 7929H
Claim No. D20004036MFSH
Policy No. D-20094922MFSH
Accident Date 02/10/2020
Inspection Date 07/10/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20010731/R1es3q2	
			Date: 05/03/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SH 7929H	Veh. Inspected	SW 23M	
Policy No.	D-20094922MFSH	Coverage (\$)	0.00	
Claim No.	D20004036MFSH	Excess (\$)	0.00	
Assign From	VIC	Assign Date	06/10/2020	
2. Vehicle Particulars & Condition				
Make & Model	VOLKSWAGEN TIGUAN HL 280	c.c	1395	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	WVGZZZ5NZJW940698	Colour	GREY	
Odometer	38031 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	235/55 R18	PIRELLI	6 mm	
L/H Front Tyre	235/55 R18	PIRELLI	6 mm	
R/H Rear Tyre	235/55 R18	PIRELLI	6 mm	
L/H Rear Tyre	235/55 R18	PIRELLI	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	02/10/2020	Inspection Date	07/10/2020	
Survey held at	VOLKSWAGEN GROUP SINGAPORE PTE LTD 247 ALEXANDRA ROAD SINGAPORE 159934			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SW 23M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR TRUNK LID (SN)	BENT	2,072.20	2,072.20
2	1K WINDOW ADHESIVE (SN)	NECESSARY	99.02	99.02
1	ADHESIVE REMOVER (SN)	NECESSARY	114.78	114.78
1	PRIMER (SN)	NECESSARY	25.74	25.74
2	APPLICATOR (SN)	NECESSARY	18.78	18.78
1	ACTIVATOR FOR PRECOATED W (SN)	NECESSARY	23.77	23.77
1	PACKING ADHESIVE (SN)	NECESSARY	27.82	27.82
2	RIVETTED CAP NUT (SN)	NECESSARY	4.46	4.46
1	VW SIGN BLACK HIGH GLOSS (SN)	NECESSARY	96.30	96.30
1	INSCRIPTION BRIGHT CHROME TIGUAN (SN)	NECESSARY	92.83	92.83
1	COVER FOR BUMPER PRIMED REAR BUMPER (SN)	DEFORMED	1,151.75	1,151.75
1	SPOILER SATIN BLACK REAR BUMPER MID (SN)	DEFORMED	291.94	291.94
1	REAR DIFFUSOR GRANITE GRE (SN)	DEFORMED	465.10	465.10
4	RIVET (SN)	NECESSARY	4.36	4.36
1	SENSOR BRACKET (SN)	NECESSARY	12.60	12.60
1	SENSOR BRACKET (SN)	NECESSARY	12.60	12.60
1	SENSOR BRACKET (SN)	NECESSARY	12.60	12.60
1	SENSOR BRACKET (SN)	NECESSARY	12.60	12.60
1	SENSOR BRACKET (SN)	NECESSARY	12.60	12.60
1	SENSOR BRACKET (SN)	NECESSARY	12.60	12.60
1	2K-PLASTIC ADHEISVE (SN)	NECESSARY	75.94	75.94
1	BONDING AGENT FOR PLASTIC (SN)	NECESSARY	59.40	59.40
1	BUMPER REINFORCEMENT (SN)	BENT	578.43	578.43
1	ATTACHMENT STRIP RR CTR BRACKET (SN)	NECESSARY	57.67	57.67
1	GUIDE PIECE LHR SIDE BRACKET (SN)	NECESSARY	36.24	36.24
1	GUIDE PIECE RHR SIDE BRACKET (SN)	NOT NECESSARY	36.24	-
10	POP-RIVET (SN)	NECESSARY	11.40	11.40
1	DECORATIVE MOULDING BRIGH LHR (SN)	CRACKED	163.02	163.02
1	DECORATIVE MOULDING BRIGH RHR (SN)	NOT NECESSARY	166.56	-
1	DECORATIVE MOULDING BRIGHT CENTRE (SN)	CUT	211.79	211.79
1	REFLECTOR LHR INNER (SN)	MISSING	65.92	65.92

Report Ref No. CC4/FCI20010731/R1es3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REFLECTOR LHR OUTER (SN)	NOT NECESSARY	65.92	-
1	HARNESS FOR BUMPER (SN)	NOT NECESSARY	121.94	-
1	NUMBER PLATE (SN)	SCRATCHED	80.00	80.00
			6,294.92	5,904.26
	<u>LABOUR</u>			
	LABOUR .		4,200.00	1,680.00
	TRANSFER BOOTLID MECHANISM .		840.00	420.00
	R&R REAR WINDSCREEN .		840.00	840.00
	SPRAY PAINTING .		4,000.00	1,600.00
	DIAGNOSTIC AND PROGRAMMING .		480.00	480.00
	CHECK SHORT CIRCUIT /HARNESS REPAIR .	NOT NECESSARY	280.00	-
			10,640.00	5,020.00
GRAND TOTAL			16,934.92	10,924.26

RECOMMENDED COST OF REPAIRS				10,924.26
------------------------------------	--	--	--	------------------

Report Ref No. CC4/FCI20010731/R1es3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SW 23M

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SW 23M

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

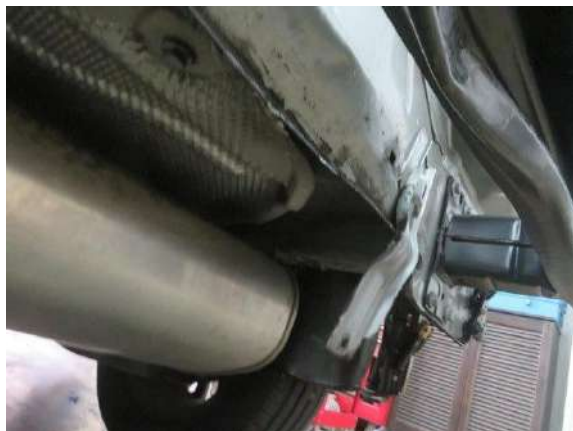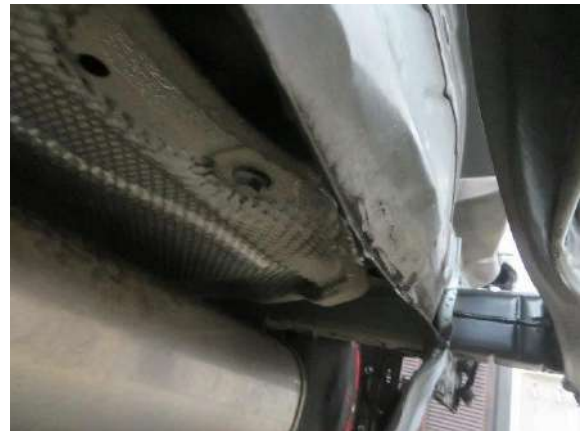



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

