



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2101925

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 24/03/2021
Reference CC6/FCI20010842/Urs3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SLU 397C
Insured Veh. SH 6956K
Claim No. D20004093MFSH
Policy No. D-18088937MFSH
Accident Date 06/10/2020
Inspection Date 08/10/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877		Ref: CC6/FCI20010842/Urs3q2 Date: 24/03/2021 Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SH 6956K	Veh. Inspected	SLU 397C
Policy No.	D-18088937MFSH	Coverage (\$)	0.00
Claim No.	D20004093MFSH	Excess (\$)	0.00
Assign From	CHRIS	Assign Date	08/10/2020
2. Vehicle Particulars & Condition			
Make & Model	OPEL ASTRA (A)	c.c	999
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	W0VBE8EA3H8099832	Colour	BLUE
Odometer	60663 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	225/45 R17	BRIDGESTONE	6 mm
L/H Front Tyre	225/45 R17	BRIDGESTONE	6 mm
R/H Rear Tyre	225/45 R17	BRIDGESTONE	6 mm
L/H Rear Tyre	225/45 R17	BRIDGESTONE	6 mm
4. Description of Damages			
	THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY. DAMAGES SEE DETAILS.		
5. General Information			
Accident Date	06/10/2020	Inspection Date	08/10/2020
Survey held at	T K LEE AUTOMOTIVE PTE LTD NO. 1 KAKI BUKIT AVE 6 #02-47 AUTOBAY SINGAPORE 417883		
5a. Remarks			
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.		
5b. Estimate Days of Repair			
	ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLU 397C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT DOOR RH	TO REPAIR SEE LABOUR	1,950.00	-
1	FRONT DOOR RUBBER RH	NOT NECESSARY	295.00	-
1	REAR DOOR RH	DENTED / BENT	1,950.00	1,950.00
1	REAR DOOR TOP HINGE RH	NOT NECESSARY	145.00	-
1	REAR DOOR BOTTOM HINGE RH	NOT NECESSARY	145.00	-
1	REAR DOOR RUBBER RH	NECESSARY	295.00	295.00
1	REAR DOOR LOCK RH	NOT NECESSARY	385.00	-
1	REAR DOOR GLASS REGULATOR	NOT NECESSARY	365.00	-
1	REAR DOOR GLASS REGULATOR MOTOR RH	NOT NECESSARY	559.00	-
1	REAR QUARTER GLASS MOULDING RH	NECESSARY	585.00	300.00
1	REAR FENDER RH	BADLY DENTED	1,980.00	1,980.00
1	REAR FENDER COWLING RH	DEFORMED / WARPED	285.00	285.00
1	REAR SHOCK ABSORBER RH	TWISTED	355.00	355.00
1	REAR AXLE	NOT NECESSARY	4,530.00	-
1	REAR AXLE WHEEL BEARING RH	DAMAGED	580.00	580.00
1	REAR BUMPER	CUT / TORN	1,850.00	1,850.00
2	REAR BUMPER SIDE RETAINER RH/LH @\$145.00	NOT NECESSARY	290.00	-
	LESS 10% DISCOUNT		-1,654.40	-759.50
			14,889.60	6,835.50
<u>SPECIAL NETT ITEMS</u>				
1	REAR SPORT RIM RH (SN)	CUT	780.00	600.00
1	REAR TYRE RH (SN)	SERVICEABLE	280.00	-
1	REAR QUARTER GLASS SPONGE TAPE RH (SN)	NECESSARY	10.00	10.00
1	REAR QUARTER GLASS SEALANT RH (SN)	NECESSARY	30.00	30.00
			1,100.00	640.00
<u>LABOUR</u>				
	TO KNOCK OUT DENT ,CUT/WELD REAR FENDER RH AND REPLACE ACCIDENT PARTS.INCLUSIVE OF THE REPAIR OF FRONT DOOR RH .		1,000.00	800.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO SPRAY PAINTING ON ACCIDENT PARTS.		1,100.00	900.00
	TO TRANSFER & DOOR PARTS.		160.00	60.00
	TO REMOVE ,REFIX REAR QUARTER GLASS RH .		60.00	60.00
	TO REMOVE ,REFIX CUSHION AND INNER TRIM .		120.00	80.00
	TO REMOVE ,REFIX FUEL TANK .		120.00	60.00
	TO REMOVE ,REPLACE REAR UNDERCARRIAGE.		350.00	120.00
	4 WHEEL ALIGNMENT.		120.00	80.00
	TO TUFF-KOTE.		90.00	60.00
			3,120.00	2,220.00
	GRAND TOTAL		19,109.60	9,695.50
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			7,700.00

Report Ref No. CC6/FCI20010842/Urs3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLU 397C

INSPECTION

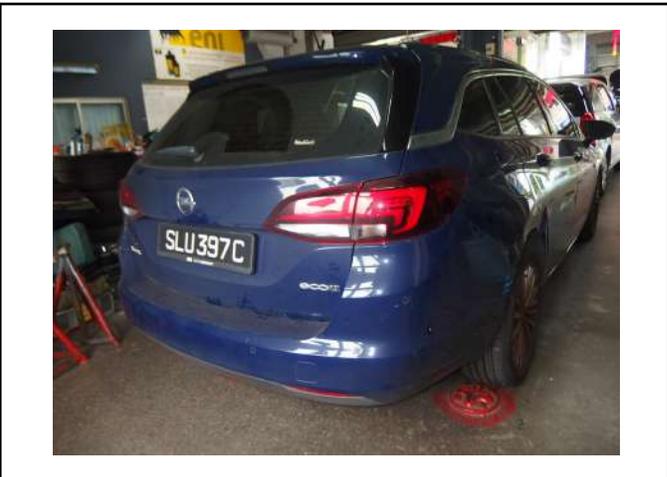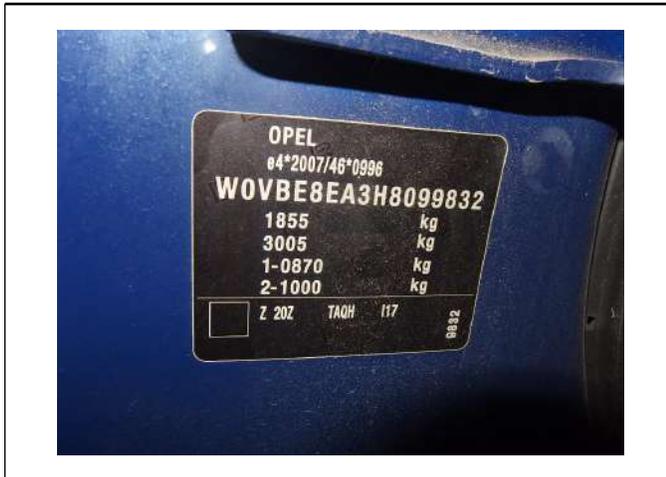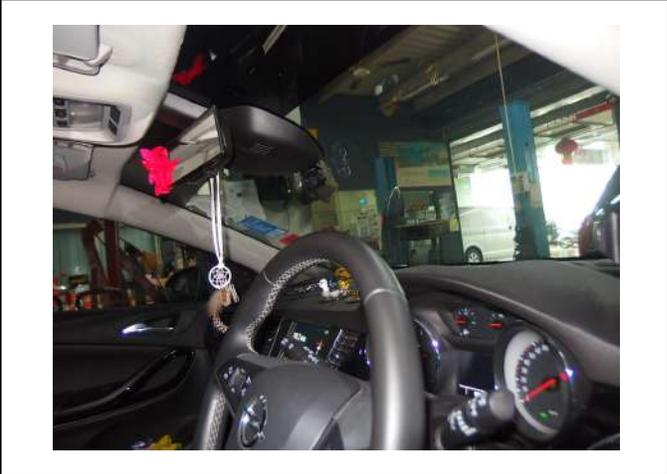






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

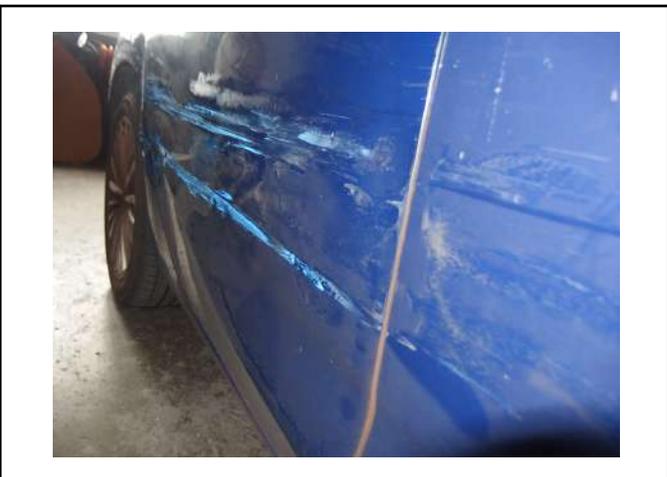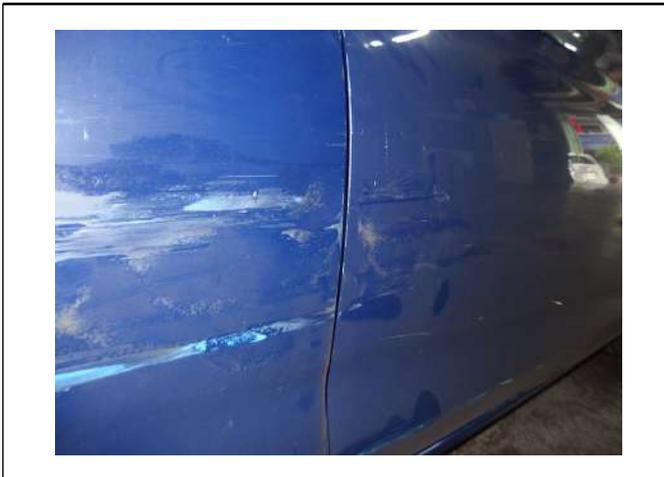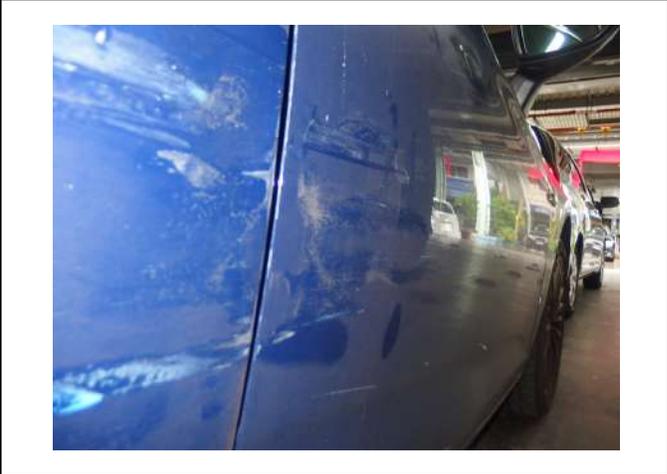




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

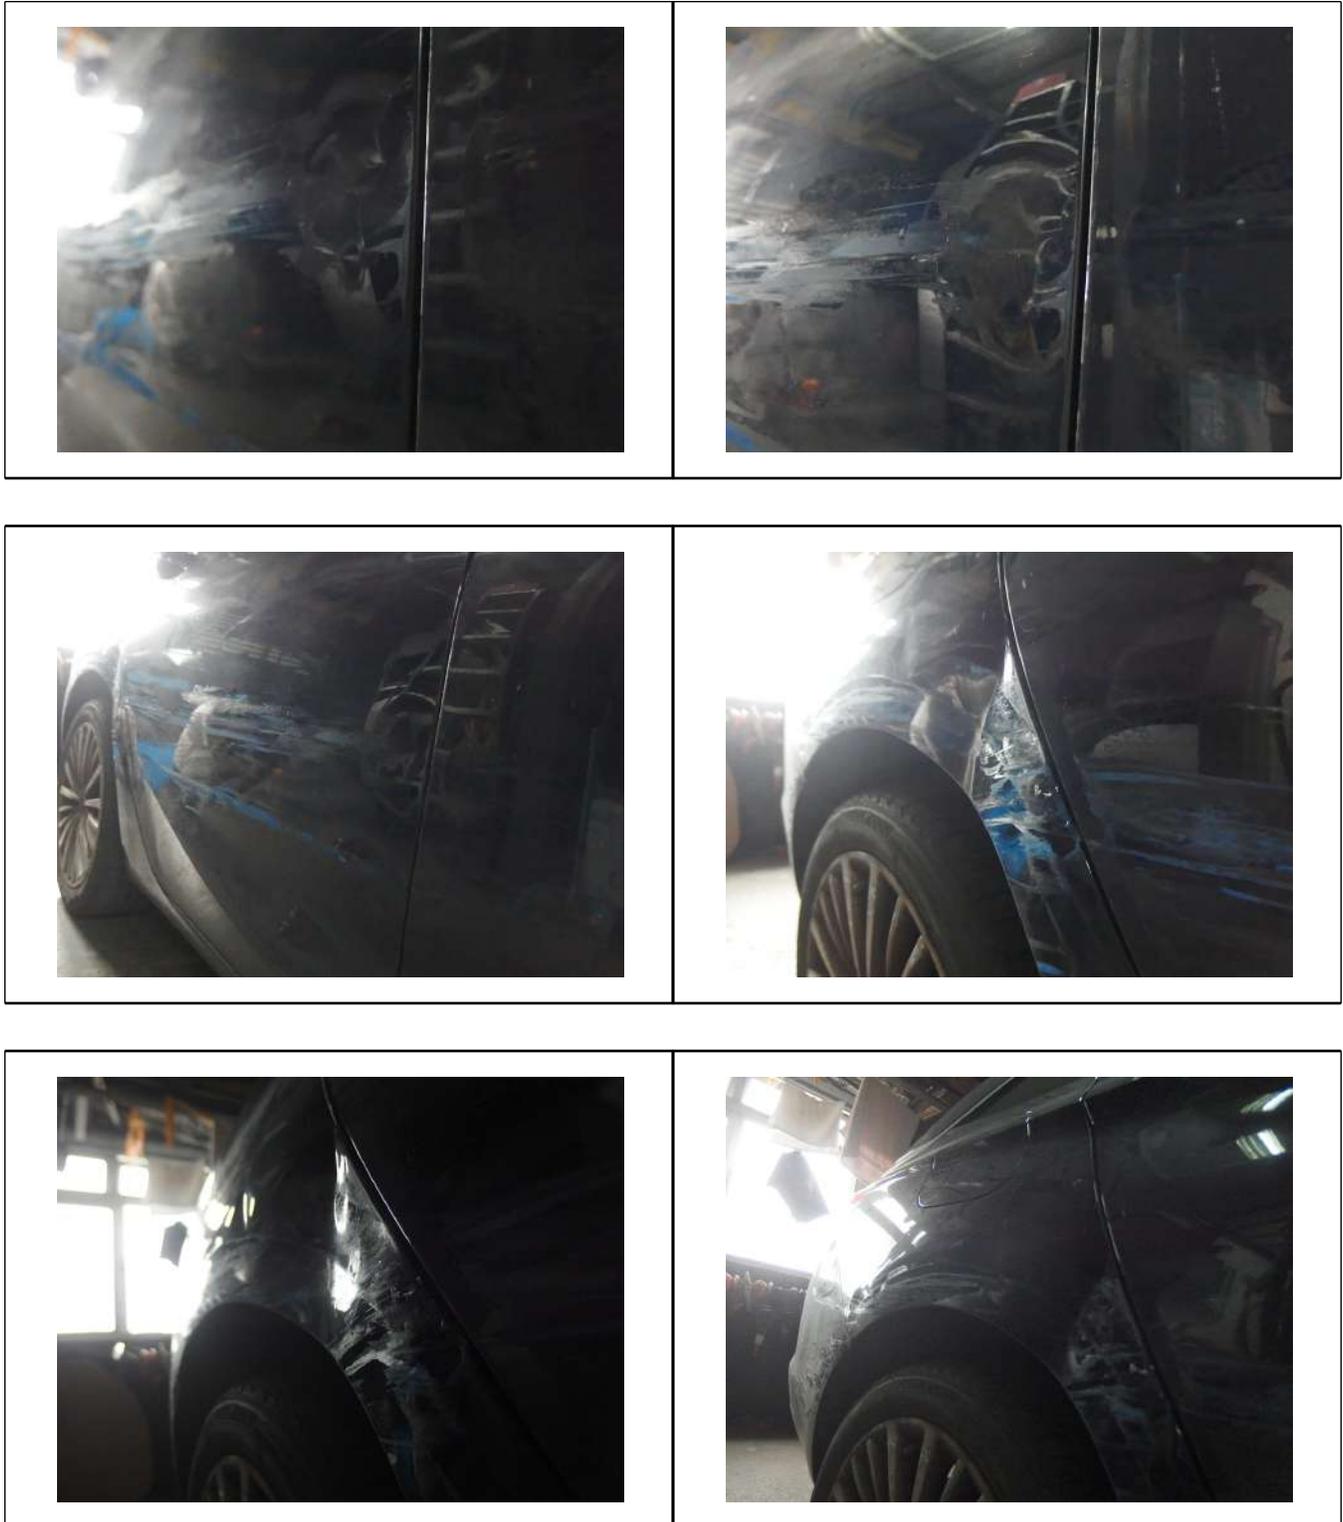





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

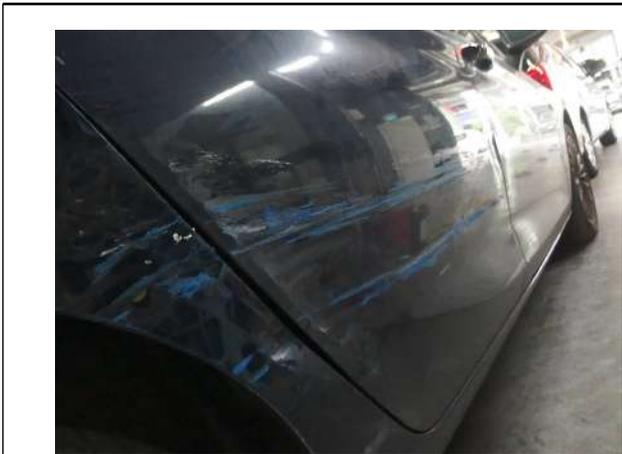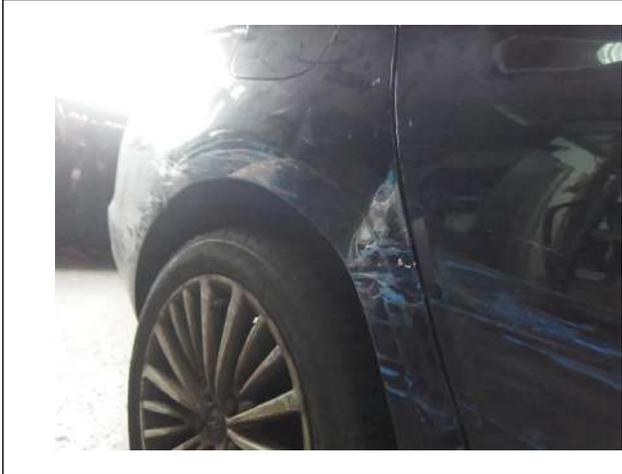




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

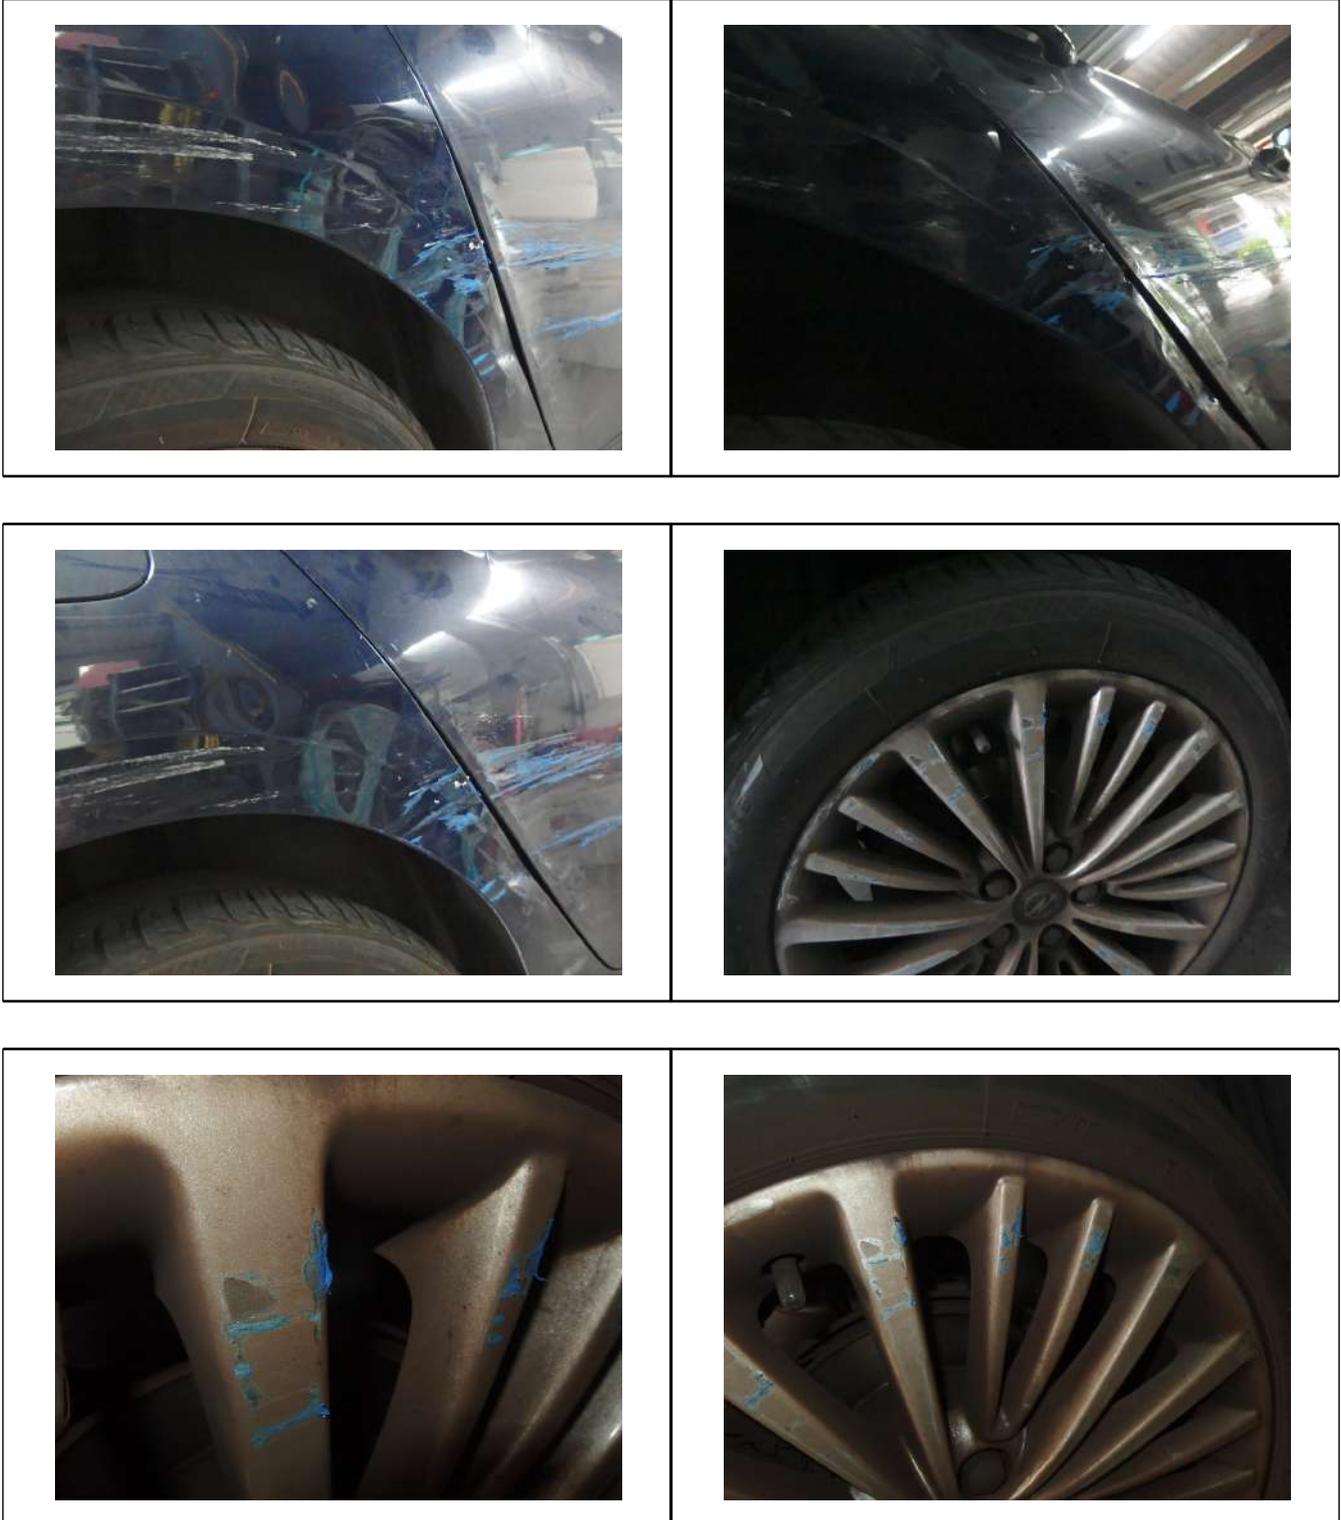




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

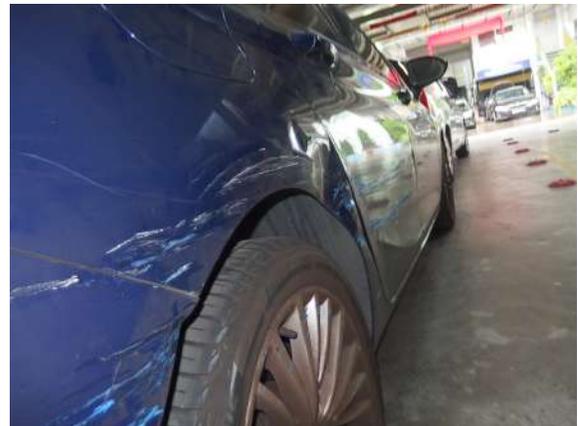



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLU 397C

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLU 397C

RE-INSPECTION

