



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2101068

INV Date 18/02/2021

Reference CC4/LPC20010986/R1gs3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SLZ 6073X
Insured Veh. SLX 7237U
Claim No. 20/20/20/VP05/023761
Policy No. Z20VP05026794
Accident Date 11/10/2020
Inspection Date 13/10/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC20010986/R1gs3q2 Date: 18/02/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLX 7237U	Veh. Inspected	SLZ 6073X	
Policy No.	Z20VP05026794	Coverage (\$)	0.00	
Claim No.	20/20/20/VP05/023761	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	12/10/2020	
2. Vehicle Particulars & Condition				
Make & Model	HONDA JAZZ 1.5 CVT	c.c	1498	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	JHMGK5850JX205995	Colour	GREY	
Odometer	30500 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	185/55 R16	YOKOHAMA	6 mm	
L/H Front Tyre	185/55 R16	YOKOHAMA	6 mm	
R/H Rear Tyre	185/55 R16	YOKOHAMA	6 mm	
L/H Rear Tyre	185/55 R16	YOKOHAMA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	11/10/2020	Inspection Date	13/10/2020	
Survey held at	KAH MOTOR CO SDN BERHAD NO. 255 ALEXANDRA ROAD SINGAPORE 159937			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			12 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLZ 6073X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FACE RR BUMPER (SN)	DEFORMED	386.62	386.62
1	COVER.R.RR BUMPER (SN)	SERVICEABLE	15.90	-
1	COVER.L.RR BUMPER (SN)	SCRATCHED	15.90	15.90
1	DIFFUSER ASSY.RR PR (SN)	DEFORMED	159.07	159.07
1	SPACER.R.RR BUMPER SIDE (SN)	NECESSARY	12.97	12.97
1	SPACER.L.RR BUMPER SIDE (SN)	NECESSARY	12.97	12.97
9	CLIP,BUMPER (SN)	NECESSARY	15.52	15.52
1	TAILGATE COMP (SN)	BUCKLED	562.20	562.20
1	WEATHERSTRIP TAILGATE (SN)	NECESSARY	69.22	69.22
1	LOCK ASSY,TAILGATE (SN)	JAMMED	64.65	64.65
1	EMBLEMRR (SN)	NECESSARY	8.92	8.92
1	GARNISH ASSY.RR. LICENSE (SN)	SCRATCHED	164.32	164.32
1	EMBLEMH (SN)	NECESSARY	8.02	8.02
1	PANEL COMPRR (SN)	BUCKLED	246.45	246.45
1	PANEL SET.RR FLOOR (SN)	BUCKLED	525.75	525.75
1	PANEL SET,L.RR OUTSIDE (SN)	TO REPAIR SEE LABOUR	438.97	-
1	TAILLIGHT ASSY,R (SN)	SCRATCHED	183.45	183.45
1	TAILLIGHT ASSYL (SN)	SCRATCHED	183.45	183.45
1	RUBBER CWINDOWSHIELD DAMPER (SN)	NECESSARY	8.77	8.77
2	RUBBER WINDOWSHIELD DAMPER (SN)	NECESSARY	10.65	10.65
1	DAMPERSTD 5X5 (SN)	NECESSARY	6.52	6.52
1	WINDSCREEN SEALANT (SN)	NECESSARY	60.00	60.00
1	4PCS REAR SENSOR (SN)	NOT WORKING	320.00	320.00
1	BUZZER ASSYSMART (SN)	CRACKED	47.17	46.50
1	SUNDRIES (SN)	NECESSARY	100.00	30.00
1	ANTENNA ASSYL.F (SN) (ADDITIONAL)	CRACKED	45.60	45.60
2	GROMMET ASSYL.F (SN) (ADDITIONAL)	NECESSARY	3.60	3.60
1	LINING ASSY,RR.PANEL (SN) (ADDITIONAL)	NECESSARY	45.60	45.60
			3,722.26	3,196.72

Report Ref No. CC4/LPC20010986/R1gs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	BODY JOINT SEALANT FOR TAILGATE.		100.00	100.00
	BODY JOINT SEALANT FOR END PANEL.		100.00	100.00
	BODY JOINT SEALANT FOR FLOOR PANEL.		100.00	100.00
	INSPECT RR LIGHTING MECHANISMS.PERFORM WATER.		180.00	180.00
	REMOVE & RENEW REVERSE SENSORS-4PCS.		180.00	180.00
	REMOVE INSTALL & CALIBRATE REAR VIEW CAMERA.		650.00	580.00
	RESET VEHICLE SMART ENTRY SYSTEM.		650.00	580.00
	REMOVE & INSTALL REAR COMPARTMENT LININGS.		650.00	650.00
	REMOVE & TRANSFER ITEMS TO NEW TAILGATE. & ADJUST.		650.00	325.00
	WINDSCREEN DAM KIT.		100.00	100.00
	REPLACE RR WINDSCREEN.		650.00	650.00
	CUT OFF & RENEW RR PANEL.RENEW ALL DAMAGE PARTS.INCLUSIVE OF THE REPAIR OF PANEL SET,L.RR OUTSIDE.		8,000.00	5,200.00
	SPRAY PAINTING ON REPAIRED OR REPLACED AREAS (6P).		4,000.00	3,120.00
	TOWING SERVICE.	NOT NECESSARY	120.00	-
			16,130.00	11,865.00
	GRAND TOTAL		19,852.26	15,061.72
	RECOMMENDED COST OF REPAIRS			15,061.72

Report Ref No. CC4/LPC20010986/R1gs3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLZ 6073X

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

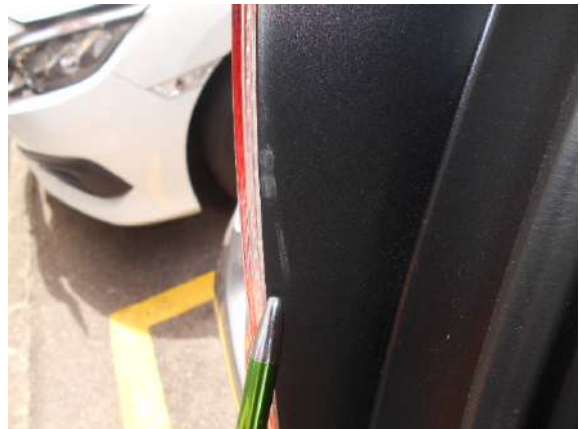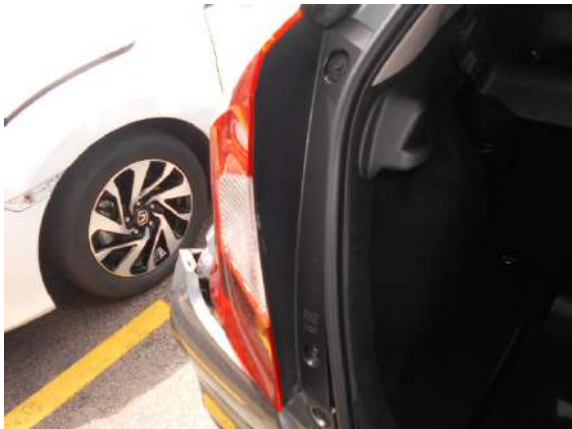



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLZ 6073X

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

