

ASS. REC. BY:

REF:

CC4/ASM20011482/Db³

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

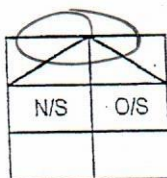
Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 13 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SMR 5801 Z yr Regn: 2015 FebType: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: BMW X3 E35 i.c.c. 2979Colour: Black A/C: Insured / Std / NI / NASp. Reading: 98405 T/Radio: Insured / Std / NI / NAEng/No: 001689 25H55B30AC/No: WBAWX7206*00C21825Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 245/45R19R: — 11 —

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Goodyear

Front Rear

R/Bal. S mm R/Bal. S mmL/Bal. S mm L/Bal. S mmD.O.A. 19/10/2020 D.O.I. 22/10/2020Survey held at Teamwork Pyc Ubi

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	<u>AXA SLF 3915 S</u>
	<u>MV 115K (using average dep of abt 18K/yr) * 2 dep</u>
	<u>LTA 85.91K</u>
	<u>HL 29.1K</u>
	<u>15K</u>
	<u>X4 dep</u>
	<u>20K</u>
<u>18/05/2021</u>	<u>Finalize L/S 21,800/- with 13 days go</u>

Date/Time, File Pass to?

☐ : Preli. Report

1)

☐ : Final Report

Date/Time, File Return to?

2)

Rep. Format: _____

Lump Sum / L.B. ()

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee:

☐ : Site Insp (\$)☐ : Interview (\$)☐ : Tech. Invs (\$)☐ : Weekend (\$)

Survey Fee:

Transportation:

S + RS. SI

Photos

Others

TOTAL

AXA INSURANCE

Vehicle number	SMR5801Z
Make / Model	BMW X3
Chassis number	WBAWX720600C21825
Accident Date	19/10/2020
Reference	2010-26

Qty	Particulars	Unit Price - SGD \$	
<u>PARTS REPLACEMENT - LIST ITEMS</u>			
1	FRONT BUMPER <i>Cut</i>	1840.00 ✓	1513.20
2	FRONT BUMPER RETAINER <i>src</i>	84.00 X	
1	FRONT BUMPER REINFORCEMENT <i>& Dental</i>	690.00 ✓	
2	FRONT BUMPER REINFORCEMENT BRACKET <i>HW o/s n/s BT</i>	430.00 X ✓	215.00
1	FRONT BUMPER SPONGE <i>2 torn</i>	205.00 ✓	
1	FRONT BUMPER LOWER <i>cut</i>	345.00 ✓	
1	FRONT BUMPER LOWER GARNISH <i>HW</i>	322.00 X	
1	FRONT BUMPER LOWER GRILLE <i>src</i>	244.00 X	
1	FRONT BUMPER TOP GARNISH <i>broken HW</i>	192.00 <i>HW</i> X	
2	FRONT BUMPER SIDE COVER <i>HW o/s HW n/s money check</i>	225.40 X ✓	112.70
2	FRONT BUMPER SIDE COVER CHROME GARNISH <i>src</i>	192.00 X	
2	FRONT FOG LAMP <i>n/s cut o/s HW</i>	1150.00 ✓	575.00
1	FRONT GRILLE <i>cut & n/s cut</i>	415.00 ✓	
2	FRONT GRILLE CHROME GARNISH <i>cut n/s</i>	216.00 <i>HW</i> X	
2	FRONT HEADLAMP <i>n/s cut/broken o/s cut</i>	8920.00 ✓	3812.10 x 2
2	FRONT HEADLAMP DRIVER MODULE <i>HW</i>	1564.00 X	7624.20
2	FRONT HEADLAMP LED MODULE <i>HW</i>	1955.00 X	
2	FRONT HEADLAMP BRACKET <i>HW</i>	437.00 X	
1	FRONT SUPPORT PANEL <i>HW broken</i>	568.00 X ✓	
1	FRONT SUPPORT PANEL TOP GARNISH <i>HW</i>	192.00 X	
1	RADIATOR <i>HW</i>	943.00 X	
2	RADIATOR SIDE GARNISH <i>HW</i>	276.00 X	
1	RADIATOR FAN COWLING <i>HW</i>	579.50 X	
1	AIRCON CONDENSER <i>HW</i>	1265.00 X	
1	BONNET <i>Dental</i>	2070.00 ✓	
1	BONNET EMBLEM - LOGO <i>dislodged</i>	93.60 ✓	
1	BONNET RUBBER <i>src</i>	84.00 X	
1	DRIVER AIRBAG <i>activated</i>	1495.00 ✓	1315.00
1	PASSENGER AIRBAG <i>activated</i>	1495.00 ✓	1023.80
1	AIRBAG MODULE <i>activated</i>	1380.00 ✓	832.10
1	STEERING COIL SPRING <i>HW burnt / Done</i>	1035.00 X ✓	321.00
1	SIDE AIRBAG <i>activated</i>	600.00 ✓	
1	DRIVER SEATBELT BUCKLE <i>activated</i>	402.50 ✓	
1	ROOF LINING <i>HW crumpled</i>	6325.00 X ✓	2011.20
1	DASHBOARD <i>HW broken</i>	4025.00 X ✓	2388.00
2	FRONT FENDER <i>n/s rgr o/s HW</i>	2244.00 X	
4	FRONT PDC SENSOR <i>2pc damaged 2pc src</i>	2622.00 ✓	550.00
		47171.00	
		Less 5%	2358.55
		Subtotal	44812.45

23870.30

21483.27

<u>PARTS REPLACEMENT - SPECIAL NETT ITEMS</u>		
1 SET	FRONT BUMPER CLIP <i>Hec</i>	40.00 30/-
1 SET	FRONT GRILLE CLIP <i>Hec</i>	60.00 20/-
1 SET	FRONT SUPPORT PANEL TOP GARNISH CLIP <i>HJ</i>	60.00 X
1 SET	FRONT BUMPER LOWER GRILLE CLIP <i>HJ</i>	40.00 X
1	FRONT NUMBER PLATE <i>dislodged</i>	80.00 45/-
1	FRONT NUMBER PLATE GARNISH <i>HJ</i>	50.00 X
1	JOINT SEALANT <i>HJ</i>	150.00 X
Subtotal		480.00
<u>LABOUR AND MISCELLANEOUS CHARGES</u>		
Balance C/F		45292.45
1	CHECK WIRING AND LIGHTING SYSTEM	120.00 30/-
2	REMOVE, REFIT LINING, TRIM AND GARNISH	150.00 <i>HJ</i>
3	DIAGNOSIS CHECK AFTER REPAIR	500.00 320/-
4	TO R&R FRONT SENSOR	200.00 40/-
5	TO R&R ROOF LINING AND REPLACE AIRBAG SYSTEM	300.00 ?
6	TO R&R DASHBOARD AND REPLACE AIRBAG SYSTEM	300.00 } 300/-
7	TO R&R SEAT AND CARPET FOR AIRBAG REPLACEMENT	300.00
8	TO R&R AIR CONDENSER AND RE-CHARGE AIRCON GAS	150.00 <i>HJ</i>
9	TO R&R RADIATOR AND TOP UP COOLANT	150.00 <i>HJ</i>
10	TO R&R FROM OLD BONNET TO NEW	200.00 50/-
11	PANEL BEATING ON AFFECTED AREAS	2600.00 900/-
12	SPRAY PAINTING ON AFFECTED AREAS	2400.00 700/-
13	APPLY ANTI RUST ON AFFECTED AREAS	150.00 40/-
14	TOWING	150.00 <i>HJ</i>
Subtotal		7670.00
Grandtotal		52962.45

95.00

2380.00

22/10/2020 @ 1500h

Not Antenna

L/S in 13 days

Ryan

2kk Auto

[Signature]

23958.27

Supp 3387.60

27345.87

L/S 21800/-

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

AXA INSURANCE

Vehicle number	SMR5801Z
Make / Model	BMW X3
Chassis number	WBAWX720600C21825
Accident Date	19/10/2020
Reference	2010-26

Qty	Particulars	Unit Price - SGD \$
<u>PARTS REPLACEMENT - LIST ITEMS</u>		
1	FRONT BUMPER CAMERA <i>NI</i>	825.00 <i>X</i>
1	FRONT BUMPER CENTRE GRILLE <i>broken</i>	198.00 <i>✓</i>
1	FRONT BUMPER UNDERCOVER <i>torn</i>	308.00 <i>✓</i>
1	SBK CABLE <i>? Dam</i>	209.00 <i>✓</i>
1	FRONT LH NOZZLE <i>broken</i>	209.00 <i>✓</i>
1	FRONT LH NOZZLE COVER <i>cut</i>	93.50 <i>✓</i>
1	AIRDUCT LH <i>broken</i>	102.00 <i>✓</i>
1	AIR CHANNEL <i>broken</i>	98.00 <i>✓</i>
1	SENSOR WIRE HARNESS <i>ton</i>	462.00 <i>✓</i>
1	WHEEL ARC GARNISH <i>many broken / 1st</i>	242.00 <i>✓</i>
1	REINFORCEMENT HOLDER <i>broken</i>	198.00 <i>✓</i>
1	TEMPERATURE SENSOR <i>ton Dam / torn</i>	139.00 <i>✓</i>
1	INTERCOOLER <i>1st</i>	825.00 <i>✓</i>
1	FRONT NUMBER PLATE HOLDER <i>distorted / broken</i>	82.50 <i>✓</i>
1	FRONT GRILLE <i>crack o/s</i>	415.00 <i>✓</i>
		4406.00
	Less 10%	470.30
	Subtotal	4232.70

J. Y. J.

23/10/2020

2 KK Auto

[Signature]

3383.00

3044.70

AXA INSURANCE

Vehicle number	SMR5801Z
Make / Model	BMW X3
Chassis number	WBAWX720600C21825
Accident Date	19/10/2020
Reference	2010-26

Qty	Particulars	Unit Price - SGD \$
1	<u>PARTS REPLACEMENT - LIST ITEMS</u>	
	FRONT GRILLE BASE <i>broken</i>	568.00 ✓
		568.00
	Less 10%	56.80
	Subtotal	511.20

381.20

342.90

[Signature]

2kk And

[Signature]