



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2103229

3 ANSON ROAD #16-00  
SPRINGLEAF TOWER  
SINGAPORE 079909

INV Date 10/05/2021  
Reference CC6/CTI20011779/Upa3q2  
Code CTI

### PROFESSIONAL SERVICE FEE

Vehicle No. JKS 8925  
Insured Veh. YN 7127C  
Claim No. SNM20D204051/C03  
Policy No. DMCVSNA00090332000  
Accident Date 27/10/2020  
Inspection Date 29/10/2020

| Description                    | Total         |
|--------------------------------|---------------|
| Third Party Express Settlement | 400.00        |
| <b>Subtotal</b>                | <b>400.00</b> |
| <b>GST (7%)</b>                | <b>28.00</b>  |
| <b>Grand Total</b>             | <b>428.00</b> |

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

| Affiliated to Federation Internationale Des Experts En Automobile                                                                      |                                                                                            |                 |                                                              |  |
|----------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------|-----------------|--------------------------------------------------------------|--|
| CHINA TAIPING INSURANCE (S) PTE LTD<br>3 ANSON ROAD #16-00<br>SPRINGLEAF TOWERSINGAPORE 079909                                         |                                                                                            |                 | Ref: CC6/CTI20011779/Upa3q2<br>Date: 10/05/2021<br>Code: CTI |  |
| <b>1. Policy Particulars :- THIRD PARTY CLAIM</b>                                                                                      |                                                                                            |                 |                                                              |  |
| Insured Veh.                                                                                                                           | YN 7127C                                                                                   | Veh. Inspected  | JKS 8925                                                     |  |
| Policy No.                                                                                                                             | DMCVSNA00090332000                                                                         | Coverage (\$)   | 0.00                                                         |  |
| Claim No.                                                                                                                              | SNM20D204051/C03                                                                           | Excess (\$)     | 0.00                                                         |  |
| Assign From                                                                                                                            |                                                                                            | Assign Date     | 29/10/2020                                                   |  |
| <b>2. Vehicle Particulars &amp; Condition</b>                                                                                          |                                                                                            |                 |                                                              |  |
| Make & Model                                                                                                                           | NISSAN GRAND LIVINA (A)                                                                    | c.c             | 1798                                                         |  |
| Engine No.                                                                                                                             | HIDDEN                                                                                     | Year of Reg.    | 2008                                                         |  |
| Chassis No.                                                                                                                            | PN8BCAL10TCA20371                                                                          | Colour          | BLUE                                                         |  |
| Odometer                                                                                                                               | 426279 KM                                                                                  | Steering        | IN ORDER                                                     |  |
| Brakes                                                                                                                                 | IN ORDER                                                                                   | Modification    | NIL                                                          |  |
| General                                                                                                                                | GOOD                                                                                       |                 |                                                              |  |
| <b>3. Conditions of Tyres</b>                                                                                                          |                                                                                            |                 |                                                              |  |
|                                                                                                                                        | Size                                                                                       | Make            | Balance                                                      |  |
| R/H Front Tyre                                                                                                                         | 215/45 R17                                                                                 | GOODYEAR        | 6 mm                                                         |  |
| L/H Front Tyre                                                                                                                         | 215/45 R17                                                                                 | GOODYEAR        | 6 mm                                                         |  |
| R/H Rear Tyre                                                                                                                          | 215/45 R17                                                                                 | GOODYEAR        | 6 mm                                                         |  |
| L/H Rear Tyre                                                                                                                          | 215/45 R17                                                                                 | GOODYEAR        | 6 mm                                                         |  |
| <b>4. Description of Damages</b>                                                                                                       |                                                                                            |                 |                                                              |  |
| THE VEHICLE SUSTAINED DAMAGES AT THE REAR & FRONT PORTION.<br>DAMAGES SEE DETAILS.                                                     |                                                                                            |                 |                                                              |  |
| <b>5. General Information</b>                                                                                                          |                                                                                            |                 |                                                              |  |
| Accident Date                                                                                                                          | 27/10/2020                                                                                 | Inspection Date | 29/10/2020                                                   |  |
| Survey held at                                                                                                                         | T K LEE AUTOMOTIVE PTE LTD<br>NO. 1 KAKI BUKIT AVE 6<br>#02-47 AUTOBAY<br>SINGAPORE 417883 |                 |                                                              |  |
| <b>5a. Remarks</b>                                                                                                                     |                                                                                            |                 |                                                              |  |
| A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.<br>B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS. |                                                                                            |                 |                                                              |  |
| <b>5b. Estimate Days of Repair</b>                                                                                                     |                                                                                            |                 |                                                              |  |
| ESTIMATED NORMAL PERIOD FOR REPAIR:                                                                                                    |                                                                                            |                 | <b>11 Working Days</b>                                       |  |



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. JKS 8925

| Qty | Description of Parts                            | Condition            | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|-------------------------------------------------|----------------------|---------------------------|-------------------|
|     | <b><u>REPLACEMENT OF PARTS</u></b>              |                      |                           |                   |
| 1   | REAR WINDSCREEN GLASS (N)                       | SHORTED              | 1,091.00                  | 1,091.00          |
| 1   | REAR TAILGATE (N)                               | BADLY DENTED         | 2,124.80                  | 2,124.80          |
| 2   | REAR TAILGATE HINGE RH/LH @\$108.90 (N)         | NOT NECESSARY        | 217.80                    | -                 |
| 2   | REAR TAILGATE DAMPER RH/LH @\$279.30 (N)        | NOT NECESSARY        | 558.60                    | -                 |
| 1   | REAR TAILGATE RUBBER (N)                        | TWISTED              | 239.90                    | 239.90            |
| 1   | REAR TAILGATE LOCK (N)                          | JAMMED               | 276.30                    | 276.30            |
| 1   | REAR TAILGATE LOCK CATCH (N)                    | NOT NECESSARY        | 46.10                     | -                 |
| 1   | REAR TAILGATE WIPER BLADE (N)                   | MISSING              | 36.20                     | 36.20             |
| 1   | REAR TAILGATE WIPER ARM (N)                     | CUT                  | 85.20                     | 85.20             |
| 1   | REAR TAILGATE WIPER MOTOR (N)                   | BENT / TWISTED       | 471.30                    | 471.30            |
| 1   | REAR TAILGATE WIPER MOTOR GARNISH (N)           | NOT NECESSARY        | 128.60                    | -                 |
| 1   | REAR TAILGATE OUTER HANDLE (N)                  | NOT NECESSARY        | 115.60                    | -                 |
| 1   | REAR TAILGATE EMBLEM LOGO (N)                   | NECESSARY            | 65.00                     | 65.00             |
| 1   | REAR TAILGATE EMBLEM 'GRAND LIVINA' (N)         | NECESSARY            | 85.20                     | 85.20             |
| 1   | REAR TAILGATE EMBLEM '1.8' (N)                  | NECESSARY            | 75.10                     | 75.10             |
| 1   | REAR TAILGATE TOP SPOILER (N)                   | CRACKED              | 588.00                    | 588.00            |
| 2   | REAR TAILLAMP LH/RH @\$415.60 (N)               | BROKEN               | 831.20                    | 831.20            |
| 2   | REAR TAILLAMP PANEL HOUSING RH/LH @\$291.50 (N) | TO REPAIR SEE LABOUR | 583.00                    | -                 |
| 1   | REAR BUMPER (N)                                 | DISTORTED            | 755.50                    | 755.50            |
| 2   | REAR BUMPER NUMBER PLATE LAMP @\$48.60 (N)      | CRACKED              | 97.20                     | 97.20             |
| 1   | REAR BUMPER NUMBER PLATE BRACKET (N)            | BENT                 | 108.50                    | 108.50            |
| 2   | REAR BUMPER SIDE RETAINER RH/LH @\$54.10 (N)    | N/S BENT             | 108.20                    | 54.10             |
| 1   | REAR END PANEL (N)                              | BADLY DENTED         | 518.60                    | 518.60            |
| 1   | REAR END PANEL GARNISH (N)                      | TWISTED              | 173.10                    | 173.10            |
| 2   | REAR FENDER INNER TRIM RH/LH @\$369.80 (N)      | SERVICEABLE          | 739.60                    | -                 |
| 1   | FRONT BONNET (N)                                | DENTED / BUCKLED     | 1,054.30                  | 1,054.30          |
| 2   | FRONT BONNET HINGE RH/LH @\$56.40 (N)           | NOT NECESSARY        | 112.80                    | -                 |
| 2   | FRONT BONNET RUBBER RH/LH @\$54.10 (N)          | NOT NECESSARY        | 108.20                    | -                 |
| 1   | FRONT BONNET INSULATOR (N)                      | NOT NECESSARY        | 138.20                    | -                 |

Report Ref No. CC6/CTI20011779/Upa3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

| Qty | Description of Parts                          | Condition       | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|-----------------------------------------------|-----------------|---------------------------|-------------------|
| 1   | FRONT BONNET LOCK (N)                         | TWISTED         | 68.30                     | 68.30             |
| 2   | FRONT HEADLAMP RH/LH @\$691.80 (N)            | CRACKED         | 1,383.60                  | 1,383.60          |
| 1   | FRONT GRILLE (N)                              | CRACKED         | 665.60                    | 665.60            |
| 1   | FRONT GRILLE EMBLEM LOGO (N)                  | NECESSARY       | 66.10                     | 66.10             |
| 1   | FRONT BUMPER (N)                              | DEFORMED / TORN | 758.00                    | 758.00            |
| 1   | FRONT BUMPER TOW COVER (N)                    | NOT NECESSARY   | 29.80                     | -                 |
| 1   | FRONT BUMPER FOG LAMP RH (N)                  | NOT NECESSARY   | 320.70                    | -                 |
| 1   | FRONT BUMPER REINFORCEMENT (N)                | DENTED          | 705.80                    | 705.80            |
| 2   | FRONT BUMPER SIDE RETAINER RH/LH @\$45.20 (N) | O/S BENT        | 90.40                     | 45.20             |
| 1   | FRONT SUPPORT PANEL (N)                       | BENT / BUCKLED  | 753.60                    | 753.60            |
| 1   | FRONT BRACE PANEL (N)                         | BENT            | 101.30                    | 101.30            |
| 1   | AIR CON CONDENSER (N)                         | PUNCTURE        | 625.60                    | 625.60            |
| 1   | AIR CON DISCHARGE PIPE (N)                    | NOT NECESSARY   | 192.80                    | -                 |
| 1   | AIR CON SUCTION PIPE (N)                      | NOT NECESSARY   | 208.60                    | -                 |
| 1   | RADIATOR (N)                                  | HOLDER CRACKED  | 724.20                    | 724.20            |
| 1   | RADIATOR SPARE TANK (N)                       | NOT NECESSARY   | 143.20                    | -                 |
| 1   | RADIATOR FAN COWLING (N)                      | NOT NECESSARY   | 208.20                    | -                 |
| 1   | RADIATOR FAN BLADE (N)                        | NOT NECESSARY   | 128.60                    | -                 |
| 1   | RADIATOR FAN MOTOR (N)                        | NOT NECESSARY   | 495.00                    | -                 |
| 1   | AIR CLEANER BOX INTAKE AIR DUCT (N)           | CRACKED         | 119.00                    | 119.00            |
|     | LESS 10% DISCOUNT                             |                 | -1,932.15                 | -1,474.68         |
|     |                                               |                 | 17,389.35                 | 13,272.12         |
|     | <b><u>SPECIAL NETT ITEMS</u></b>              |                 |                           |                   |
| 1   | REAR WINDSCREEN SPONGE TAPE (SN)              | NECESSARY       | 20.00                     | 20.00             |
| 1   | SET REAR WINDSCREEN SEALANT (SN)              | NECESSARY       | 80.00                     | 40.00             |
| 1   | REAR WINDSCREEN SOLAR FILM (SN)               | NECESSARY       | 220.00                    | 120.00            |
| 1   | REAR NUMBER PLATE (SN)                        | BENT            | 35.00                     | 14.00             |
| 1   | SET REAR BUMPER REVERSE SENSOR (SN)           | SHORTED         | 280.00                    | 200.00            |
| 1   | SET REAR BUMPER CLIPS (SN)                    | NECESSARY       | 35.00                     | 35.00             |
| 1   | SET FRONT BONNET INSULATOR CLIP (SN)          | NOT NECESSARY   | 45.00                     | -                 |
| 1   | FRONT NUMBER PLATE (SN)                       | SCRATCHED       | 25.00                     | 14.00             |
| 1   | SET FRONT BUMPER CLIP (SN)                    | NECESSARY       | 45.00                     | 45.00             |
| 1   | AIR CON COIL (SN)                             | NOT NECESSARY   | 45.00                     | -                 |

Report Ref No. CC6/CTI20011779/Upa3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

| Qty                                                                         | Description of Parts                                                                                                                                                     | Condition     | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|---------------------------|-------------------|
| 1                                                                           | AIR CON AUTO FAN (SN)                                                                                                                                                    | SERVICEABLE   | 400.00                    | -                 |
| 1                                                                           | (LIT) RADIATOR COOLANT (SN)                                                                                                                                              | NOT NECESSARY | 25.00                     | -                 |
|                                                                             |                                                                                                                                                                          |               | 1,255.00                  | 488.00            |
|                                                                             | <b>LABOUR</b>                                                                                                                                                            |               |                           |                   |
|                                                                             | TO KNOCK OUT DENT ,CUT/WELD REAR PANEL ,FRONT SUPPORT PANEL ,REPAIR REAR FENDER AND REPLACE ACCIDENT PARTS.INCLUSIVE OF THE REPAIR OF REAR TAILLAMP PANEL HOUSING RH/LH. |               | 1,500.00                  | 1,200.00          |
|                                                                             | TO SPRAY PAINTING ON ACCIDENT PARTS.                                                                                                                                     |               | 1,600.00                  | 1,500.00          |
|                                                                             | TO CHECK FRONT AND REAR WIRING .                                                                                                                                         |               | 60.00                     | 30.00             |
|                                                                             | TO REMOVE ,REPLACE CONDENSER AND REFILL GAS.                                                                                                                             |               | 100.00                    | 100.00            |
|                                                                             | TO REMOVE ,REPLACE REAR WINDSCREEN .                                                                                                                                     |               | 120.00                    | 120.00            |
|                                                                             | TO TRANSFER REAR TAILGATE PARTS.                                                                                                                                         |               | 100.00                    | 60.00             |
|                                                                             | TO REMOVE ,REFIX CUSHION AND INNER TRIM .                                                                                                                                |               | 120.00                    | 80.00             |
|                                                                             | TO REMOVE ,REPLACE REVERSE SENSOR .                                                                                                                                      |               | 80.00                     | 50.00             |
|                                                                             | TO TUFF-KOTE.                                                                                                                                                            |               | 150.00                    | 100.00            |
|                                                                             |                                                                                                                                                                          |               | 3,830.00                  | 3,240.00          |
| <b>GRAND TOTAL</b>                                                          |                                                                                                                                                                          |               | <b>22,474.35</b>          | <b>17,000.12</b>  |
| <b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b> |                                                                                                                                                                          |               |                           | <b>8,600.00</b>   |

Report Ref No. CC6/CTI20011779/Upa3q2

CHUA KANG SENG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### PHOTOGRAPHS FOR VEHICLE NO. JKS 8925

### INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## **LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. JKS 8925

RE-INSPECTION

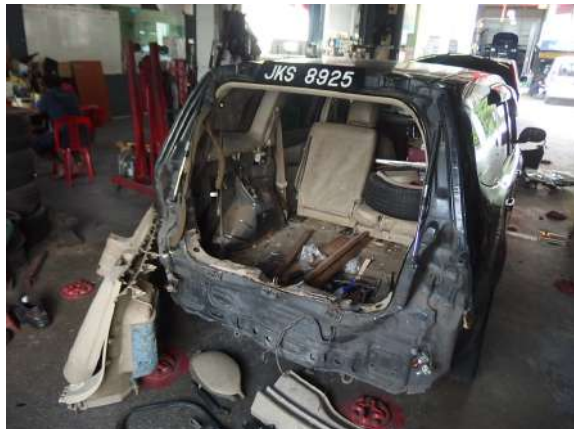



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

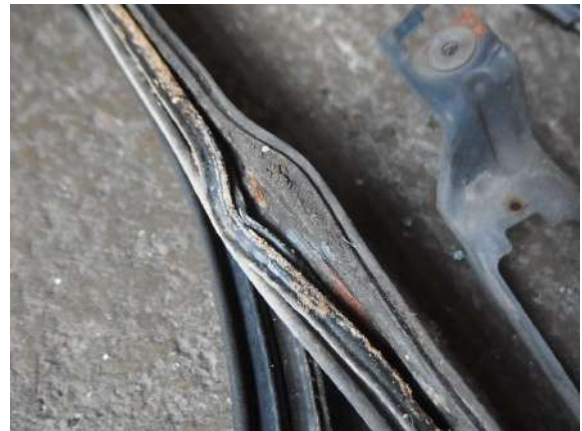



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

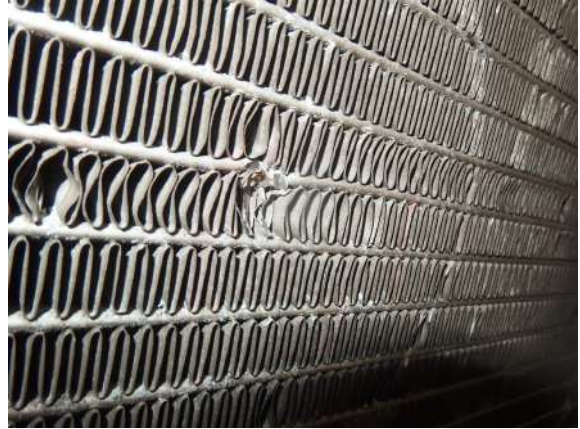



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

**PHOTOGRAPHS FOR VEHICLE NO. JKS 8925**

**RE-INSPECTION**

