

Vehicle Registration No: VAY 2308

Our Ref No: TWG/05/1916/TP

Qty	Description	Conditions	Repairer's Estimate	Revised Amount
-----	-------------	------------	---------------------	----------------

### SPARE PARTS - LIST ITEMS

1	Rear boot lid	Repair	\$ 1,658.00	
1	Rear boot logo	Necessary	\$ 79.00	\$ 79.00
1	Rear n/s taillamp	Damage	\$ 655.00	\$ 655.00
1	Rear end panel	Damage	\$ 1,018.50	\$ 1,018.50
1	Rear bumper	Damage	\$ 1,495.00	\$ 1,495.00
1	Rear bumper inner frame garnish	Damage	\$ 335.00	\$ 335.00
1	Rear bumper lower diffuser	Damage	\$ 485.00	\$ 485.00
1	Rear bumper lower tray	Damage	\$ 168.00	\$ 168.00
2	Rear bumper reflectors	N/S Damage	\$ 230.00	\$ 115.00
1	Rear bumper reinforcement	Damage	\$ 685.00	\$ 685.00
2	Rear bumper side retainers	Necessary	\$ 279.90	\$ 279.90
3	Rear bumper PDC sensors	Damage	\$ 940.50	\$ 940.50
1	Rear exhaust silencer	Damage	\$ 1,980.00	\$ 1,980.00
2	Rear exhaust mountings	Necessary	\$ 90.00	\$ 90.00
2	Rear exhaust chrome tail pipes	Damage	\$ 270.00	\$ 270.00
			<b>\$ 10,368.90</b>	<b>\$ 8,595.90</b>
			<i>Less 5%</i>	<i>\$ 429.80</i>
<b>Total Cost - List Items</b>			<b>\$ 9,850.46</b>	<b>\$ 8,166.11</b>

### SPECIAL NETT ITEMS

1	Rear bumper clip (1 set)	Necessary	\$ 45.00	\$ 45.00
<b>Total Cost - Special Nett items</b>			<b>\$ 45.00</b>	<b>\$ 45.00</b>

**Total cost of parts**

**\$ 9,895.46 \$ 8,211.11**

Vehicle Registration No: VAY 2308

Our Ref No: TWG/05/1916/TP

S/No	Description	Repairer's Estimate	Revised Amount
	<b>Total cost of parts c/f</b>	<b>\$ 9,895.46</b>	<b>\$ 8,211.11</b>

### LABOUR

1	To remove, refit, replaced damaged lamps and check up rear electrical wiring	\$ 80.00	\$ 50.00
2	To remove and refit inner garnishes, inner trim to assist repair.	\$ 150.00	\$ 120.00
3	To remove and refit rear reverse sensor.	\$ 150.00	\$ 120.00
4	To remove, refit and replace exhaust silencer and mountings.	\$ 150.00	\$ 120.00
5	To apply undercoating on repaired and replaced panel.	\$ 100.00	\$ 60.00
6	To provide labour charges, workmanship to dismantle above damaged parts, repair including cut and weld ; re-align body structure and damaged consistent to the accident.	\$ 1,080.00	\$ 750.00
7	To respray painting include polishing and waxing on the changed body parts, repaired portions where consistent to the accident.	\$ 1,000.00	\$ 880.00

**GRAND TOTAL**
**\$ 12,605.46    \$ 10,311.11**

Vehicle Registration No: VAY 2308

Our Ref No: TWG/05/1916/TP

The repairer has agreed to undertake the repair under a Lump Sum Basis. We have further adjusted the amount to a **Lump Sum Repair Contract of : \$ 8,200.00**

By accepting to carry out the repairs on a contract lump sum basis, the repairer has the discretion to replace the damaged parts with used, reconditioned or new parts, or to repair it to a roadworthy condition.

Note: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage / item in this survey, kindly notified the company within seven (7) from the date hereof. Otherwise, the revised amount shall be deem to be vaild.

**Disclaimer**


*The rates and assessment of damages as stated in this report is to be used solely for legal proceedings in relation to the surveyed vehicle and the accident in which the surveyed vehicle was involved in. The rates and assessment of damages must not be used in any circumstances for comparison with other vehicle and/or other accident in other legal proceedings.*

**CL APPRAISER PTE LTD**





Cheong K. H  
Automotive Appraiser




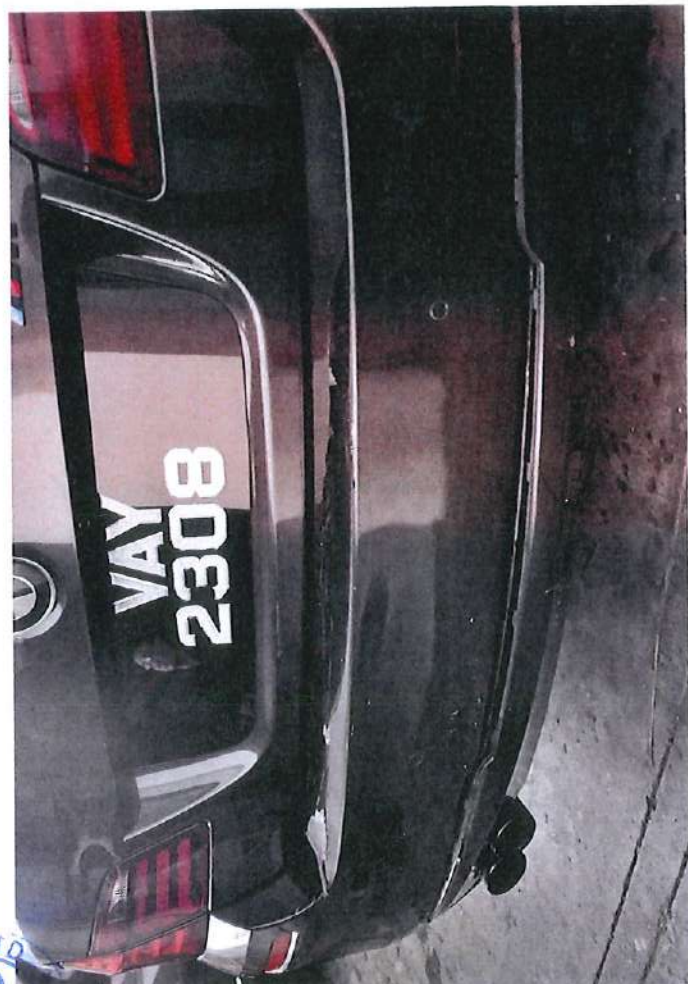






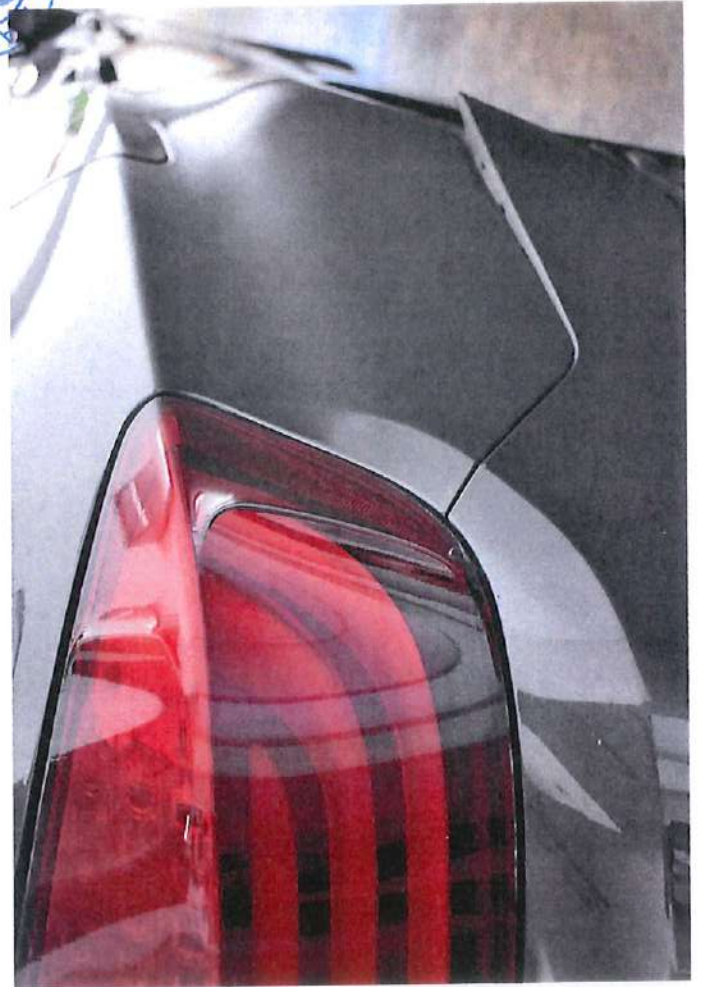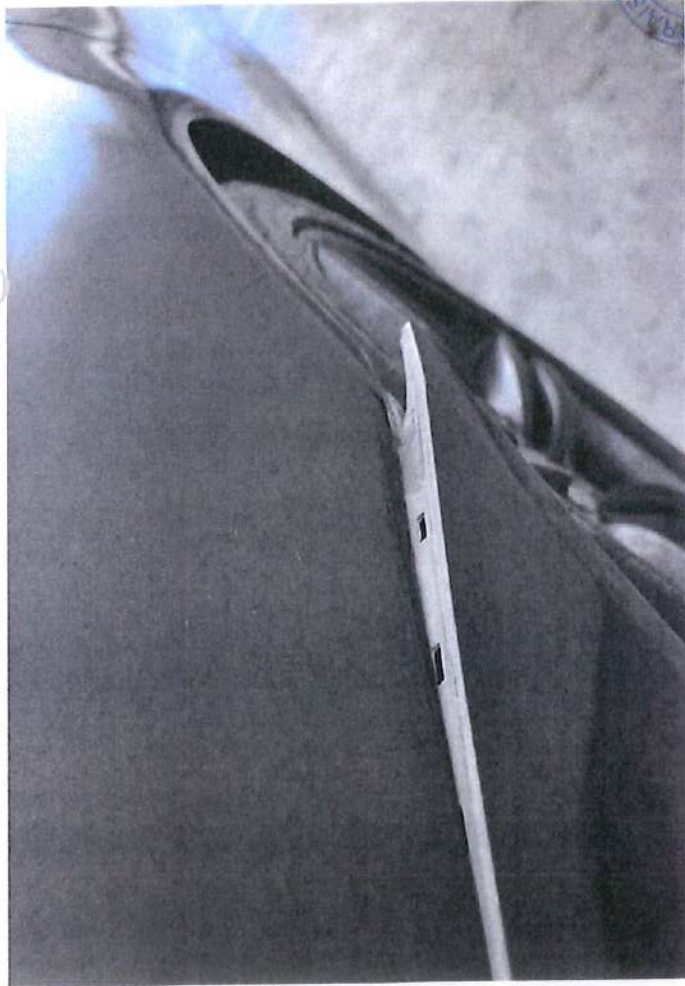





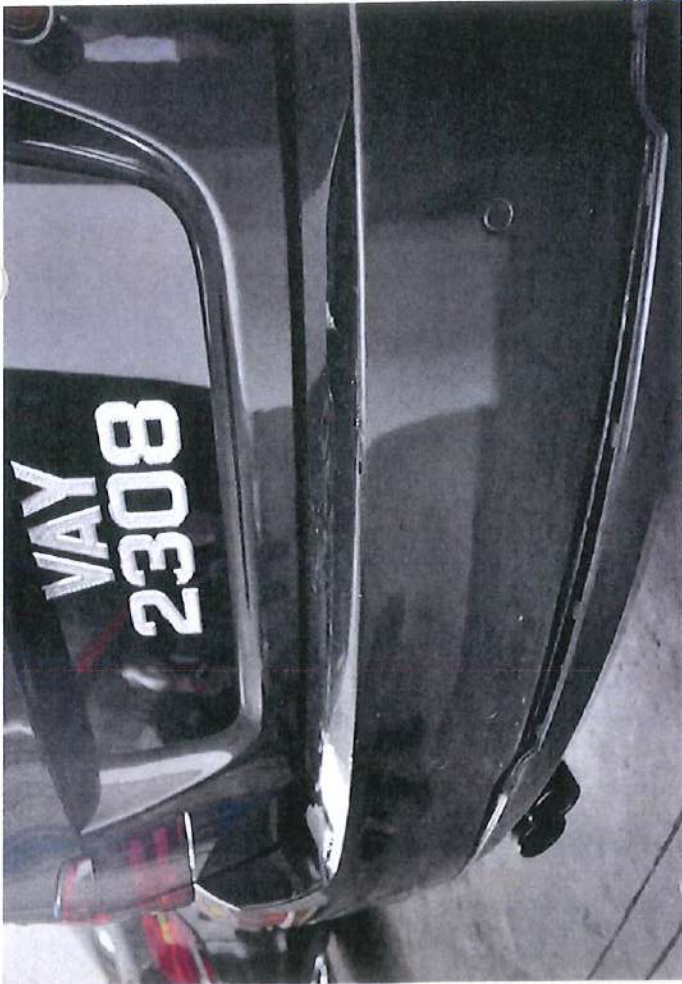



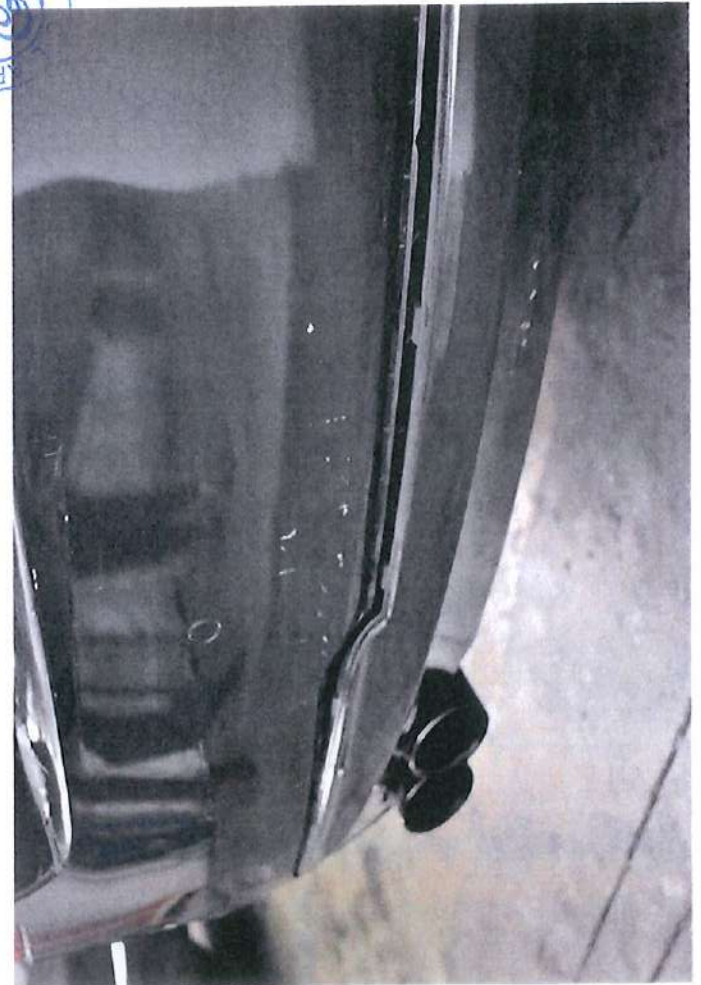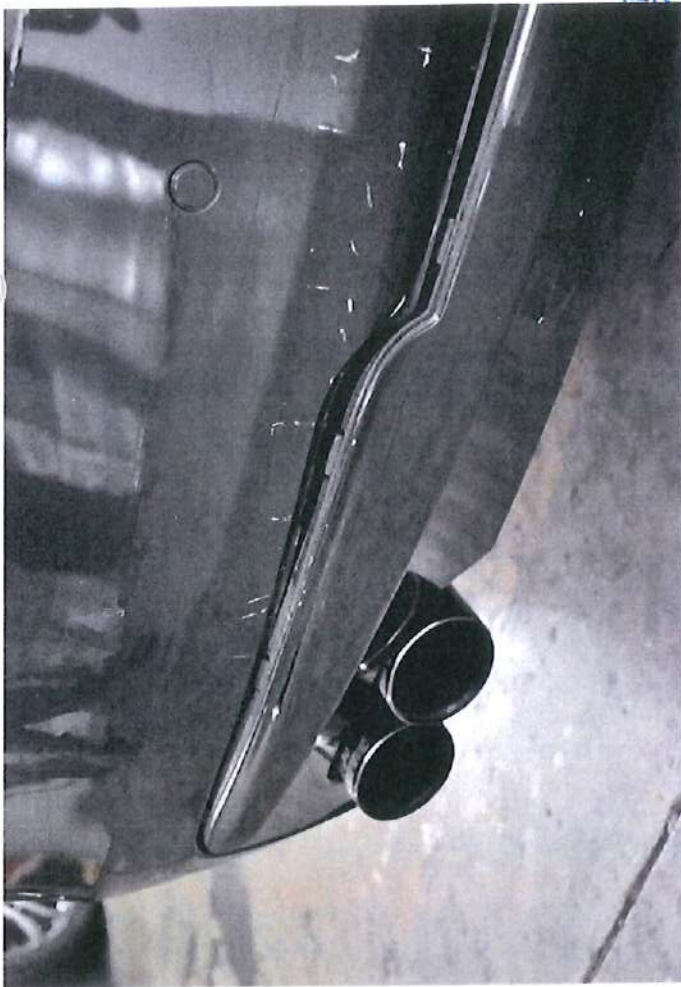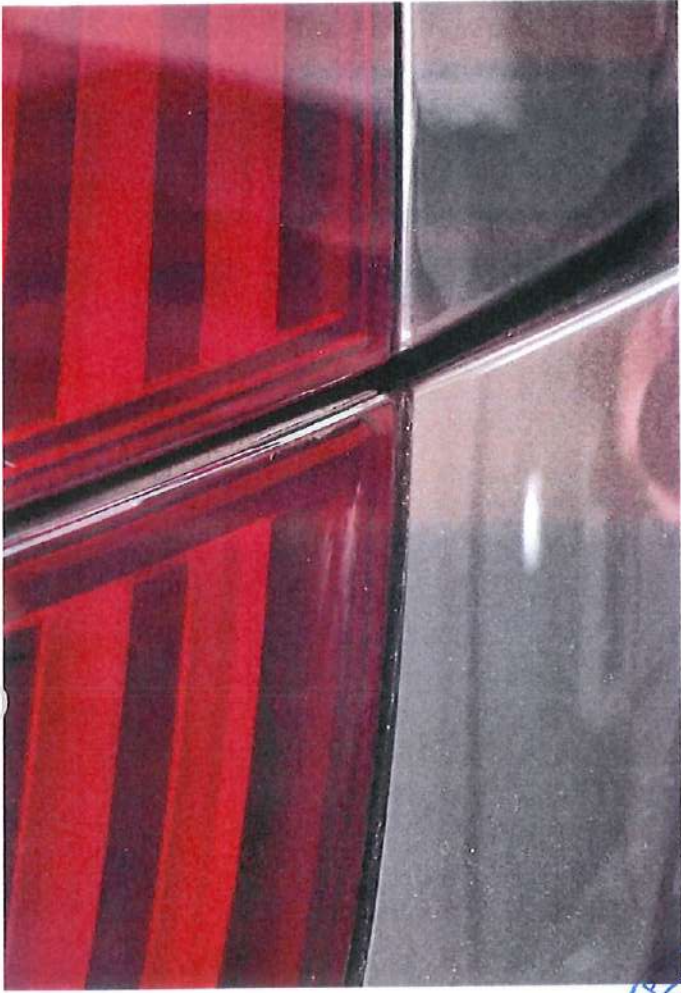




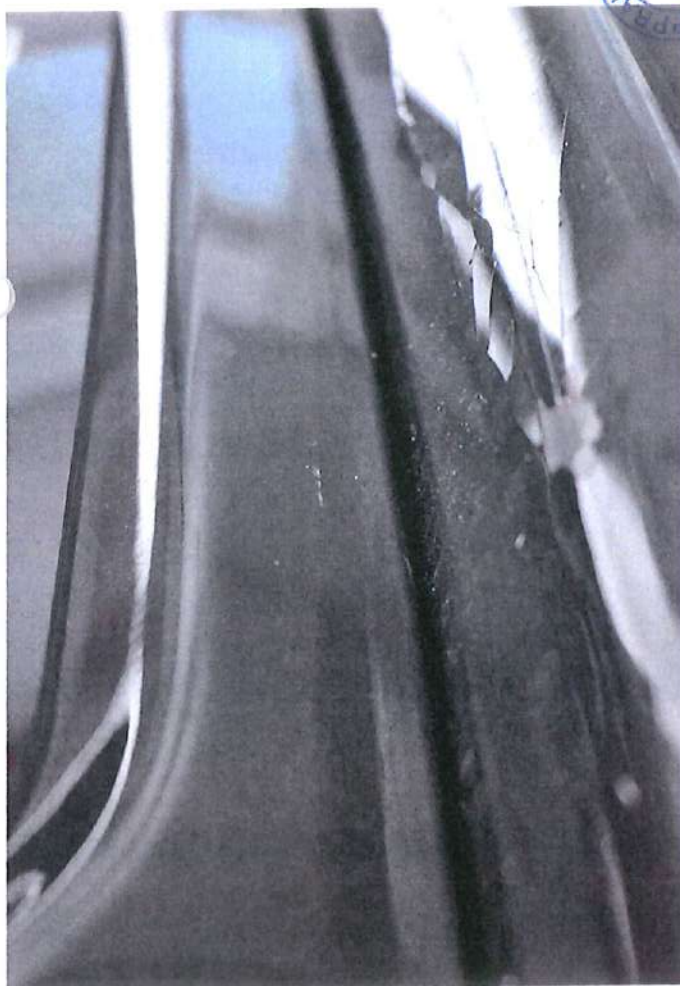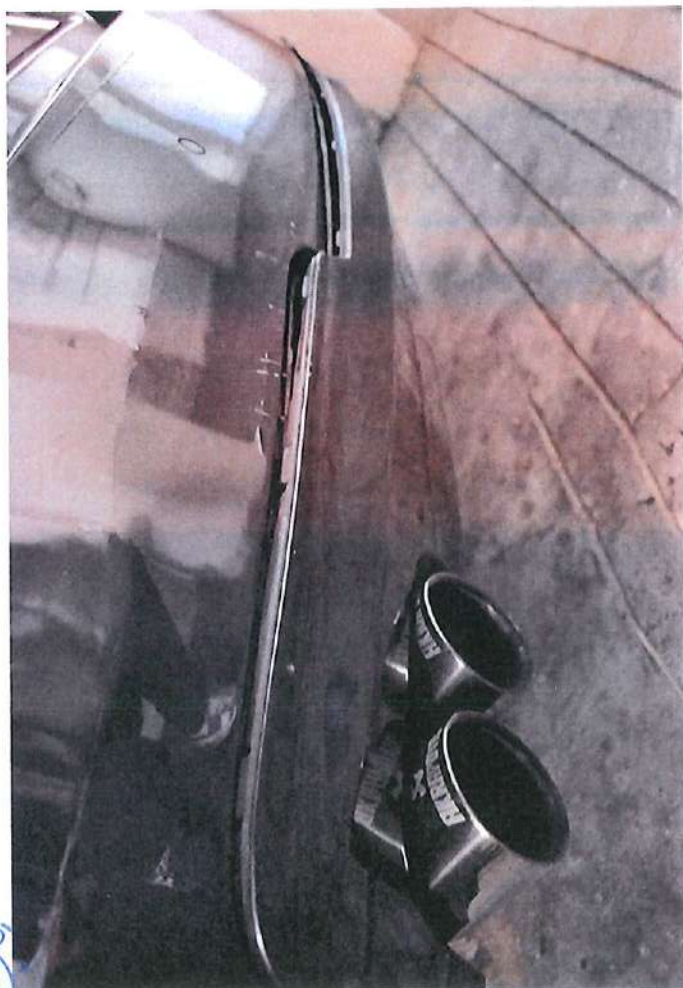








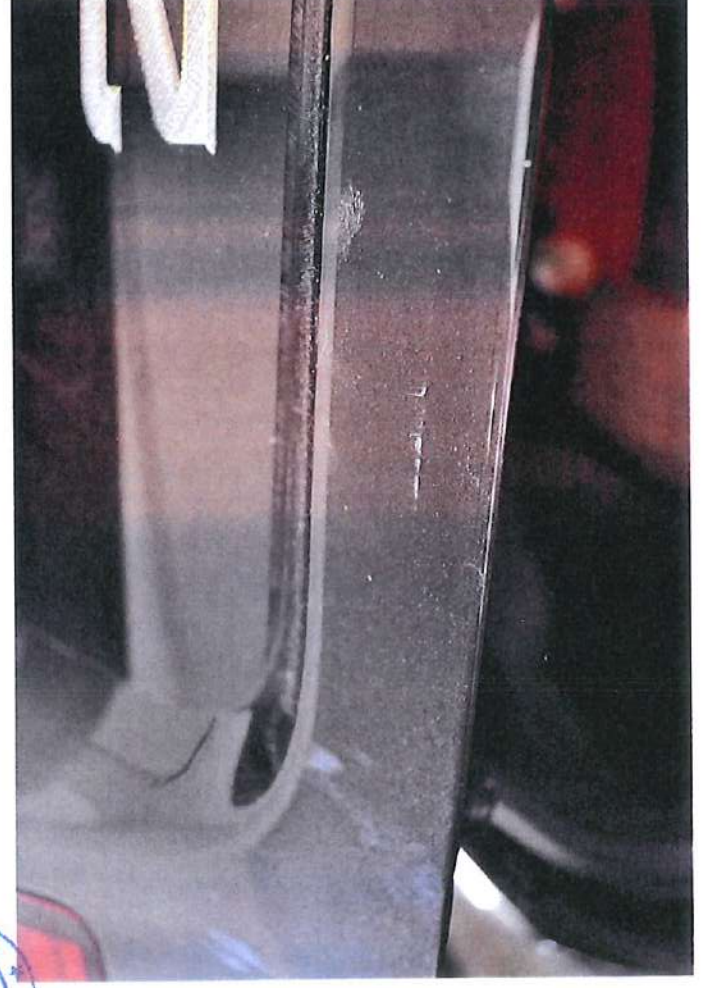







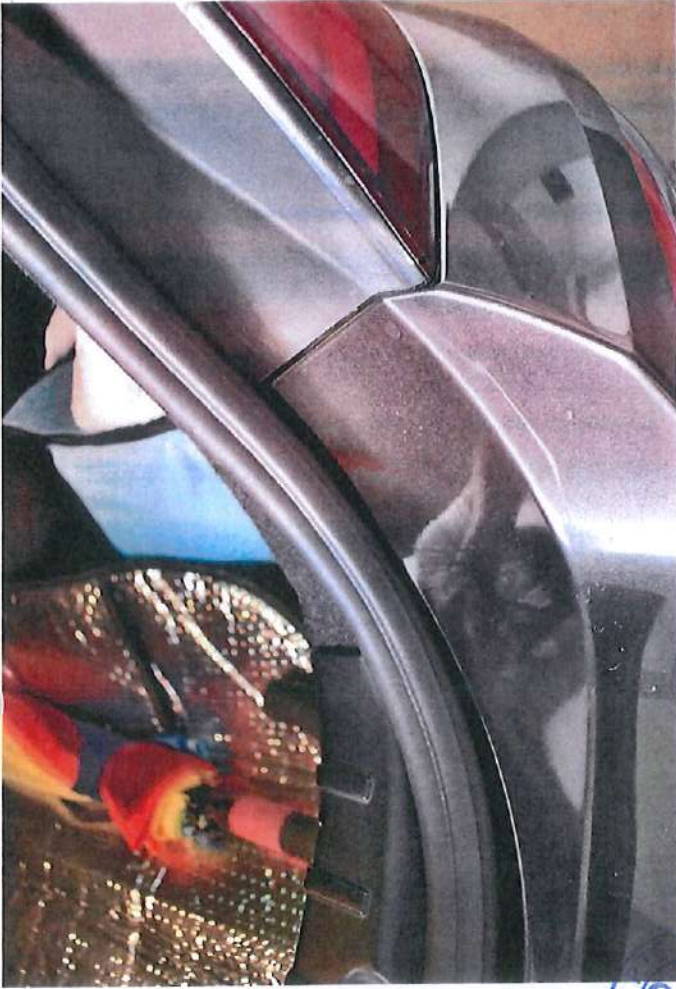





AP  
USER PTE LTD







