



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2200882

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 16/02/2022
Reference CC4/FCI20012085/Kga3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SJR 5609Z
Insured Veh. SHC 899M
Claim No. D20004435MFSH
Policy No. D-20094921MFSH
Accident Date 31/10/2020
Inspection Date 03/05/2021

Description	Total
Third Party Express Settlement	350.00
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20012085/Kga3q2	
			Date: 16/02/2022	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHC 899M	Veh. Inspected	SJR 5609Z	
Policy No.	D-20094921MFSH	Coverage (\$)	0.00	
Claim No.	D20004435MFSH	Excess (\$)	0.00	
Assign From	ERIC WOO	Assign Date	04/11/2020	
2. Vehicle Particulars & Condition				
Make & Model	MERCEDES BENZ C180K (A)	c.c	1597	
Engine No.	HIDDEN	Year of Reg.	2009	
Chassis No.	WDD2040452A271870	Colour	WHITE	
Odometer	202991 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	225/50 R17	BRIDGESTONE	6 mm	
L/H Front Tyre	225/50 R17	BRIDGESTONE	6 mm	
R/H Rear Tyre	225/50 R17	BRIDGESTONE	6 mm	
L/H Rear Tyre	225/50 R17	BRIDGESTONE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	31/10/2020	Inspection Date	03/05/2021	
Survey held at	CHENG HOE MOTOR PL BLK 1019 YISHUN IND. PARK A #01-374/382 SINGAPORE 768761			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJR 5609Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT RH DOOR (N)	BENT	2,045.00	2,045.00
1	FRONT RH DOOR MOULDING (N)	DENTED	210.00	210.00
1	FRONT RH FENDER (N)	TO REPAIR SEE LABOUR	725.00	-
1	FRONT RH FENDER MOULDING (N)	NECESSARY	75.00	75.00
	LESS 10% DISCOUNT		-305.50	-233.00
			2,749.50	2,097.00
1	FRONT RH DOOR INNER RUBBER (50%) (SN)	NECESSARY	328.00	164.00
	LESS 10% DISCOUNT		-32.80	-
			295.20	164.00
	<u>LABOUR</u>			
	REMOVE & REFIX FRT RH FENDER ,FRT RH DOOR ,SIDE MIRROR ,KNOCK & REPAIR FRT RH FENDER ,TRANSFER DOOR ATTACHMENT & REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF FRONT RH FENDER.		500.00	400.00
	REMOVE & REFIX FRT RH DOOR GLASS ,CHECK CENTRAL LOCKING & POWER MIRROR .		60.00	60.00
	PUTTY & RESPRAY ON FRT RH FENDER ,SIDE MIRROR COVER ,FRT RH DOOR .		600.00	500.00
	RUSTPROOFING.		30.00	30.00
			1,190.00	990.00
GRAND TOTAL			4,234.70	3,251.00
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,600.00

Report Ref No. CC4/FCI20012085/Kga3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJR 5609Z

INSPECTION

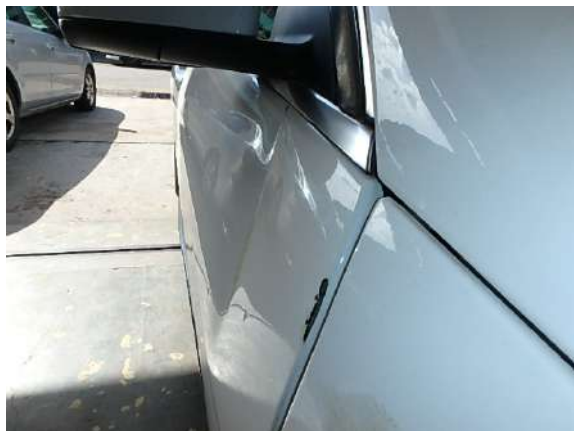



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R



