



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2103337

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 12/05/2021
Reference CC6/CTI20012266/Aea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMQ 9205Z
Insured Veh. GBB 7345A
Claim No. SNM20D204250/C02
Policy No. DMCVSN3089111900
Accident Date 05/11/2020
Inspection Date 06/11/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI20012266/Aea3q2 Date: 12/05/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBB 7345A	Veh. Inspected	SMQ 9205Z	
Policy No.	DMCVSN3089111900	Coverage (\$)	0.00	
Claim No.	SNM20D204250/C02	Excess (\$)	0.00	
Assign From		Assign Date	06/11/2020	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA VIOS	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	MR2B23F3601182182	Colour	SILVER	
Odometer	11742 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	185/60 R15	DUNLOP	6 mm	
L/H Front Tyre	185/60 R15	DUNLOP	6 mm	
R/H Rear Tyre	185/60 R15	DUNLOP	6 mm	
L/H Rear Tyre	185/60 R15	DUNLOP	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	05/11/2020	Inspection Date	06/11/2020	
Survey held at	KANG CAR REPAIRERS PTE LTD NO.1 KAKI BUKIT AVE 6 #02-06 AUTOBAY @ KAKI BUKIT SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMQ 9205Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	DEFORMED	482.20	482.20
1	REAR BUMPER REINFORCEMENT	BENT	316.10	316.10
1	REAR BUMPER SIDE RETAINER RH	NECESSARY	143.50	143.50
1	REAR BUMPER RETAINER (SMALL) RH	CRACKED	72.70	72.70
1	REAR BUMPER REFLECTOR RH	CRACKED	92.80	92.80
1	REAR BUMPER MUDFLAP RH	NOT NECESSARY	76.90	-
1	BOOT LID	TO REPAIR SEE LABOUR	855.50	-
1	BOOT LID LOGO	NECESSARY	52.20	52.20
1	BOOT LID 'VIOS' EMBLEM	NECESSARY	43.60	43.60
1	BOOT LID 'E' EMBLEM	NECESSARY	38.60	38.60
1	BOOT LID LOCK	NOT NECESSARY	320.40	-
1	BOOT LID LOCK CHECKER	NOT NECESSARY	38.90	-
1	BOOT LID RUBBER	CUT	166.40	166.40
1	BOOT LID LAMP RH	NOT NECESSARY	179.80	-
1	BOOT LID TRIM	NOT NECESSARY	278.90	-
1	TAIL LAMP -RH	CRACKED	397.10	397.10
1	REAR FENDER TRIM RH	NOT NECESSARY	355.90	-
1	REAR PANEL	DENTED	728.70	728.70
1	REAR PANEL TRIM	DEFORMED	242.30	242.30
1	REAR BOOT LID SENSOR	CRACKED	165.70	165.70
	LESS 25% DISCOUNT		-1,262.05	-735.48
			3,786.15	2,206.42
	<u>SPECIAL NETT ITEMS</u>			
2	'L' PLATE BRACKET (SN)	NECESSARY	70.00	70.00
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	50.00	30.00
1	SET REAR BUMPER MUDFLAP CLIPS RH (SN)	NOT NECESSARY	30.00	-
1	'L' PLATE (SN)	BENT	80.00	60.00
1	BOOT LID NUMBER '680' STICKER (SN)	NECESSARY	35.00	35.00
1	SET BOOTLID TRIM CLIPS (SN)	NOT NECESSARY	60.00	-
1	SET REAR FENDER TRM CLIPS RH (SN)	NOT NECESSARY	60.00	-

Report Ref No. CC6/CTI20012266/Aea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET REAR PANEL TRIM CLIPS (SN)	NECESSARY	40.00	20.00
			425.00	215.00
	LABOUR			
	TO CHECK WIRING .		50.00	30.00
	TO SPRAY UNDERSEAL .		100.00	60.00
	(REAR) TO SPRAY PAINTING .		1,000.00	700.00
	TO REMOVE AND REPLACE THE DAMAGED PARTS, KNOCK OUT ACCIDENT DENTED PORTIONS ,AND FOR CUTTING /WELDING WORKS.INCLUSIVE OF THE REPAIR OF BOOT LID .		1,000.00	700.00
	TO REMOVE AND REFIT INNER TRIM .		150.00	60.00
			2,300.00	1,550.00
GRAND TOTAL			6,511.15	3,971.42
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,150.00

Report Ref No. CC6/CTI20012266/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMQ 9205Z

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMQ 9205Z

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

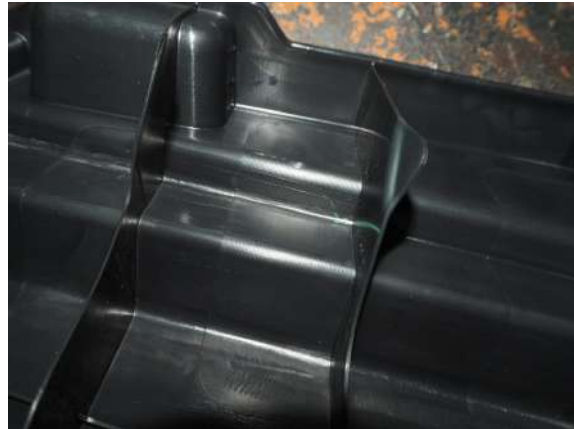



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

