



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2103872

3 ANSON ROAD #16-00  
SPRINGLEAF TOWER  
SINGAPORE 079909

INV Date 03/06/2021  
Reference CC6/CTI20012269/Qes3q2  
Code CTI

### PROFESSIONAL SERVICE FEE

Vehicle No. SGY 863L  
Insured Veh. SMR 8482R  
Claim No. SNM20D204276/C05  
Policy No. DMPCSNW00079812000  
Accident Date 06/11/2020  
Inspection Date 11/11/2020

| Description                    | Total         |
|--------------------------------|---------------|
| Third Party Express Settlement | 400.00        |
| <b>Subtotal</b>                | <b>400.00</b> |
| <b>GST (7%)</b>                | <b>28.00</b>  |
| <b>Grand Total</b>             | <b>428.00</b> |

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

| Affiliated to Federation Internationale Des Experts En Automobile                                                                         |                                                                                                 |                 |                             |  |
|-------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------|-----------------|-----------------------------|--|
| CHINA TAIPING INSURANCE (S) PTE LTD<br>3 ANSON ROAD #16-00<br>SPRINGLEAF TOWERS SINGAPORE 079909                                          |                                                                                                 |                 | Ref: CC6/CTI20012269/Qes3q2 |  |
|                                                                                                                                           |                                                                                                 |                 | Date: 03/06/2021            |  |
|                                                                                                                                           |                                                                                                 |                 | Code: CTI                   |  |
| <b>1. Policy Particulars :- THIRD PARTY CLAIM</b>                                                                                         |                                                                                                 |                 |                             |  |
| Insured Veh.                                                                                                                              | SMR 8482R                                                                                       | Veh. Inspected  | SGY 863L                    |  |
| Policy No.                                                                                                                                | DMPCSNW00079812000                                                                              | Coverage (\$)   | 0.00                        |  |
| Claim No.                                                                                                                                 | SNM20D204276/C05                                                                                | Excess (\$)     | 0.00                        |  |
| Assign From                                                                                                                               |                                                                                                 | Assign Date     | 11/11/2020                  |  |
| <b>2. Vehicle Particulars &amp; Condition</b>                                                                                             |                                                                                                 |                 |                             |  |
| Make & Model                                                                                                                              | HONDA SHUTTLE                                                                                   | c.c             | 1496                        |  |
| Engine No.                                                                                                                                | HIDDEN                                                                                          | Year of Reg.    | 2017                        |  |
| Chassis No.                                                                                                                               | GK81104238                                                                                      | Colour          | SILVER                      |  |
| Odometer                                                                                                                                  | 52324 KM                                                                                        | Steering        | IN ORDER                    |  |
| Brakes                                                                                                                                    | IN ORDER                                                                                        | Modification    | SPORTS RIM                  |  |
| General                                                                                                                                   | FAIR                                                                                            |                 |                             |  |
| <b>3. Conditions of Tyres</b>                                                                                                             |                                                                                                 |                 |                             |  |
|                                                                                                                                           | Size                                                                                            | Make            | Balance                     |  |
| R/H Front Tyre                                                                                                                            | 185/60 R15                                                                                      | YOKOHAMA        | 5 mm                        |  |
| L/H Front Tyre                                                                                                                            | 185/60 R15                                                                                      | YOKOHAMA        | 5 mm                        |  |
| R/H Rear Tyre                                                                                                                             | 185/60 R15                                                                                      | YOKOHAMA        | 5 mm                        |  |
| L/H Rear Tyre                                                                                                                             | 185/60 R15                                                                                      | YOKOHAMA        | 5 mm                        |  |
| <b>4. Description of Damages</b>                                                                                                          |                                                                                                 |                 |                             |  |
| THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION AND O/S & N/S BODY.<br>DAMAGES SEE DETAILS.                                            |                                                                                                 |                 |                             |  |
| <b>5. General Information</b>                                                                                                             |                                                                                                 |                 |                             |  |
| Accident Date                                                                                                                             | 06/11/2020                                                                                      | Inspection Date | 11/11/2020                  |  |
| Survey held at                                                                                                                            | AUTOMOTIVE REPAIR CENTRE PTE LTD<br>38 WOODLANDS INDUSTRIAL PARK E1 # 05-18<br>SINGAPORE 757700 |                 |                             |  |
| <b>5a. Remarks</b>                                                                                                                        |                                                                                                 |                 |                             |  |
| A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.<br>B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS. |                                                                                                 |                 |                             |  |
| <b>5b. Estimate Days of Repair</b>                                                                                                        |                                                                                                 |                 |                             |  |
| ESTIMATED NORMAL PERIOD FOR REPAIR:                                                                                                       |                                                                                                 |                 | <b>14 Working Days</b>      |  |



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SGY 863L

| Qty | Description of Parts               | Condition            | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|------------------------------------|----------------------|---------------------------|-------------------|
|     | <b><u>REPLACEMENT OF PARTS</u></b> |                      |                           |                   |
| 1   | FRONT BUMPER                       | CRUMPLED             | 1,080.00                  | 1,080.00          |
| 10  | FRONT BUMPER CLIPS @\$3.00         | NECESSARY            | 30.00                     | 30.00             |
| 1   | FRONT BUMPER TOW EYE COVER         | MISSING              | 30.00                     | 30.00             |
| 1   | FRONT BUMPER RETAINER RH           | BROKEN               | 20.00                     | 20.00             |
| 1   | FRONT BUMPER RETAINER LH           | BROKEN               | 20.00                     | 20.00             |
| 1   | FRONT BUMPER LOWER GRILLE          | MISSING              | 150.00                    | 150.00            |
| 1   | FRONT BUMPER LOWER COVER NO.9      | MISSING              | 220.00                    | 220.00            |
| 1   | FRONT REINFORCEMENT                | BENT                 | 300.00                    | 300.00            |
| 1   | FRONT LOWER GRILLE UPPER RH NO.8   | MISSING              | 40.00                     | 40.00             |
| 1   | FRONT LOWER GRILLE LOWER RH NO.4   | MISSING              | 50.00                     | 50.00             |
| 1   | FRONT HEAD LAMP RH                 | SCRATCHED            | 1,100.00                  | 1,100.00          |
| 1   | FRONT HEAD LAMP LH                 | SERVICEABLE          | 1,100.00                  | -                 |
| 1   | FRONT HEAD LAMP BRACKET RH         | BROKEN               | 40.00                     | 40.00             |
| 1   | FRONT HEAD LAMP BRACKET LH         | SERVICEABLE          | 40.00                     | -                 |
| 1   | FRONT FENDER RH                    | CRUMPLED             | 380.00                    | 380.00            |
| 1   | FRONT FENDER LH                    | TO REPAIR SEE LABOUR | 380.00                    | -                 |
| 1   | FRONT FENDER SHIELD RH             | CRUMPLED             | 120.00                    | 120.00            |
| 1   | FRONT FENDER SHIELD LH             | CUT                  | 120.00                    | 120.00            |
| 10  | FRONT FENDERCLIP @\$3.00           | NECESSARY            | 30.00                     | 30.00             |
| 1   | FRONT SUPPORT LOWER PANEL NO.8     | CRUMPLED             | 200.00                    | 200.00            |
| 1   | FRONT WHEEL HOUSE PANEL RH NO.9    | BENT                 | 250.00                    | 250.00            |
| 1   | FRONT WHEEL HOUSE PANEL RH NO.5    | BENT                 | 150.00                    | 150.00            |
| 1   | FRONT WHEEL HOUSE PANEL RH NO.18   | BENT                 | 80.00                     | 80.00             |
| 1   | FRONT WHEEL HOUSE PANEL RH NO.19   | BENT                 | 90.00                     | 90.00             |
| 1   | FRONT TEMP CLIP                    | SERVICEABLE          | 10.00                     | -                 |
| 1   | FRONT TEMP SENSOR                  | SERVICEABLE          | 60.00                     | -                 |
| 1   | FRONT WIPER TANK                   | CUT                  | 80.00                     | 80.00             |
| 1   | FRONT WIPER PUMP                   | SERVICEABLE          | 60.00                     | -                 |
| 1   | REAR TAIL LAMP LH                  | CRACKED              | 550.00                    | 550.00            |
| 1   | REAR TAILGATE LAMP LH              | SERVICEABLE          | 420.00                    | -                 |

Report Ref No. CC6/CTI20012269/Qes3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

| Qty | Description of Parts                               | Condition   | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|----------------------------------------------------|-------------|---------------------------|-------------------|
| 1   | FRONT TAILGATE                                     | CRUMPLED    | 1,200.00                  | 1,200.00          |
| 1   | FRONT TAILGATE SHUTTLE EMBLEM                      | NECESSARY   | 60.00                     | 60.00             |
| 1   | REAR TAILGATE HONDA EMBLEM                         | SERVICEABLE | 40.00                     | -                 |
| 1   | REAR WINDSCREEN MOULDING                           | NECESSARY   | 120.00                    | 120.00            |
| 1   | REAR TAILGATE UPPER SPOILER                        | CRACKED     | 1,080.00                  | 893.00            |
| 1   | FRONT DOOR LH                                      | CRUMPLED    | 1,300.00                  | 857.00            |
| 1   | FRONT DOOR GLASS LH                                | SERVICEABLE | 580.00                    | -                 |
| 1   | FRONT DOOR GLASS RUBBLER SEAL LH                   | CRUMPLED    | 60.00                     | 60.00             |
| 1   | FRONT DOOR OUT WEATHER MOULDING                    | CRUMPLED    | 80.00                     | 80.00             |
| 1   | FRONT DOOR INNER SEAL LH                           | SERVICEABLE | 150.00                    | -                 |
| 1   | FRONT DOOR FRONT MOULDING(BLACK STICKER) LH        | NECESSARY   | 70.00                     | 70.00             |
| 1   | FRONT DOOR SIDE MIRROR HOUSING WITH SIGNAL ASSY LH | CRUMPLED    | 550.00                    | 550.00            |
| 1   | FRONT DOOR SIDE MIRROR HOUSING WITH SIGNAL ASSY RH | JAMMED      | 550.00                    | 550.00            |
| 1   | FRONT DOOR SIDE MIRROR COVER LH                    | MISSING     | 60.00                     | 60.00             |
| 1   | FRONT DOOR SIDE MIRROR COVER RH                    | MISSING     | 60.00                     | 60.00             |
| 1   | FRONT TRIANGLE GLASS WITH MOULDING LH              | BROKEN      | 350.00                    | 350.00            |
| 1   | FRONT TRIANGLE GLASS WITH MOULDING RH              | BROKEN      | 350.00                    | 350.00            |
| 1   | REAR DOOR LH                                       | CRUMPLED    | 1,800.00                  | 899.00            |
| 1   | REAR DOOR GLASS LH                                 | BROKEN      | 480.00                    | 480.00            |
| 1   | REAR DOOR GLASS RUBBER SEAL LH                     | NECESSARY   | 60.00                     | 60.00             |
| 1   | REAR DOOR OUT WEATHER MOULDING SEAL LH             | SERVICEABLE | 80.00                     | -                 |
| 1   | REAR DOOR INNER SEAL LH                            | SERVICEABLE | 90.00                     | -                 |
| 1   | REAR DOOR FRONT MOULDING (BLACK STICKER )LH        | NECESSARY   | 40.00                     | 40.00             |
| 1   | REAR DOOR REAR BLACK GARNISH LH                    | SCRATCHED   | 50.00                     | 50.00             |
| 1   | REAR FENDER LH                                     | CRUMPLED    | 1,050.00                  | 1,050.00          |
| 1   | REAR FENDER INNER TRIM LH                          | SERVICEABLE | 500.00                    | -                 |
| 1   | REAR FENDER INNER TRIM BELT PACKET COVER LH        | MISSING     | 70.00                     | 70.00             |
| 1   | REAR FENDER GLASS LH                               | BROKEN      | 550.00                    | 550.00            |
| 1   | REAR FENDER GLASS MOULDING LH                      | NECESSARY   | 100.00                    | 100.00            |
| 1   | REAR UPPER TAILLAMP PANEL LH                       | CRUMPLED    | 220.00                    | 220.00            |
| 1   | UPPER A-PILLAR PANEL LH                            | CRUMPLED    | 1,250.00                  | 1,250.00          |

Report Ref No. CC6/CTI20012269/Qes3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

| Qty | Description of Parts                     | Condition            | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|------------------------------------------|----------------------|---------------------------|-------------------|
| 1   | UPPER ROOF PANEL                         | TO REPAIR SEE LABOUR | 1,950.00                  | -                 |
| 1   | FRONT AIR BAG RH                         | BROKEN               | 2,600.00                  | 1,000.00          |
| 1   | FRONT AIR BAG LH                         | BROKEN               | 2,250.00                  | 1,000.00          |
| 1   | FRONT SEAT BELT RH                       | JAMMED               | 600.00                    | 350.00            |
| 1   | FRONT SEAT BELT LH                       | JAMMED               | 600.00                    | 350.00            |
| 1   | REAR CABLE FOR AIR BAG AT STEERING WHEEL | NECESSARY            | 300.00                    | 300.00            |
| 1   | FRONT DESKBOARD                          | NECESSARY            | 1,100.00                  | 1,100.00          |
| 1   | SRS CONTROL UNIT                         | NECESSARY            | 1,000.00                  | 1,000.00          |
| 1   | SRS SENSOR @ FRONT BUMPER RH             | CRUMPLED             | 180.00                    | 180.00            |
| 1   | SRS SENSOR @ FRONT BUMPER LH             | CRUMPLED             | 180.00                    | 180.00            |
| 1   | FRONT CROSSMEMBER                        | DENTED               | 780.00                    | 780.00            |
| 1   | FRONT KNUCKLE RH                         | DENTED               | 350.00                    | 350.00            |
| 1   | FRONT KNUCKLE LH                         | DENTED               | 350.00                    | 350.00            |
| 1   | FRONT BEARING RH                         | JAMMED               | 180.00                    | 180.00            |
| 1   | FRONT BEARING LH                         | JAMMED               | 180.00                    | 180.00            |
| 1   | FRONT WHEEL HUB RH                       | BENT                 | 150.00                    | 150.00            |
| 1   | FRONT WHEEL HUB LH                       | BENT                 | 150.00                    | 150.00            |
| 1   | FRONT TIE ROD RH                         | SERVICEABLE          | 100.00                    | -                 |
| 1   | FRONT TIE ROD LH                         | SERVICEABLE          | 100.00                    | -                 |
| 1   | FRONT TIE ROD END RH                     | SERVICEABLE          | 80.00                     | -                 |
| 1   | FRONT TIE ROD END LH                     | SERVICEABLE          | 80.00                     | -                 |
| 1   | FRONT ABSORBER RH                        | BENT                 | 400.00                    | 400.00            |
| 1   | FRONT ABSORBER LH                        | BENT                 | 400.00                    | 400.00            |
| 1   | FRONT ABSORBER TOP MOUNT RH              | SERVICEABLE          | 50.00                     | -                 |
| 1   | FRONT ABSORBER TOP MOUNT LH              | SERVICEABLE          | 50.00                     | -                 |
| 1   | FRONT LOWER ARM RH                       | BENT                 | 300.00                    | 300.00            |
| 1   | FRONT LOWER ARM LH                       | BENT                 | 300.00                    | 300.00            |
| 1   | FRONT STABILIZER LINKAGE RH              | SERVICEABLE          | 60.00                     | -                 |
| 1   | FRONT STABILIZER LINKAGE LH              | SERVICEABLE          | 60.00                     | -                 |
| 2   | FRONT WHEEL RIM R15 @\$400.00            | BENT                 | 800.00                    | 400.00            |
| 2   | FRONT WHEEL RIM COVER @\$200.00          | SCRATCHED            | 400.00                    | 300.00            |
| 1   | FRONT DRIVESHAFT RH (ADDITIONAL)         | CRUSHED              | 1,400.00                  | 1,400.00          |

Report Ref No. CC6/CTI20012269/Qes3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

| Qty | Description of Parts                                                                                                     | Condition | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|--------------------------------------------------------------------------------------------------------------------------|-----------|---------------------------|-------------------|
|     | LESS 20% DISCOUNT                                                                                                        |           | -                         | -5,251.80         |
|     |                                                                                                                          |           | 37,680.00                 | 21,007.20         |
|     | <b><u>SPECIAL NETT ITEMS</u></b>                                                                                         |           |                           |                   |
| 1   | FRONT LICENSE PLATE WITH FRAME (SN)                                                                                      | CRUMPLED  | 40.00                     | 40.00             |
| 2   | FRONT TRIANGLE GLASS SEALANT RH & LH @\$20.00 (SN)                                                                       | NECESSARY | 40.00                     | 40.00             |
| 1   | REAR FENDER GLASS LH SEALANT (SN)                                                                                        | NECESSARY | 40.00                     | 40.00             |
| 1   | REAR WINDSCREEN SEALANT (SN)                                                                                             | NECESSARY | 40.00                     | 40.00             |
| 1   | REAR WINDSCREEN SOLAR FILM (SN)                                                                                          | NECESSARY | 200.00                    | 150.00            |
| 1   | REAR FENDER LH SOLAR FILM (SN)                                                                                           | NECESSARY | 150.00                    | 100.00            |
| 2   | DOOR LH SOLAR FILM @\$150.00 (SN)                                                                                        | NECESSARY | 300.00                    | 240.00            |
| 2   | FRONT TRIANGLE GLASS SOLAR FILM @\$100.00 (SN)                                                                           | NECESSARY | 200.00                    | 160.00            |
| 2   | FRONT TYRE R15 @\$200.00 (80%) (SN)                                                                                      | BROKEN    | 400.00                    | 320.00            |
| 1   | AUTO TRANSMISSION OIL (SN) (ADDITIONAL)                                                                                  | NECESSARY | 90.00                     | 90.00             |
|     |                                                                                                                          |           | 1,500.00                  | 1,220.00          |
|     | <b><u>LABOUR</u></b>                                                                                                     |           |                           |                   |
|     | SPRAY PAINTING WHOLE FRONT AND REAR .                                                                                    |           | 2,200.00                  | 2,200.00          |
|     | REPLACE REAR INCLUDING FITTING ,CUT ,WELD AND RE-ALIGN.INCLUSIVE OF THE REPAIR OF FRONT FENDER LH AND UPPER ROOF PANEL . |           | 2,200.00                  | 2,200.00          |
|     | REMOVE AND REFIT DASHBOARD AND REPLATED PARTS (AIRBAGS).                                                                 |           | 250.00                    | 200.00            |
|     | REMOVE & REFIT FRONT SUBFRAME WITH BOTH UNDERCARRIAGES.                                                                  |           | 350.00                    | 200.00            |
|     | TRANSFER DOOR FITTING AND WINDOW MECHANISM TO NEW DOOR.                                                                  |           | 160.00                    | 120.00            |
|     | REMOVE AND REFIT REAR WINDSCREEN .                                                                                       |           | 120.00                    | 120.00            |
|     | REMOVE AND REFIT FENDER SIDE GLASS TO FACILITATE REPAIR .                                                                |           | 180.00                    | 180.00            |
|     | APPLY RUST PROOFING ON REPLACED /REPAIRED PANEL.                                                                         |           | 100.00                    | 50.00             |
|     | COMPUTERIZED WHEEL ALIGNMENT.                                                                                            |           | 70.00                     | 70.00             |
|     | RESET ECU ,ABS AND SRS.                                                                                                  |           | 150.00                    | 150.00            |



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 5

| Qty                                                                     | Description of Parts                 | Condition | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-------------------------------------------------------------------------|--------------------------------------|-----------|---------------------------|-------------------|
|                                                                         | CHECK AND RECTIFY ELECTRICAL WIRING. |           | 30.00                     | 30.00             |
|                                                                         |                                      |           | 5,810.00                  | 5,520.00          |
| GRAND TOTAL                                                             |                                      |           | 44,990.00                 | 27,747.20         |
| RECOMMENDED COST OF LUMP SUM REPAIRS<br>(TO ITS PRE-ACCIDENT CONDITION) |                                      |           |                           | 22,200.00         |

Report Ref No. CC6/CTI20012269/Qes3q2

OI SUN PIN

Asst. Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGY 863L

INSPECTION








## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

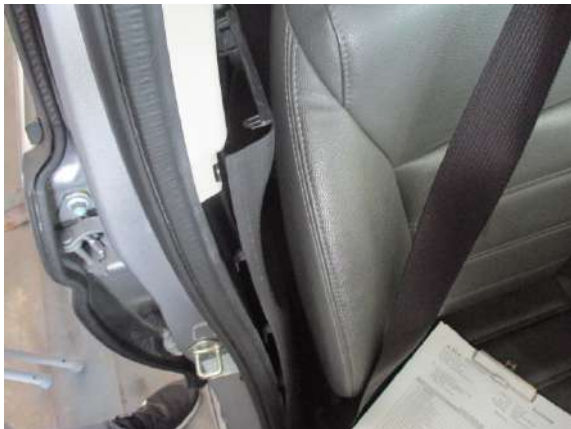



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGY 863L

RE-INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

