



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2104006

INV Date 09/06/2021

Reference CC4/LPC20012283/Qga3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. GBK 2932R
Insured Veh. YN 185E
Claim No. 20/20/20/VC00/023871
Policy No. Z/20/VC00/108652
Accident Date 04/11/2020
Inspection Date 12/11/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC20012283/Qga3q2	Date: 09/06/2021
			Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YN 185E	Veh. Inspected	GBK 2932R	
Policy No.	Z/20/VC00/108652	Coverage (\$)	0.00	
Claim No.	20/20/20/VC00/023871	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	09/11/2020	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA HILUX DOUBLE	c.c	2393	
Engine No.	HIDDEN	Year of Reg.	2020	
Chassis No.	MR0CB8DD100502942	Colour	SILVER	
Odometer	10956 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	265/65 R17	BRIDGESTONE	6 mm	
L/H Front Tyre	265/65 R17	BRIDGESTONE	6 mm	
R/H Rear Tyre	265/65 R17	BRIDGESTONE	6 mm	
L/H Rear Tyre	265/65 R17	BRIDGESTONE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	04/11/2020	Inspection Date	12/11/2020	
Survey held at	YEW TEE AUTOMOBILE TECH PL (HQ) BLK 6 WOODLANDS ROAD 399F YEW TEE IND. ESTATE SINGAPORE 678006			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			2 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBK 2932R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR SIDE BUMPER LH (CHROME)	DENTED	331.40	331.40
	LESS 25% DISCOUNT		-82.85	-82.85
			248.55	248.55
	<u>NETT ITEMS</u>			
1	REAR SIDE BUMPER STEP GARNISH LH (N)	CUT	148.20	148.20
1	REAR SIDE BUMPER BRACKET LH (N)	SERVICEABLE	154.20	-
1	REAR BUMPER STEP GARNISH CENTER (N)	SERVICEABLE	287.70	-
1	REAR BUMPER STEP GARNISH INNER PANEL (N)	SERVICEABLE	756.20	-
	LESS 10% DISCOUNT		-134.63	-14.82
			1,211.67	133.38
	<u>SPECIAL NETT ITEMS</u>			
1	REAR BUMPER REVERSE SENSOR (SN)	SERVICEABLE	220.00	-
			220.00	-
	<u>LABOUR</u>			
	TO REMOVE AND REFIT REAR BUMPER SENSOR .		80.00	30.00
	TO DISCONNECT AND RECONNECT ,CHECK ELECTRICAL WIRING HARNESS WIRE ,SOCKETS ,REPLACE DAMAGED PARTS.		30.00	30.00
	TO REMOVE AND REPLACE THE ABOVE DAMAGED PARTS ,STRAIGHTEN ,KNOCK OUT ,REALIGN AND REPAIR INCLUDING CUT AND WELD BODY PANELS .TO RE-ADJUST TO THE ORIGINAL POSITION USING POWER TOOLS.		600.00	300.00
			710.00	360.00
GRAND TOTAL			2,390.22	741.93
RECOMMENDED COST OF REPAIRS				741.93

Report Ref No. CC4/LPC20012283/Qga3q2

OI SUN PIN

Asst. Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBK 2932R

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

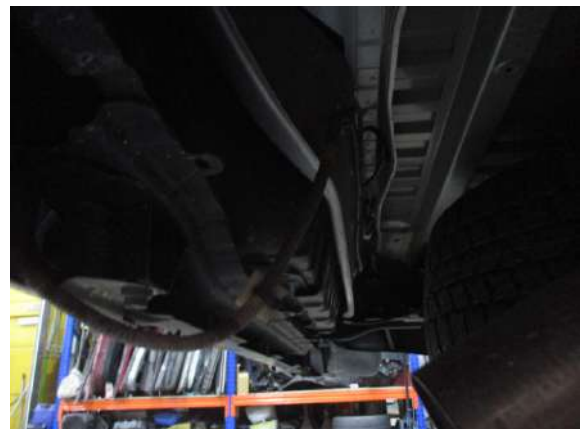



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBK 2932R

RE-INSPECTION

