



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2102989

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 29/04/2021
Reference CC4/FCI20012344/T1rs3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. EY 6000U
Insured Veh. SH 6078U
Claim No. D20004459MFSH
Policy No. D-20094922MFSH
Accident Date 31/10/2020
Inspection Date 13/11/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20012344/T1rs3q2	
			Date: 29/04/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SH 6078U	Veh. Inspected	EY 6000U
	Policy No.	D-20094922MFSH	Coverage (\$)	0.00
	Claim No.	D20004459MFSH	Excess (\$)	0.00
	Assign From	VIC	Assign Date	11/11/2020
2. Vehicle Particulars & Condition				
	Make & Model	JAGUAR XF 2.0	c.c	1999
	Engine No.	HIDDEN	Year of Reg.	2015
	Chassis No.	SAJAC05M4FPU66801	Colour	MAROON
	Odometer	43718 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	245/45 R18	MICHELIN	6 mm
	L/H Front Tyre	245/45 R18	MICHELIN	6 mm
	R/H Rear Tyre	245/45 R18	MICHELIN	6 mm
	L/H Rear Tyre	245/45 R18	MICHELIN	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE O/S REAR PORTION AND UNDERCARRIAGE. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	31/10/2020	Inspection Date	13/11/2020
	Survey held at	WEARNES AUTOMOTIVE PTE LTD 45 LENG KEE ROAD SINGAPORE 159103.		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. EY 6000U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER COVER REAR XF (SN)	DEFORMED	2,195.10	1,975.59
1	REAR VALANCE V6 S207 (SN)	NOT NECESSARY	659.90	-
1	WHEEL -ROAD -ALLOY (SN)	CUT	1,035.00	931.50
1	FENDER PANEL REAR RH (SN)	BENT	5,336.60	4,802.94
1	WINDSCREEN REAR S207 (SN)	NECESSARY	1,164.40	1,047.96
4	WINDSCREEN SPACER (SN)	NECESSARY	32.80	29.52
1	SEALANT WINDSCREEN (SN)	NECESSARY	319.00	287.10
1	*D* WELDING PRIMER (SN) (ADDITIONAL)	NECESSARY	61.20	61.20
			10,804.00	9,135.81
	<u>LABOUR</u>			
	TO REPLACE REAR BUMPER ,REAR RH FENDER ETC.		3,600.00	3,150.00
	TO SPRAYPAINT ON REAR BUMPER & FENDER RHR .		2,400.00	1,600.00
	TO CHECK WIRING INCLUDE RESETTING OF ALL ELECTRICAL MODULES.		525.00	525.00
	TO REPLACE REAR RH RIM .		50.00	50.00
	WHEEL ALIGNMENT .		280.00	280.00
	TO REPLACE REAR WINDSCREEN .		600.00	600.00
	TO INSTALL REAR WINDSCREEN FIL .		280.00	280.00
			7,735.00	6,485.00
	GRAND TOTAL		18,539.00	15,620.81
	RECOMMENDED COST OF REPAIRS			15,620.81

Report Ref No. CC4/FCI20012344/T1rs3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. EY 6000U

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

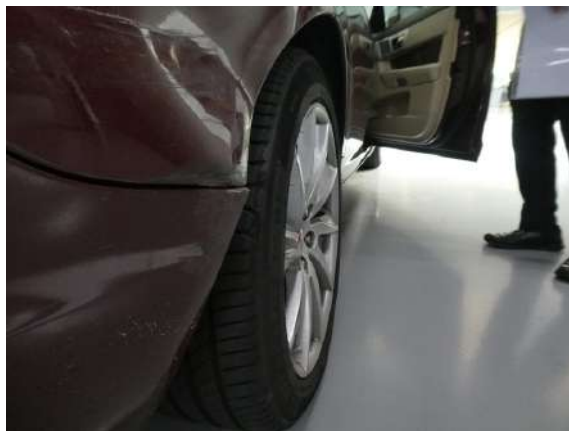



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. EY 6000U

RE-INSPECTION

