



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2106503

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 17/09/2021
Reference CC4/FCI20012350/Gra3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SKD 8149B
Insured Veh. SHA 2318X
Claim No. D20004571MFSH
Policy No. D-20094922MFSH
Accident Date 06/11/2020
Inspection Date 13/11/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20012350/Gra3q2	
			Date: 17/09/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHA 2318X	Veh. Inspected	SKD 8149B	
Policy No.	D-20094922MFSH	Coverage (\$)	0.00	
Claim No.	D20004571MFSH	Excess (\$)	0.00	
Assign From	VIC	Assign Date	11/11/2020	
2. Vehicle Particulars & Condition				
Make & Model	MERCEDES BENZ C 180	c.c	1597	
Engine No.	HIDDEN	Year of Reg.	2012	
Chassis No.	WDD2040452A655883	Colour	RED	
Odometer	210032 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	225/40Z R18	TOYO	6 mm	
L/H Front Tyre	225/40Z R18	TOYO	6 mm	
R/H Rear Tyre	225/40Z R18	TOYO	6 mm	
L/H Rear Tyre	225/40Z R18	TOYO	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	06/11/2020	Inspection Date	13/11/2020	
Survey held at	BIFROST AUTO PTE LTD 8 KAKI BUKIT AVENUE 4 #01-49 PREMIER @ KAKI BUKIT SINGAPORE 415875			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKD 8149B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BOOTLID	NOT NECESSARY	1,570.80	-
1	BOOTLID LOCK	NOT NECESSARY	394.50	-
1	BOOTLID LOGO	NECESSARY	58.90	58.90
1	BOOTLID WEATHERSTRIP	TWISTED	280.70	153.00
1	BOOTLID INNER TRIM	NOT NECESSARY	564.70	-
1	REAR BUMPER	DEFORMED	1,456.80	1,345.10
1	REAR BUMPER RETAINER (RH)	DEFORMED	58.50	58.50
1	REAR BUMPER RETAINER (LH)	DEFORMED	58.50	58.50
1	REAR BUMPER BRACKET (RH)	CRACKED	37.80	37.80
1	REAR BUMPER BRACKET (LH)	CRACKED	37.80	37.80
1	REAR BUMPER INNER FRAME CENTER	DEFORMED	182.50	182.50
1	REAR BUMPER REINFORCEMENT	NOT NECESSARY	797.60	-
1	REAR BUMPER LOWER LIP	BROKEN	978.40	357.45
1	TAIL LAMP (RH)	CRACKED	789.40	542.00
1	TAIL LAMP (LH)	CRACKED	789.40	542.00
1	EXHAUST PIPE (RH)	NOT NECESSARY	2,127.80	-
1	EXHAUST PIPE (LH)	NOT NECESSARY	2,127.80	-
1	EXHAUST PIPE GASKET	NOT NECESSARY	25.50	-
1	EXHAUST PIPE MOUNTING	NOT NECESSARY	95.40	-
1	END PANEL	TO REPAIR SEE LABOUR	1,365.60	-
1	END PANEL TOP GARNISH	BROKEN	159.40	159.40
	LESS 5% DISCOUNT		-697.89	-
	LESS 10% DISCOUNT		-	-353.30
			13,259.91	3,179.65
	<u>SPECIAL NETT ITEMS</u>			
1	SET REAR BUMPER CLIP (SN)	NECESSARY	50.00	30.00
1	SET END PANEL TOP GARNISH CLIP (SN)	NECESSARY	50.00	10.00
1	SET REVERSE SENSOR (SN)	DAMAGED	450.00	200.00
1	END PANEL SEALANT (SN)	NOT NECESSARY	85.00	-



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET TAIL LAMP CLIP (SN)	NECESSARY	30.00	10.00
			665.00	250.00
	LABOUR			
	TO DISMANTLE .REPLACE ,CUT ,WELD ,KNOCK OUT DENTS TO STRAIGHTEN ACCIDENT PARTS AS- MENTION REPAIR PARTS ,INCLUSIVE OF REPLACEMENT PARTS.INCLUSIVE OF THE REPAIR OF END PANEL .		900.00	600.00
	TO PUTTY AND SPRAY PAINT ON ALL ACCIDENT DAMAGE PARTS AND OTHER ACCIDENT AFFECTED AREAS.		800.00	600.00
	TO CHECK WIRING SYSTEM TO FACILITATE REPAIR AND REFIT THE SAME .		60.00	30.00
	APPLY RUST PROOFING ON THE ADJACCENT PANELS.	NOT NECESSARY	80.00	-
	TO SUPPLY UNDER COATING /PUTTY ON PARTS REPLACED.	NOT NECESSARY	50.00	-
	TO PERFORM WATER SEEPAGE TEST AFTER REPAIR .	NOT NECESSARY	80.00	-
	REMOVE AND REFIT REAR END PANEL LINING AND GARNISH TO FACILITATE REPAIR .		80.00	60.00
	REMOVE AND REFIT REAR BUMPER SENSOR .		60.00	40.00
			2,110.00	1,330.00
GRAND TOTAL			16,034.91	4,759.65
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,800.00

Report Ref No. CC4/FCI20012350/Gra3q2

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKD 8149B

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

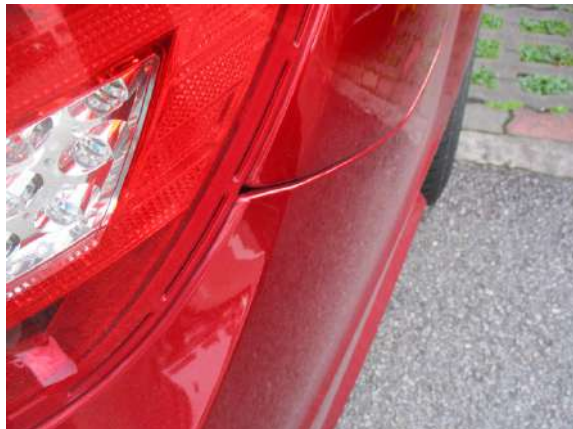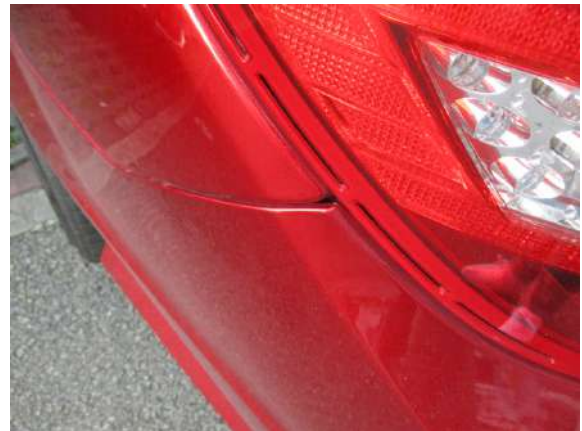



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKD 8149B

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKD 8149B

RE-INSPECTION

