



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD
300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2102675
INV Date 15/04/2021
Reference CC4/LPC20012416/Apa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SJQ 3845B
Insured Veh. GBB 4776J
Claim No. 20/20/20/VC05/023890
Policy No. Z20VC05006344
Accident Date 10/11/2020
Inspection Date 11/11/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555		Ref: CC4/LPC20012416/Apa3q2 Date: 15/04/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	GBB 4776J	Veh. Inspected	SJQ 3845B
Policy No.	Z20VC05006344	Coverage (\$)	0.00
Claim No.	20/20/20/VC05/023890	Excess (\$)	0.00
Assign From	KENNY	Assign Date	11/11/2020
2. Vehicle Particulars & Condition			
Make & Model	HONDA FIT	c.c	1339
Engine No.	HIDDEN	Year of Reg.	2009
Chassis No.	GE61164778	Colour	WHITE
Odometer	127994 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	205/45 R17	ACHILLES	6 mm
L/H Front Tyre	205/45 R17	ACHILLES	6 mm
R/H Rear Tyre	205/45 R17	ACHILLES	6 mm
L/H Rear Tyre	205/45 R17	ACHILLES	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT & REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	10/11/2020	Inspection Date	11/11/2020
Survey held at	HUA MENG SPRAY PAINTING WORKSHOP 1 KAKI BUKIT AVE 6 #01-61 AUTOBAY SINGAPORE 417883		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		17 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJQ 3845B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	REAR WINDSCREEN MOULDING	NECESSARY	79.50	79.50
1	TAILGATE	DISTORTED	966.00	845.00
2	TAILGATE DAMPERS @\$131.50	NOT NECESSARY	263.00	-
2	TAILGATE HINGES @\$68.50	NOT NECESSARY	137.40	-
1	TAILGATE INNER TRIM BOARD	CRACKED	254.50	254.50
1	TAILGATE INNER LOCK	JAMMED	183.50	183.50
1	TAILGATE INNER CATCH	NOT NECESSARY	42.60	-
1	TAILGATE OUTER HANDLE	CUT	154.10	154.10
1	TAILGATE H EMBLEM	NECESSARY	45.00	45.00
1	TAILGATE FIT EMBLEM	NECESSARY	48.50	48.50
1	TAILGATE INNER PULL POCKET	DEFORMED	85.60	35.00
2	REAR TAILLAMP @\$526.10	CRACKED	1,052.20	570.00
2	REAR TAILLAP PANEL @\$438.00	N/S DENTED	876.40	146.00
1	REAR TAILGATE CABLE	NOT NECESSARY	34.00	-
1	REAR END PANEL	DISTORTED	553.40	356.70
1	REAR END PANEL INNER GARNISH	DEFORMED	213.40	116.20
1	REAR BUMPER	DISTORTED	660.90	483.20
2	REAR BUMPER BRACKET @\$32.70	NECESSARY	65.40	65.40
1	SET REAR BUMPER CLIPS	NECESSARY	35.00	35.00
1	REAR BUMPER TOWING HOOK COVER	DISTORTED	38.50	38.50
1	REAR WINDSCREEN	SHATTERED	754.20	754.20
1	REAR WIPER ARM	CUT	49.50	49.50
1	REAR WIPER ARM COVER	CRACKED	30.00	30.00
1	REAR WIPER MOTOR	DAMAGED	261.80	261.80
2	REAR FENDER QUARTER GLASS RUBBER @\$40.20	N/S NECESSARY	80.40	40.20
2	REAR FENDER @\$717.70	N/S BUCKLED	1,435.40	717.70
2	REAR FENDER INNER SIDE GARNISH @\$335.60	DEFORMED	671.20	568.40
2	REAR FENDER INNER SIDE TOP GARNISH @\$275.00	DEFORMED	550.00	390.00
1	REAR SPARE TYRE TOP BOARD	DEFORMED	290.40	290.40
1	REAR SPARE TYRE WELL PANEL	BUCKLED	965.00	737.00
3	REAR SPARE TYRE WELL INSULATION @\$209.80	NOT NECESSARY	629.40	-

Report Ref No. CC4/LPC20012416/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR SPARE TYRE SPONGE	DEFORMED	242.50	242.50
2	REAR SPARE TYRE SIDE PANEL @\$105.20	TO REPAIR SEE LABOUR	210.40	-
1	REAR RH CHASSIS FRAME	TO REPAIR SEE LABOUR	165.00	-
2	REAR EXHAUST PIPE MOUNTING @\$32.40	NOT NECESSARY	64.80	-
1	REAR EXHAUST COVER	CRUMPLED	40.80	40.80
2	REAR NUMBER PLATE LAMP @\$45.00	NOT NECESSARY	90.00	-
2	FRONT BONNET HINGES @\$34.50	NOT NECESSARY	69.00	-
1	FRONT BONNET LOCK	NOT NECESSARY	99.70	-
1	FRONT GRILLE	CRACKED	175.30	175.30
1	FRONT GRILLE EMBLEM	NECESSARY	35.00	35.00
1	SET FRONT GRILLE CLIPS	NECESSARY	60.00	20.00
1	FRONT SUPPORT PANEL	TO REPAIR SEE LABOUR	450.00	-
1	FRONT BUMPER	DISTORTED	578.00	578.00
2	FRONT BUMPER SIDE HOLDER @\$23.70	NECESSARY	47.40	47.40
1	FRONT BUMPER LOWER CENTRE GRILLE	DEFORMED	114.80	114.80
1	FRONT BUMPER TOWING HOOK COVER	MISSING	30.00	30.00
1	FRONT BUMPER REINFORCEMENT	BENT	280.00	280.00
2	FRONT BUMPER BRACKET @\$30.40	NOT NECESSARY	60.80	-
1	SET FRONT BUMPER CLIPS	NECESSARY	60.00	30.00
2	FRONT HEADLAMP @\$643.50	CRACKED	1,287.00	1,287.00
2	FRONT HEADLAMP LOWER BRACKET @\$30.50	CRACKED	61.00	61.00
1	AIRCOND CONDENSER	BENT	846.00	846.00
1	RADIATOR	NOT NECESSARY	1,525.00	-
	LESS 20% DISCOUNT		-3,619.74	-2,216.62
			14,478.96	8,866.48
1	REAR EXHAUST PIPE (SN)	BENT	1,800.00	1,250.00
1	FRONT BONNET (SN)	BUCKLED	1,600.00	1,250.00
	LESS 20% DISCOUNT		-680.00	-
			2,720.00	2,500.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>SPECIAL NETT ITEMS</u>				
1	FRONT NUMBER PLATE (SN)	BENT	50.00	30.00
1	FRONT NUMBER PLATE HOLDER (SN)	DEFORMED	50.00	30.00
1	REAR NUMBER PLATE (SN)	BENT	50.00	30.00
1	REAR NUMBER PLATE HOLDER (SN)	DEFORMED	50.00	30.00
1	SET REAR BUMPER SENSOR (SN)	DAMAGED	380.00	200.00
			580.00	320.00
<u>LABOUR</u>				
	TO SUPPLY REAR END PANEL SEALANT .		200.00	60.00
	TO SUPPLY REAR WINDSCREEN SEALANT .		100.00	60.00
	REMOVE & REINSTALL REAR WINDSCREEN & QUARTER GLASS .		300.00	160.00
	REMOVE & REINSTALL ROOF LINING & CUSHION .		300.00	200.00
	REMOVE & REINSTALL REVERSE SENSOR .		150.00	50.00
	REMOVE & REINSTALL PETROL TANK .		150.00	80.00
	REMOVE & REINSTALL AIR CON FILL IN GAS.		150.00	120.00
	REMOVE,REPLACE & REPAIR CONSISTENT TO THE ACCIDENT .INCLUSIVE OF THE REPAIR OF REAR SPARE TYRE SIDE PANEL,REAR RH CHASSIS FRAME AND FRONT SUPPORT PANEL .		2,200.00	2,000.00
	RESPRAY PAINTING .		1,800.00	1,800.00
	TUFF KOTE.		50.00	50.00
			5,400.00	4,580.00
GRAND TOTAL			23,178.96	16,266.48
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				13,000.00

Report Ref No. CC4/LPC20012416/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJQ 3845B

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

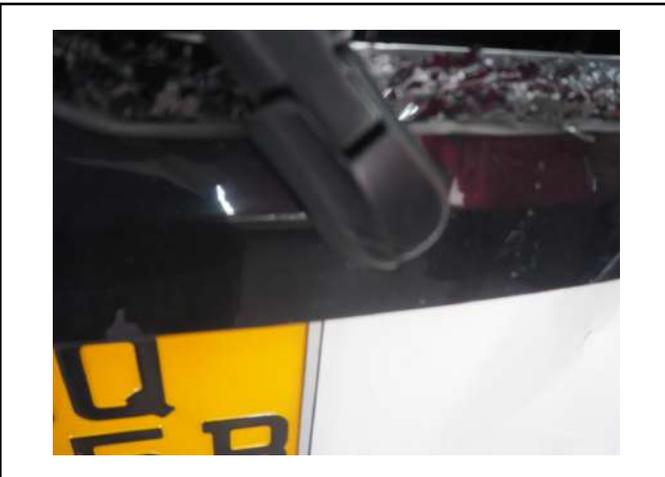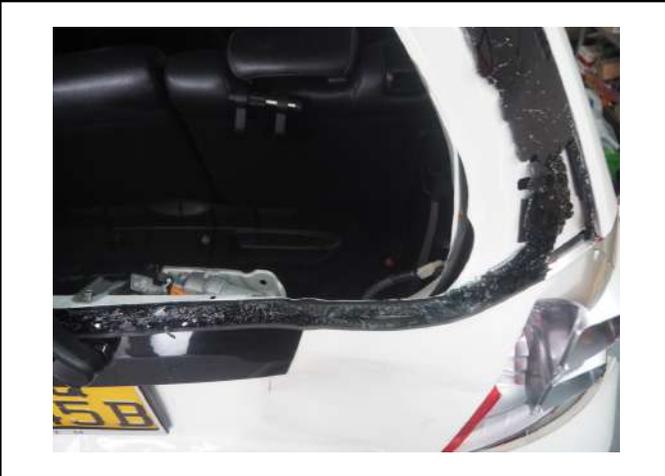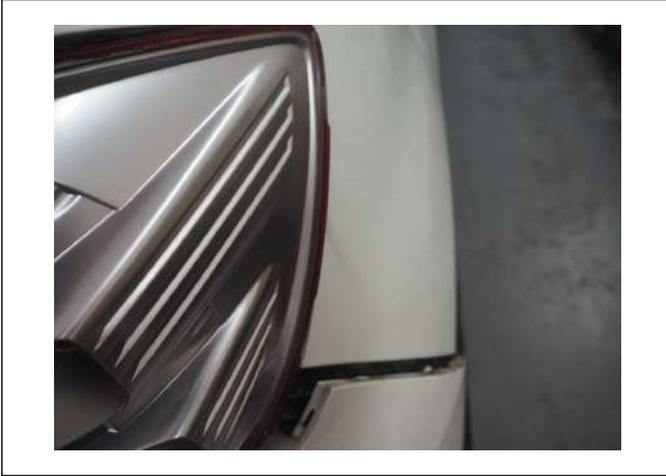



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

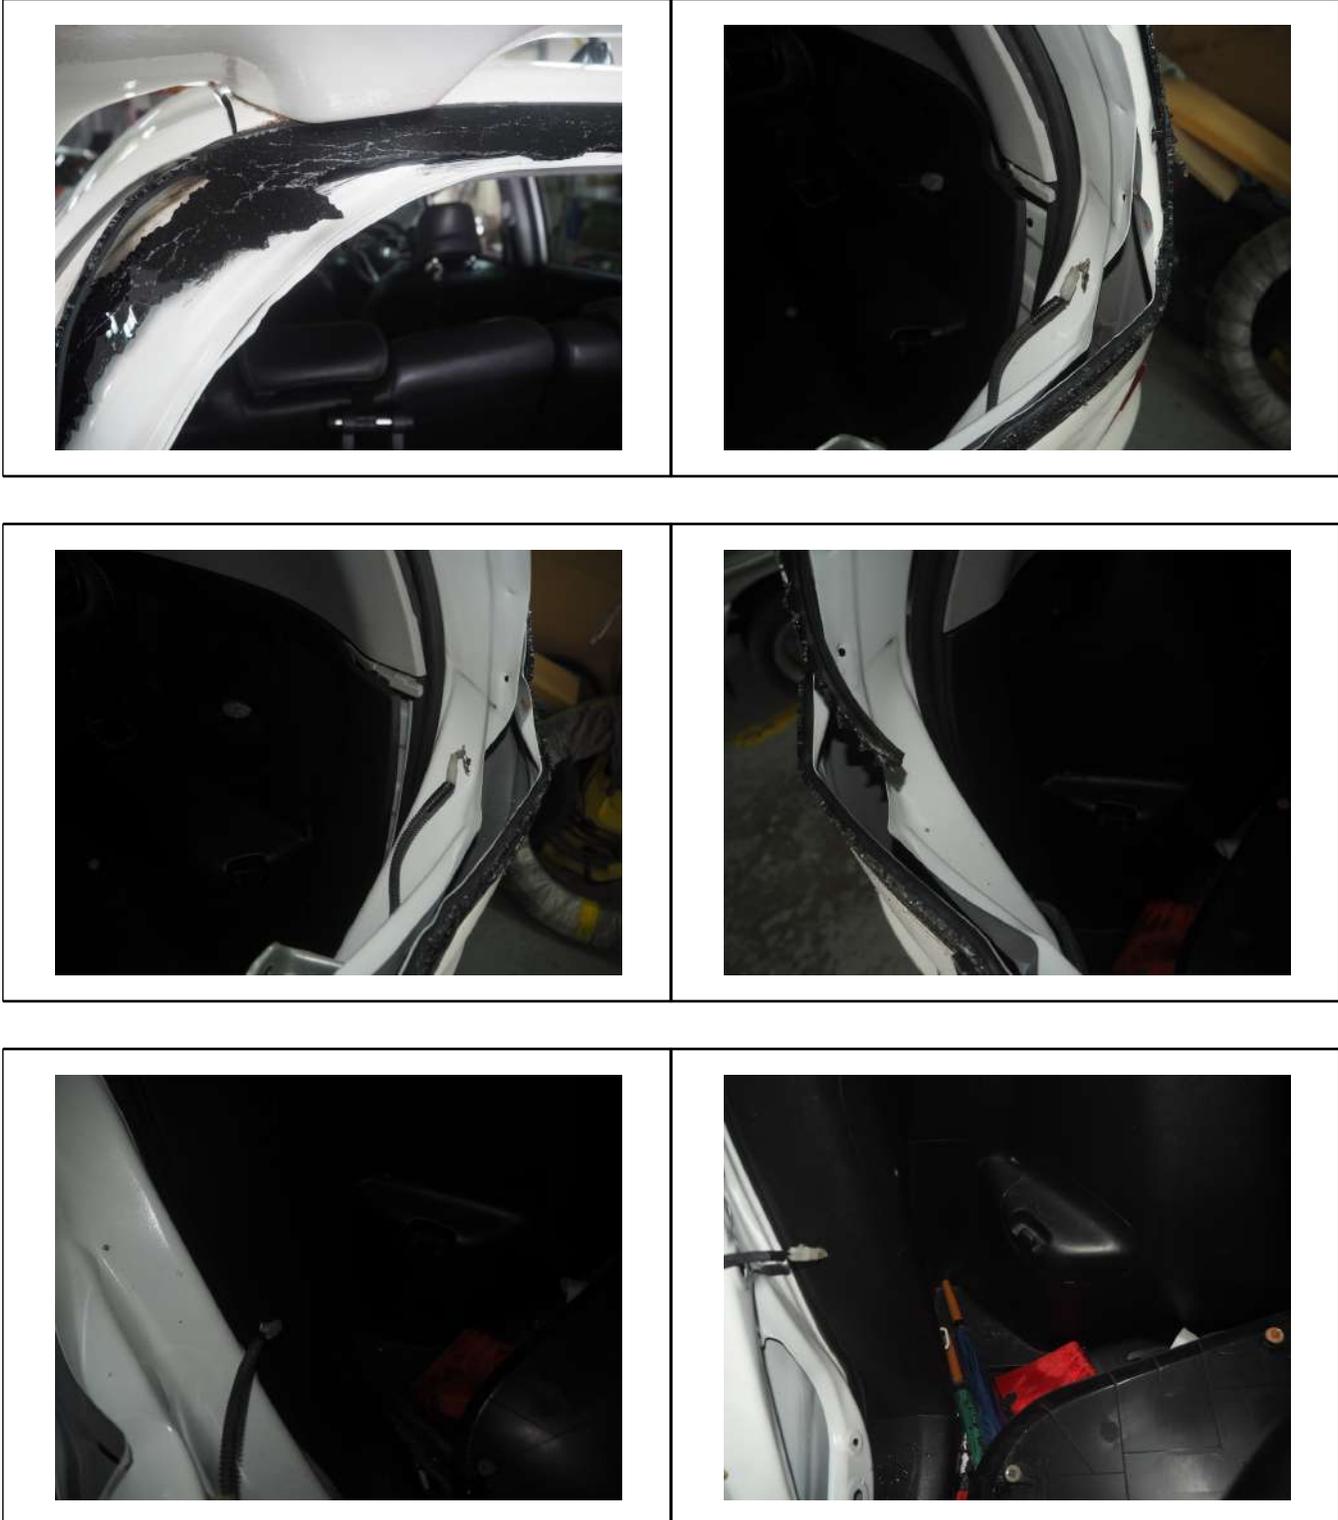





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

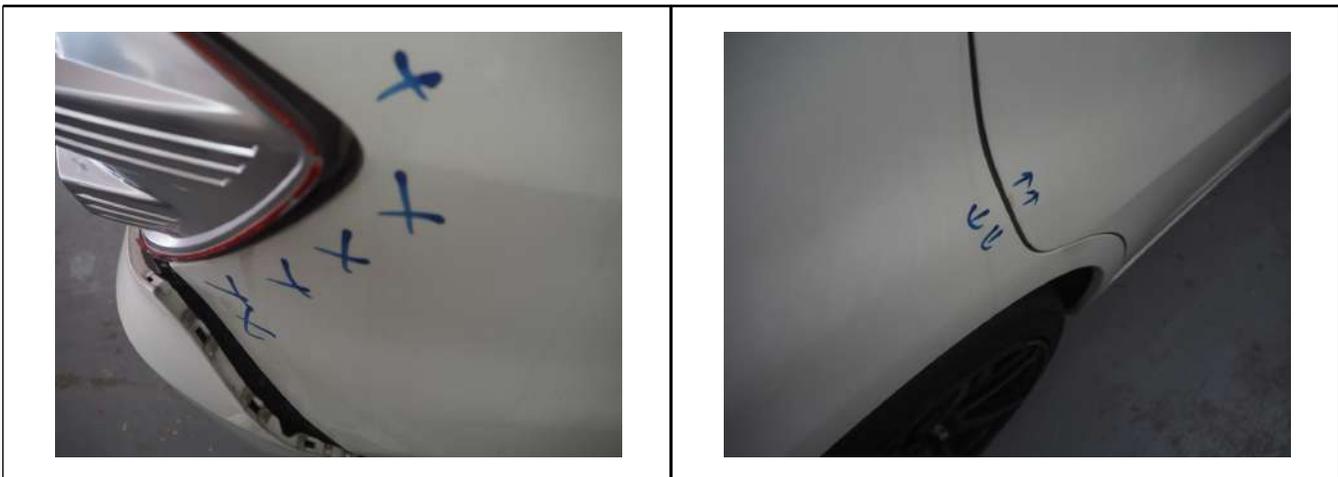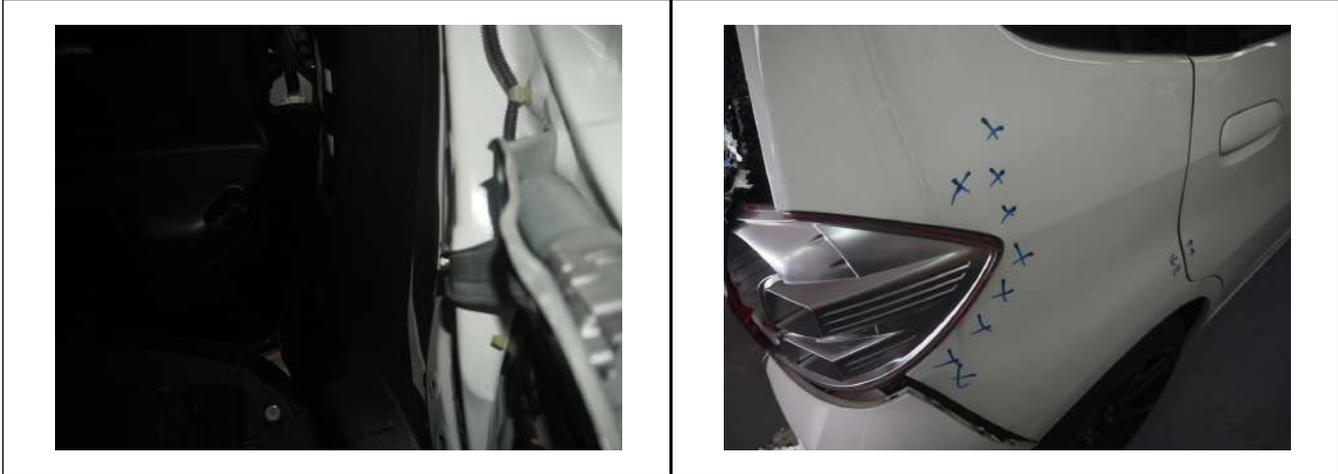




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

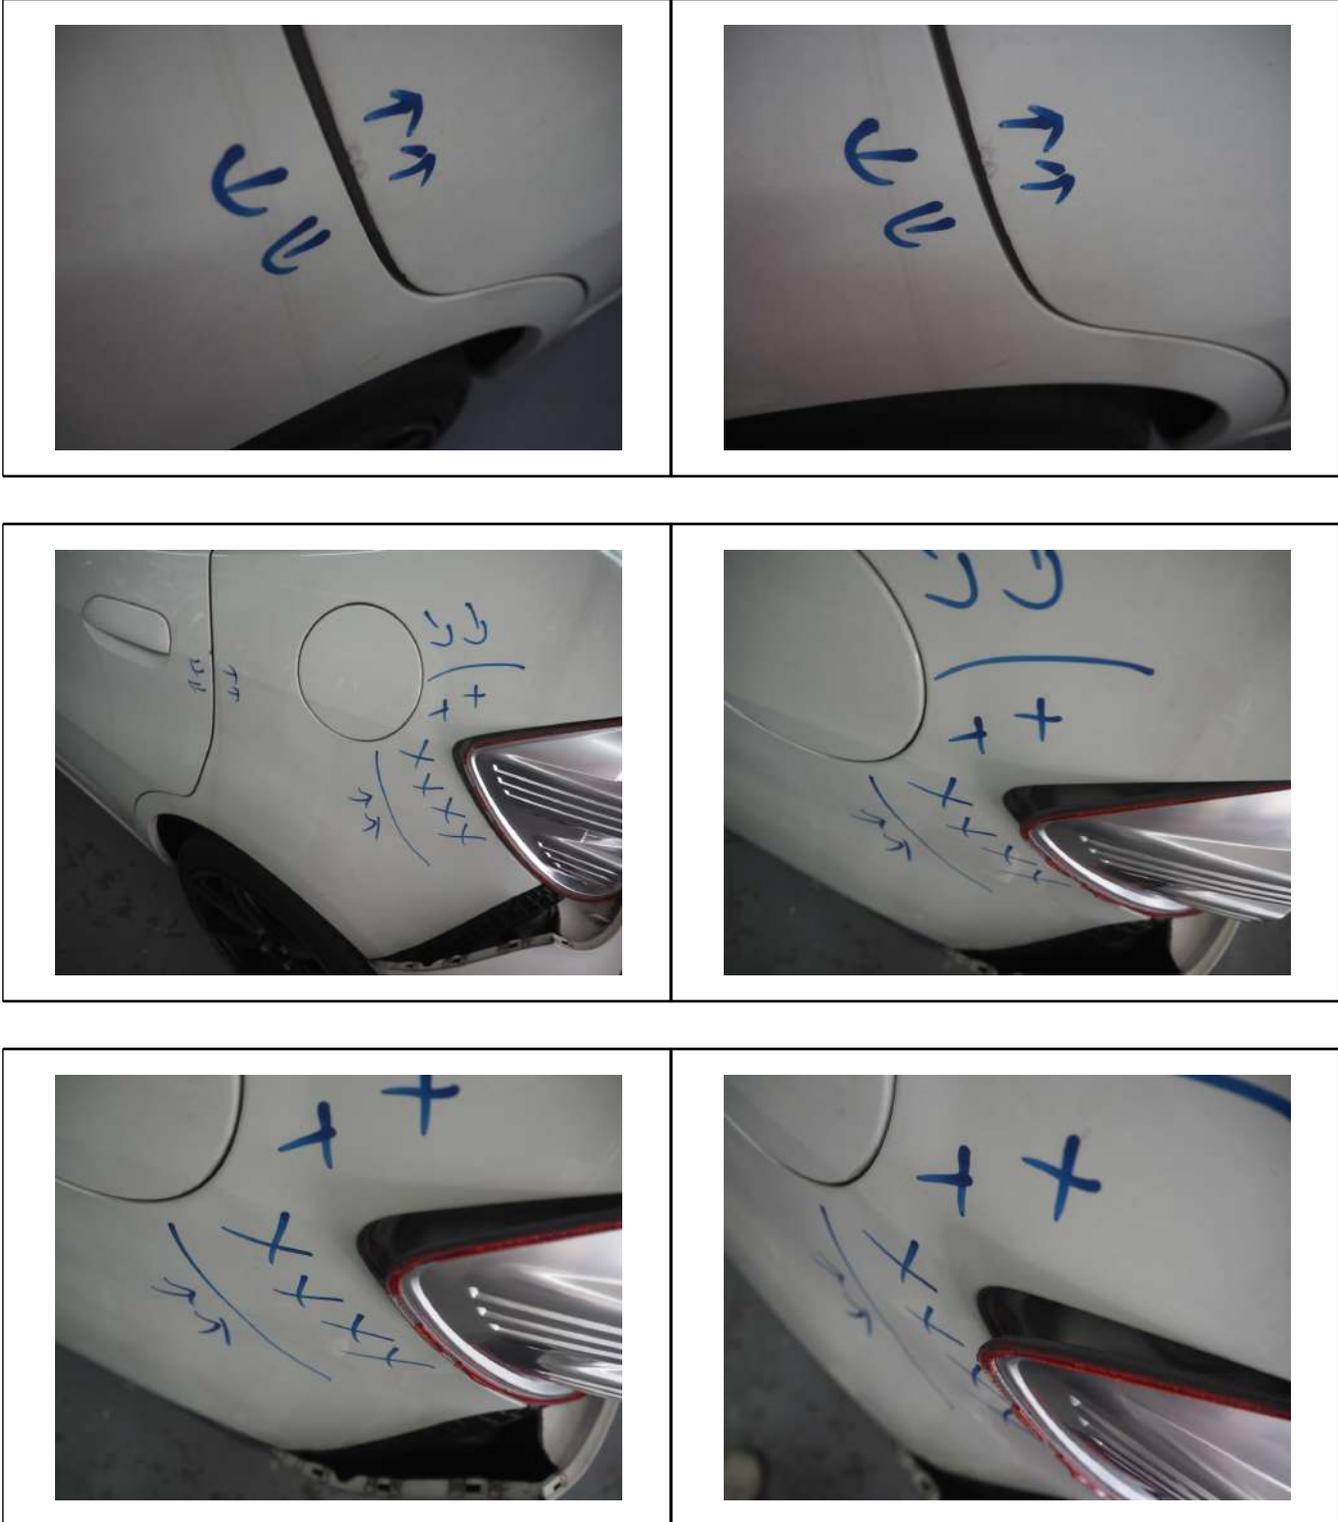




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

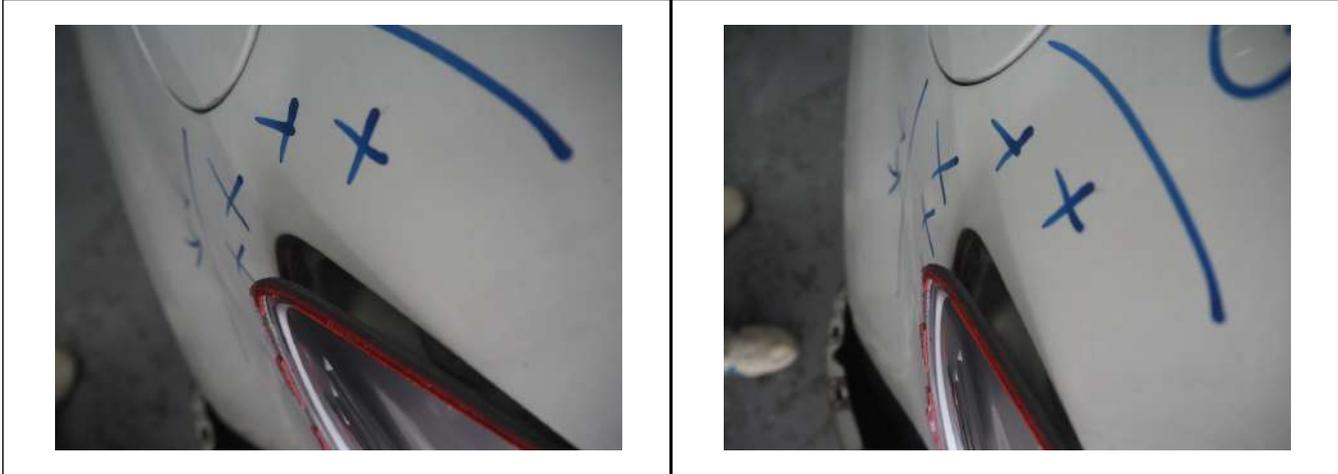



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJQ 3845B

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

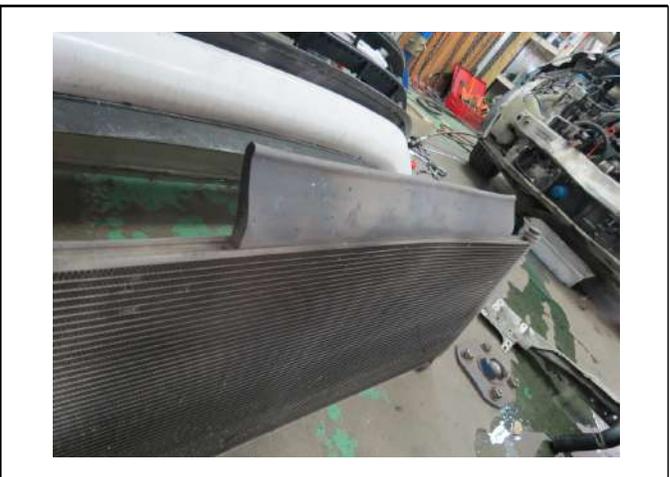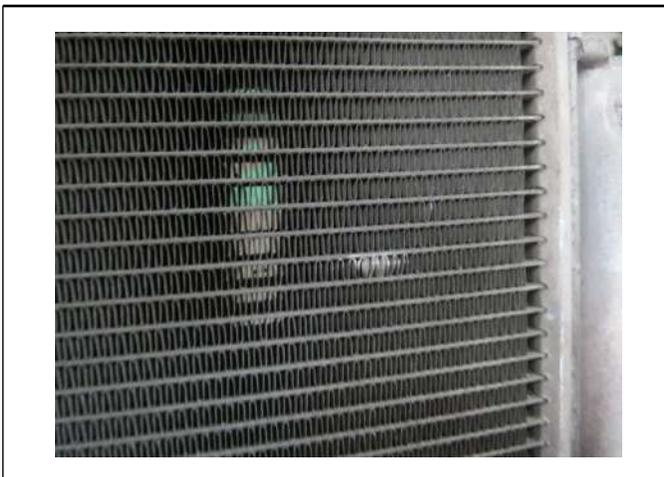



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

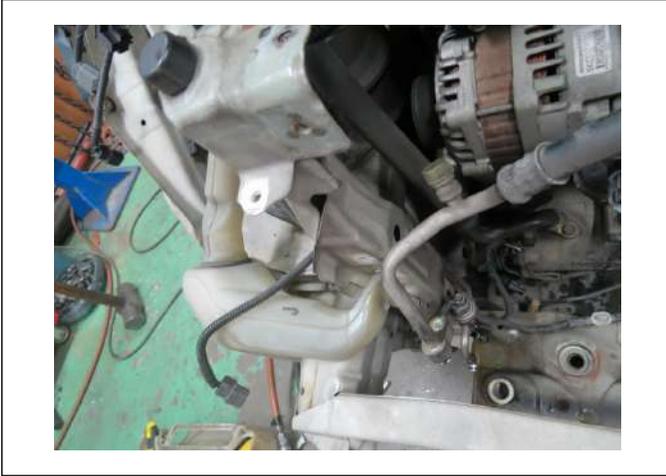



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

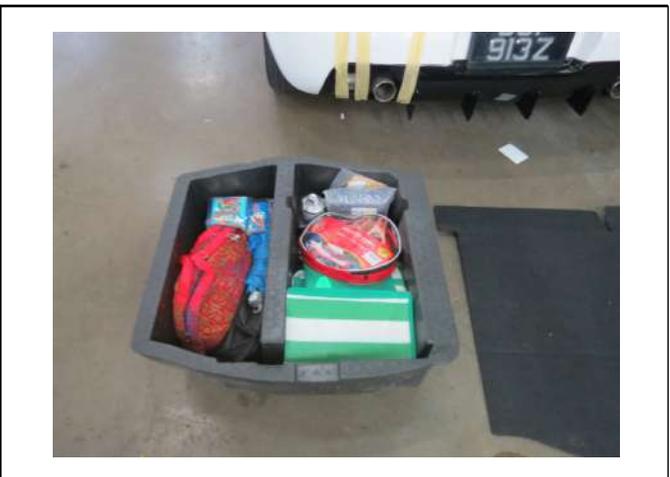



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

