



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2102384

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 09/04/2021
Reference CC6/CTI20012641/Uea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLW 3085Y
Insured Veh. YP 780B
Claim No. SNM20D204443
Policy No. DMCVSNW00017542004
Accident Date 17/11/2020
Inspection Date 17/11/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI20012641/Uea3q2 Date: 09/04/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YP 780B	Veh. Inspected	SLW 3085Y	
Policy No.	DMCVSNW00017542004	Coverage (\$)	0.00	
Claim No.	SNM20D204443	Excess (\$)	0.00	
Assign From		Assign Date	17/11/2020	
2. Vehicle Particulars & Condition				
Make & Model	HONDA VEZEL (A)	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	RU11230841	Colour	BLUE	
Odometer	64906 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	DUNLOP	6 mm	
L/H Front Tyre	215/60 R16	DUNLOP	6 mm	
R/H Rear Tyre	215/60 R16	DUNLOP	6 mm	
L/H Rear Tyre	215/60 R16	DUNLOP	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR AND FRONT PORTION.THE CHASSIS FRAME AFFECTED DUE TO COLLISION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	17/11/2020	Inspection Date	17/11/2020	
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			15 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLW 3085Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR WINDSCREEN MOULDING	NECESSARY	88.20	88.20
1	REAR WINDSCREEN	SHATTERED	1,650.00	1,288.20
1	TAILGATE	BADLY DENTED	1,100.90	953.00
1	TAILGATE TOP SPOILER	NOT NECESSARY	860.00	-
1	TAILGATE OUTER GARNISH	CRACKED	315.20	204.80
2	TAILGATE DAMPERS @\$299.10	SERVICEABLE	598.20	-
1	TAILGATE "H" LOGO	NECESSARY	32.50	32.50
1	TAILGATE "VEZEL" EMBLEM	NOT FITTED	56.50	-
2	TAILGATE REFLECTORS @\$364.60	CRACKED	729.20	561.20
1	TAILGATE INNER LOCK	BENT / JAMMED	181.90	181.90
1	TAILGATE LOCK STRIKER	TWISTED	48.60	48.60
1	TAILGATE INNER TRIM BOARD	CRACKED	368.20	175.50
1	SET TAILGATE INNER TRIM BOARD CLIPS	NECESSARY	50.00	50.00
1	TAILGATE INNER HANDLE HOLDER	TWISTED	32.00	32.00
2	TAILGATE DAMPERS @\$192.50	REPEATED	385.00	-
1	TAILGATE WEATHERSTRIP	TWISTED	199.00	101.30
1	REAR BUMPER	DISTORTED	863.50	593.20
2	REAR BUMPER SIDES @\$395.10	DISTORTED	790.20	590.00
2	REAR BUMPER REFLECTORS @\$165.00	CRACKED	330.00	302.00
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	50.00
1	REAR BUMPER LOWER UNDER COVER	DISTORTED	312.00	312.00
1	SET REAR BUMPER LOWER UNDER COVER CLIPS	NECESSARY	50.00	45.00
2	REAR BUMPER SIDE RETAINERS @\$45.00	BENT	90.00	90.00
1	REAR END PANEL	BADLY DENTED	517.00	517.00
1	REAR END PANEL TOP GARNISH	DISTORTED	188.00	188.00
2	TAILLAMPS @\$485.00	CRACKED	970.00	961.20
2	TAILLAMP HOUSING PANELS @\$350.00	BENT / DENTED	700.00	599.00
1	REAR FLOOR SIDE N/S PANEL	DISTORTED	399.20	366.20
1	REAR FLOOR PANEL	CRUMPLED / BUCKLED	1,330.20	986.20
1	REAR FLOOR PANEL TOP BOARD	TORN	326.50	316.50

Report Ref No. CC6/CTI20012641/Uea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR FLOOR PANEL TOOLS SPONGE	TORN	688.00	495.50
1	REAR LOCK SENSOR	CRACKED	295.00	205.40
2	REAR FENDERS @\$991.00	BADLY DENTED / WARPED	1,982.00	1,962.00
2	REAR FENDER INNER TRIMS @\$450.00	DISTORTED	900.00	770.20
2	REAR FENDER UNDER COVERS @\$299.20	TORN	598.40	369.00
1	REAR EXHAUST	TO REPAIR SEE LABOUR	785.20	-
2	REAR EXHAUST MOUNTINGS @\$45.00	NOT NECESSARY	90.00	-
1	REAR EXHAUST HEATSHIELD	NOT NECESSARY	188.90	-
2	REAR FENDER OUTER PROTECTORS @\$299.00	TORN	598.00	360.20
1	ROOF LINING	WARPED	1,885.20	1,415.30
1	REAR DOOR N/S	TO REPAIR SEE LABOUR	981.20	-
1	REAR DOOR INNER LOCK N/S	SHORTED	399.50	322.50
1	REAR WIPER ARM	BENT	166.50	105.40
1	REAR WIPER MOTOR	JAMMED	688.90	345.20
1	REAR WIPER BLADE	SERVICEABLE	88.60	-
1	REAR AXLE BEAM	NOT NECESSARY	1,650.00	-
2	REAR SHOCK ABSORBERS @\$305.10	NOT NECESSARY	610.20	-
2	REAR WHEEL HUB BEARINGS @\$450.00	NOT NECESSARY	900.00	-
1	REAR WHEEL HOUSING PANEL N/S	BADLY DENTED	1,080.20	1,005.20
1	BONNET	BUCKLED	915.00	855.20
2	BONNET HINGES @\$151.00	BENT	302.00	302.00
1	BONNET INSULATOR	SERVICEABLE	285.20	-
1	SET BONNET INSULATOR CLIPS	NECESSARY	50.00	50.00
1	BONNET INNER RUBBER	NECESSARY	65.00	65.00
1	BONNET LOCK	TWISTED	135.50	135.50
1	BONNET LOCK CABLE	SERVICEABLE	199.00	-
1	FRONT BUMPER	DISTORTED	950.00	752.20
1	FRONT BUMPER REINFORCEMENT	BENT	480.00	321.00
2	FRONT BUMPER SIDE RETAINERS @\$65.00	BENT	130.00	96.00
1	FRONT BUMPER CENTRE GRILLE	TORN	399.00	162.30
1	FRONT BUMPER LOWER SPOILER	TORN	480.00	466.00

Report Ref No. CC6/CTI20012641/Uea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	FRONT BUMPER FOG LAMP COVERS @\$180.00	TWISTED	360.00	242.00
2	FRONT BUMPER FOG LAMPS @\$445.00	CRACKED	890.00	654.00
1	FRONT BUMPER UNDER COVER	NOT NECESSARY	315.00	-
1	SET FRONT BUMPER CLIPS	NOT NECESSARY	50.00	-
1	FRONT BUMPER TOW COVER	NOT NECESSARY	30.00	-
1	FRONT GRILLE	CRACKED	525.00	525.00
1	FRONT GRILLE OUTER GARNISH	CRACKED	548.00	385.00
1	FRONT GRILLE LOGO	NECESSARY	48.00	38.00
2	HEADLAMPS @\$2950.00	CRACKED	5,900.00	3,718.40
2	HEADLAMP LOWER BRACKETS @\$145.00	CRACKED	290.00	170.00
1	FRONT SUPPORT PANEL	BENT	745.00	576.20
1	FRONT SUPPORT PANEL TOP GARNISH	DISTORTED	322.00	188.20
1	SET FRONT SUPPORT PANEL TOP GARNISH CLIPS	NECESSARY	30.00	30.00
2	FRONT FENDERS @\$688.20	TO REPAIR SEE LABOUR	1,376.40	-
2	FRONT FENDER INNER SHIELDS @\$166.50	NOT NECESSARY	333.00	-
2	FRONT FENDER OUTER PROTECTORS @\$295.00	TORN	590.00	370.00
1	AIR CON CONDENSER	BENT / PUNCTURE	1,569.00	1,005.20
2	AIR CON CONDENSER SIDE GARNISHS @\$155.20	SERVICEABLE	310.40	-
1	RADIATOR	BENT / PUNCTURE	1,817.90	1,649.40
1	RADIATOR FAN COWLING	NOT NECESSARY	245.00	-
1	RADIATOR FAN BLADE	NOT NECESSARY	121.00	-
1	RADIATOR FAN MOTOR	NOT NECESSARY	450.00	-
1	FRONT LOCK CENTRE BRACKET	CRACKED	115.00	115.00
1	AIR DUCT	TWISTED	215.00	188.00
1	AIR CLEANER BOX	NOT NECESSARY	650.20	-
1	FRONT WIPER GARNISH	NOT NECESSARY	388.00	-
1	BATTERY TRAY	NOT NECESSARY	145.90	-
1	WASHER TANK	NOT NECESSARY	245.80	-
	LESS 20% DISCOUNT		-	-6,009.80
			51,204.10	24,039.20
	SPECIAL NETT ITEMS			
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	50.00	40.00

Report Ref No. CC6/CTI20012641/Uea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET REAR WINDSCREEN SOLAR FILM (SN)	NECESSARY	280.00	200.00
1	SET REAR REVERSE CAMERA (SN)	SHORTED	380.00	300.00
1	SET REAR REVERSE VIDEO CAM (SN)	MISSING	450.00	350.00
1	REAR LICENCE PLATE W/HOLDER (SN)	NOT NECESSARY	50.00	-
1	SET REAR BUMPER REVERSE SENSOR (SN)	SHORTED	280.00	200.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00
1	SET REAR FLOOR PANEL INSULATOR (SN)	NOT NECESSARY	200.00	-
1	FRONT LICENCE PLATE W/HOLDER (SN)	NOT NECESSARY	50.00	-
1	BOL RADIATOR COOLANT (SN)	NECESSARY	50.00	30.00
			1,840.00	1,170.00
	LABOUR			
	TO CHECK WIRING.		80.00	30.00
	TO DISMANTLE & REPLACED REVERSE SENSOR.		80.00	50.00
	TO DISMANTLE & REPLACED REAR WINDSCREEN.		150.00	120.00
	TO DISMANTLE & REFIX CUSHION UPHOLSTERY.		120.00	80.00
	TO DISMANTLE & REPLACED ROOF LINING.		380.00	120.00
	TO DISMANTLE & REFIX REAR EXHAUST.		100.00	60.00
	TO DISMANTLE & REFIX PETROL TANK.		100.00	60.00
	TO CONDUCT WHEEL ALIGNMENT.	NOT NECESSARY	120.00	-
	TO DISMANTLE & REFIX REAR UNDER CARRIAGE.	NOT NECESSARY	380.00	-
	TO MOUNT VEHICLE ON CAR O-LINER.		380.00	300.00
	TO SPRAY RUST PROOFING.		280.00	150.00
	TO REFILL AIR CON GAS.		120.00	100.00
	LABOUR FOR PANEL BEATING & REPLACED PARTS.INCLUSIVE OF THE REPAIR OF REAR EXHAUST,REAR DOOR N/S AND FRONT FENDERS.		4,800.00	3,000.00
	TO PUTTY & SPRAY PAINTING.		3,000.00	2,000.00
			10,090.00	6,070.00
GRAND TOTAL			63,134.10	31,279.20

Report Ref No. CC6/CTI20012641/Uea3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			25,000.00
---	--	--	------------------

Report Ref No. CC6/CTI20012641/Uea3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLW 3085Y

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

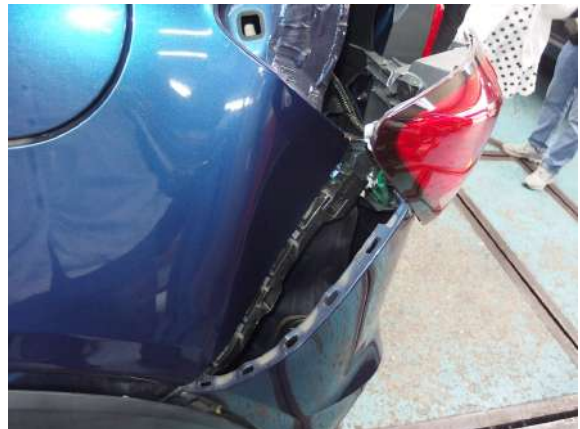




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

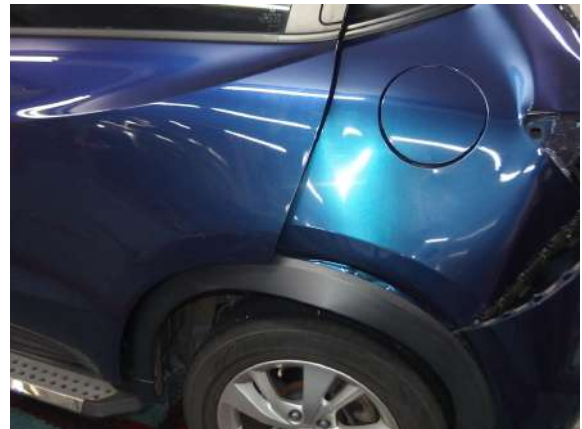



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

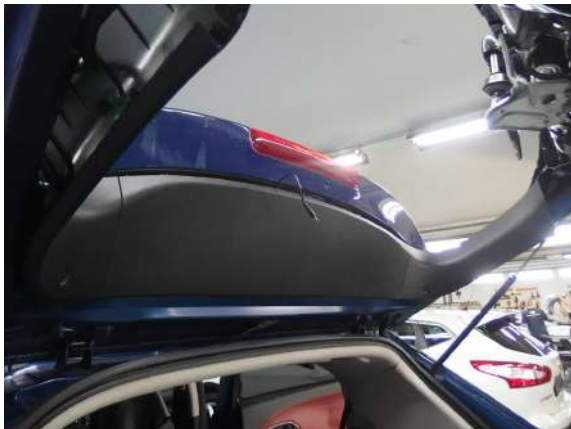




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

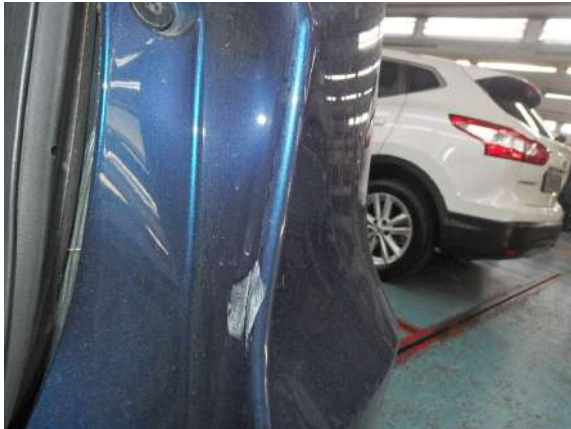



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLW 3085Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

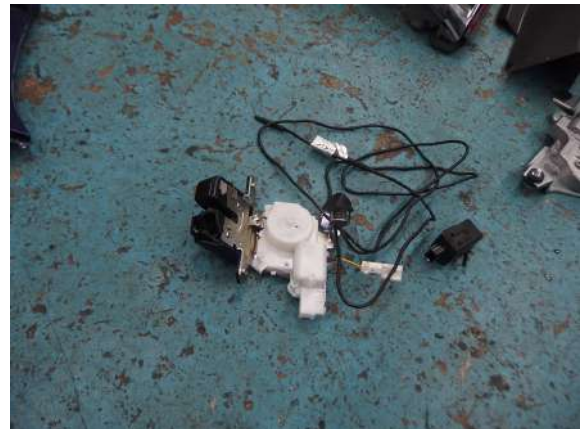



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

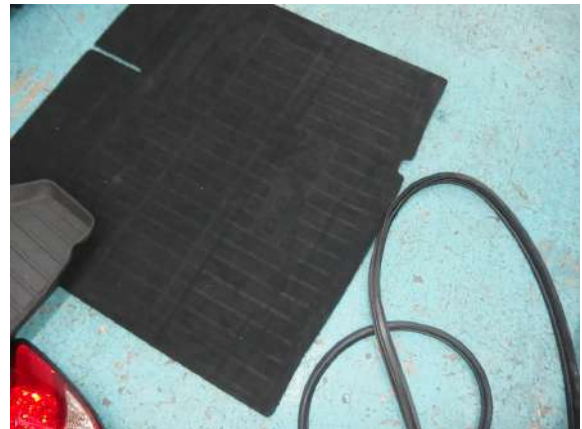



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLW 3085Y

RE-INSPECTION

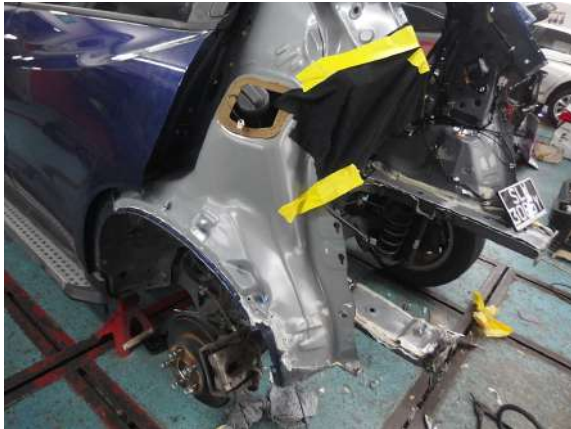



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLW 3085Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

