



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2101762

36 ROBINSON ROAD  
#16-01 CITY HOUSE  
SINGAPORE 068877

INV Date 18/03/2021  
Reference CC6/FCI20012654/Ars3q2  
Code FCI2

### PROFESSIONAL SERVICE FEE

Vehicle No. SLH 1227Y  
Insured Veh. SHC 3788E  
Claim No. D20004672MFSH  
Policy No. D-18088937MFSH  
Accident Date 13/11/2020  
Inspection Date 19/11/2020

| Description                    | Total         |
|--------------------------------|---------------|
| Third Party Express Settlement | 600.00        |
| <b>Subtotal</b>                | <b>600.00</b> |
| <b>GST (7%)</b>                | <b>42.00</b>  |
| <b>Grand Total</b>             | <b>642.00</b> |

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

| Affiliated to Federation Internationale Des Experts En Automobile                                                                      |                                                                                 |                 |                             |  |
|----------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------|-----------------|-----------------------------|--|
| MS FIRST CAPITAL INSURANCE LTD<br>36 ROBINSON ROAD<br>#16-01 CITY HOUSESINGAPORE 068877                                                |                                                                                 |                 | Ref: CC6/FCI20012654/Ars3q2 |  |
|                                                                                                                                        |                                                                                 |                 | Date: 18/03/2021            |  |
|                                                                                                                                        |                                                                                 |                 | Code: FCI2                  |  |
| <b>1. Policy Particulars :- THIRD PARTY CLAIM</b>                                                                                      |                                                                                 |                 |                             |  |
| Insured Veh.                                                                                                                           | SHC 3788E                                                                       | Veh. Inspected  | SLH 1227Y                   |  |
| Policy No.                                                                                                                             | D-18088937MFSH                                                                  | Coverage (\$)   | 0.00                        |  |
| Claim No.                                                                                                                              | D20004672MFSH                                                                   | Excess (\$)     | 0.00                        |  |
| Assign From                                                                                                                            | RACHEL WU                                                                       | Assign Date     | 17/11/2020                  |  |
| <b>2. Vehicle Particulars &amp; Condition</b>                                                                                          |                                                                                 |                 |                             |  |
| Make & Model                                                                                                                           | B.M.W. 523I                                                                     | c.c             | 2497                        |  |
| Engine No.                                                                                                                             | HIDDEN                                                                          | Year of Reg.    | 2010                        |  |
| Chassis No.                                                                                                                            | WBAFP32080C257777                                                               | Colour          | BLACK                       |  |
| Odometer                                                                                                                               | 160749 KM                                                                       | Steering        | IN ORDER                    |  |
| Brakes                                                                                                                                 | IN ORDER                                                                        | Modification    | SPORTS RIM                  |  |
| General                                                                                                                                | GOOD                                                                            |                 |                             |  |
| <b>3. Conditions of Tyres</b>                                                                                                          |                                                                                 |                 |                             |  |
|                                                                                                                                        | Size                                                                            | Make            | Balance                     |  |
| R/H Front Tyre                                                                                                                         | 245/45 R19                                                                      | DUNLOP          | 6 mm                        |  |
| L/H Front Tyre                                                                                                                         | 245/45 R19                                                                      | DUNLOP          | 6 mm                        |  |
| R/H Rear Tyre                                                                                                                          | 245/45 R19                                                                      | DUNLOP          | 6 mm                        |  |
| L/H Rear Tyre                                                                                                                          | 245/45 R19                                                                      | DUNLOP          | 6 mm                        |  |
| <b>4. Description of Damages</b>                                                                                                       |                                                                                 |                 |                             |  |
| THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY.<br><br>DAMAGES SEE DETAILS.                                                             |                                                                                 |                 |                             |  |
| <b>5. General Information</b>                                                                                                          |                                                                                 |                 |                             |  |
| Accident Date                                                                                                                          | 13/11/2020                                                                      | Inspection Date | 19/11/2020                  |  |
| Survey held at                                                                                                                         | MODERN AUTOMOTIVE PTE LTD<br>BLK 3023A UBI ROAD 1<br>#01-61<br>SINGAPORE 408717 |                 |                             |  |
| <b>5a. Remarks</b>                                                                                                                     |                                                                                 |                 |                             |  |
| A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.<br>B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS. |                                                                                 |                 |                             |  |
| <b>5b. Estimate Days of Repair</b>                                                                                                     |                                                                                 |                 |                             |  |
| ESTIMATED NORMAL PERIOD FOR REPAIR:                                                                                                    |                                                                                 |                 | 7 Working Days              |  |



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLH 1227Y

| Qty | Description of Parts               | Condition            | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|------------------------------------|----------------------|---------------------------|-------------------|
|     | <b><u>REPLACEMENT OF PARTS</u></b> |                      |                           |                   |
| 1   | FRONT BUMPER                       | TO REPAIR SEE LABOUR | 1,468.00                  | -                 |
| 1   | FRONT BUMPER SIDE HOLDER -RH       | NOT NECESSARY        | 102.00                    | -                 |
| 1   | FRONT BUMPER LOGO                  | NECESSARY            | 68.00                     | 68.00             |
| 1   | FRONT FENDER -RH                   | DENTED               | 895.00                    | 895.00            |
| 1   | FRONT FENDER OUTER GARNISH -RH     | CUT                  | 48.00                     | 48.00             |
| 1   | FRONT FENDER INNER SHIELD -RH      | DEFORMED             | 192.00                    | 192.00            |
| 1   | FRONT LOWER ARM -RH                | BENT                 | 425.00                    | 425.00            |
| 1   | FRONT CONTROL ARM -RH              | BENT                 | 285.00                    | 285.00            |
| 1   | FRONT UPPER ARM-RH                 | BENT                 | 308.00                    | 308.00            |
| 1   | FRONT KNUCKLE ARM -RH              | DAMAGED              | 822.00                    | 822.00            |
| 1   | FRONT WHEEL HUB C/W BEARING -RH    | DAMAGED              | 452.00                    | 452.00            |
| 1   | FRONT SHOCK ABSORBER -RH           | NOT NECESSARY        | 545.00                    | -                 |
| 1   | FRONT DOOR -RH                     | DENTED               | 1,774.00                  | 1,774.00          |
| 1   | FRONT DOOR LOCK -RH                | NOT NECESSARY        | 546.00                    | -                 |
| 1   | FRONT DOOR WEATHERSTRIPE-RH        | NECESSARY            | 248.00                    | 248.00            |
| 1   | FRONT DOOR WING MIRROR -RH         | NOT NECESSARY        | 873.00                    | -                 |
| 1   | ROCKER PANEL OUTER SKIRTING -RH    | DEFORMED             | 688.00                    | 688.00            |
| 1   | REAR DOOR -RH                      | DENTED               | 1,688.00                  | 1,688.00          |
| 1   | REAR DOOR LOCK -RH                 | NOT NECESSARY        | 495.00                    | -                 |
| 1   | REAR DOOR WEATHERSTRIPE-RH         | NECESSARY            | 235.00                    | 235.00            |
| 1   | REAR LOWER ARM -RH                 | BENT                 | 615.00                    | 615.00            |
| 1   | REAR CONTROL ARM -RH               | BENT                 | 285.00                    | 285.00            |
| 1   | REAR KNUCKLE ARM -RH               | NOT NECESSARY        | 989.00                    | -                 |
| 1   | REAR WHEEL HUB C/W BEARING -RH     | NECESSARY            | 580.00                    | 580.00            |
| 1   | REAR SHOCK ABSORBER -RH            | NOT NECESSARY        | 522.00                    | -                 |
|     | LESS 5% DISCOUNT                   |                      | -757.40                   | -480.40           |
|     |                                    |                      | 14,390.60                 | 9,127.60          |
| 1   | FRONT WHEEL RIM -RH (SN)           | CUT                  | 1,250.00                  | 850.00            |
| 1   | REAR WHEEL RIM -RH (SN)            | CUT                  | 1,250.00                  | 850.00            |

Report Ref No. CC6/FCI20012654/Ars3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

| Qty                                                                         | Description of Parts                                                                                | Condition     | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------|---------------|---------------------------|-------------------|
|                                                                             | LESS 5% DISCOUNT                                                                                    |               | -125.00                   | -                 |
|                                                                             |                                                                                                     |               | 2,375.00                  | 1,700.00          |
|                                                                             | <b><u>SPECIAL NETT ITEMS</u></b>                                                                    |               |                           |                   |
| 1                                                                           | SET FRONT BUMPER CLIPS (SN)                                                                         | NOT NECESSARY | 50.00                     | -                 |
| 1                                                                           | SET FRONT FENDER INNER SHIELD CLIPS -RH (SN)                                                        | NECESSARY     | 30.00                     | 30.00             |
| 1                                                                           | SET FRONT DOOR BLACK TAPE-RH (SN)                                                                   | NECESSARY     | 80.00                     | 80.00             |
| 1                                                                           | SET ROCKER PANEL OUTER SKIRTING CLIPS-RH (SN)                                                       | NECESSARY     | 50.00                     | 50.00             |
| 1                                                                           | SET REAR DOOR BLACK TAPE-RH (SN)                                                                    | NECESSARY     | 80.00                     | 80.00             |
|                                                                             |                                                                                                     |               | 290.00                    | 240.00            |
|                                                                             | <b><u>LABOUR</u></b>                                                                                |               |                           |                   |
|                                                                             | TO KNOCKING & PULL OUT RH SIDE PORTION & RENEW ABOVE PARTS.INCLUSIVE OF THE REPAIR OF FRONT BUMPER. |               | 1,400.00                  | 900.00            |
|                                                                             | TO PUTTY & SPRAY UP PAINT WORKS.                                                                    |               | 1,500.00                  | 1,200.00          |
|                                                                             | TO CHECK WIRING .                                                                                   |               | 100.00                    | 30.00             |
|                                                                             | TO SPRAY TUFF COAT.                                                                                 |               | 150.00                    | 80.00             |
|                                                                             | TO TRANSFER FRONT DOOR FITTINGS.                                                                    |               | 150.00                    | 80.00             |
|                                                                             | TO TRANSFER REAR DOOR FITTINGS.                                                                     |               | 150.00                    | 80.00             |
|                                                                             | TO DISMANTLE FRONT UNDERCARRIAGE.                                                                   |               | 350.00                    | 220.00            |
|                                                                             | TO DISMANTLE REAR UNDERCARRIAGE.                                                                    |               | 350.00                    | 180.00            |
|                                                                             | TO PERFORM WHEEL ALIGNMENT.                                                                         |               | 150.00                    | 80.00             |
|                                                                             |                                                                                                     |               | 4,300.00                  | 2,850.00          |
| <b>GRAND TOTAL</b>                                                          |                                                                                                     |               | <b>21,355.60</b>          | <b>13,917.60</b>  |
| <b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b> |                                                                                                     |               |                           | <b>11,100.00</b>  |

Report Ref No. CC6/FCI20012654/Ars3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### PHOTOGRAPHS FOR VEHICLE NO. SLH 1227Y

### INSPECTION








## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

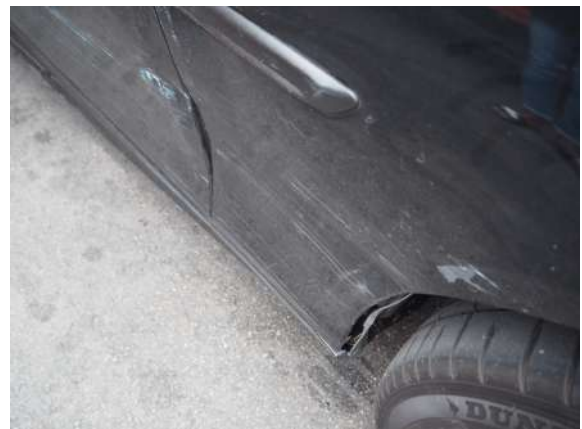



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLH 1227Y

RE-INSPECTION







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

