



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2105351

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 01/08/2021
Reference CC6/CTI20012696/Drs3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SH 9787L
Insured Veh. SKG 7263U
Claim No. SNM20D204433/LKKDS
Policy No. DMPCSNW00115372000
Accident Date 17/11/2020
Inspection Date 19/11/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI20012696/Drs3q2	
			Date: 01/08/2021	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SKG 7263U	Veh. Inspected	SH 9787L	
Policy No.	DMPCSNW00115372000	Coverage (\$)	0.00	
Claim No.	SNM20D204433/LKKDS	Excess (\$)	0.00	
Assign From		Assign Date	19/11/2020	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI IONIQ	c.c	1580	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	KMHC851CVLU188593	Colour	BLUE	
Odometer	97959 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	DURATURN	5 mm	
L/H Front Tyre	195/65 R15	DURATURN	5 mm	
R/H Rear Tyre	195/65 R15	DURATURN	5 mm	
L/H Rear Tyre	195/65 R15	DURATURN	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	17/11/2020	Inspection Date	19/11/2020	
Survey held at	BIFROST AUTO PTE LTD 8 KAKI BUKIT AVENUE 4 #01-49 PREMIER @ KAKI BUKIT SINGAPORE 415875			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SH 9787L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BONNET	BENT	2,253.80	2,253.80
2	BONNET HINGE (LH/RH) @\$118.70	TO REPAIR SEE LABOUR	237.40	-
1	BONNET INSULATOR	NOT NECESSARY	230.10	-
1	BONNET INSULATOR CLIPS	NOT NECESSARY	15.00	-
1	RADIATOR GRILLE NEW MODEL	MTG CRACKED	1,568.60	1,568.60
2	FLAP ASSY ACTIVE AIR UPPER (LH/RH) @\$824.60	BROKEN	1,649.20	1,649.20
1	FRONT BUMPER COVER	TORN	418.30	418.30
1	FRONT BUMPER TOP COVER	NOT NECESSARY	476.30	-
1	FRONT BUMPER SPONGE	TORN	186.90	186.90
1	FRONT BUMPER REINFORCEMENT	DENTED	1,075.10	1,075.10
2	FRONT BUMPER REINFORCEMENT ABSORBER (LH/RH) @\$186.0	NOT NECESSARY	373.00	-
1	FRONT BUMPER TOWING COVER	NOT NECESSARY	29.00	-
1	FRONT BUMPER MOULDING CENTRE UPPER	CUT	368.50	368.50
1	FRONT BUMPER LOWER STIFFNER	CUT / BENT	285.10	285.10
1	FRONT BUMPER LOWER GRILLE	DENTED	365.30	365.30
1	FRONT BUMPER LOWER GRILLE MOULDING	DENTED	127.60	127.60
1	FRONT BUMPER LIP	NOT NECESSARY	35.10	-
2	FRONT BUMPER BRACKET TOP (LH/RH) @\$35.00	NOT NECESSARY	70.00	-
2	FRONT BUMPER BRACKET (LH/RH) @\$28.00	N/S BROKEN / O/S NOT NECESSARY	56.00	28.00
2	FRONT BUMPER RETAINER MOUNTING (LH/RH) @\$65.30	NOT NECESSARY	130.60	-
10	FRONT BUMPER CLIPS	NECESSARY	25.00	25.00
1	FRONT BUMPER GRILLE (LH)	CUT	186.90	186.90
1	FRONT BUMPER AIR DUCT (LH)	NOT NECESSARY	153.80	-
1	DAY LIGHT ,LH	MTG BROKEN	642.50	642.50
1	DAY LIGHT WIRE,LH	NOT NECESSARY	585.50	-
1	BUZZER ASSY -PIEZO (LH)	NOT NECESSARY	388.00	-
1	HEADLAMP SUPPORT PANEL ASSY	CRACKED	949.30	949.30
1	HEADLAMP (LH)	BROKEN	3,987.30	1,993.65
1	RADIATOR	NOT NECESSARY	710.50	-

Report Ref No. CC6/CTI20012696/Drs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	COOLANT	NOT NECESSARY	45.00	-
1	FRT PILLAR UPPER COVER -OUTER (LH)	SERVICEABLE	89.60	-
1	FRONT FENDER (LH)	DENTED	490.70	490.70
1	FRONT FENDER APRON PANEL (LH)	NOT NECESSARY	756.20	-
1	FRONT FENDER APRON PANEL UPPER (LH)	NOT NECESSARY	229.60	-
1	FRONT FENDER SHIELD (LH)	DISLODGE	164.70	164.70
1	AIRCON CONDENSER	NOT NECESSARY	663.60	-
1	FRONT WHEEL RIM (LH)	NOT NECESSARY	1,124.20	-
1	FRONT WHEEL BEARING AND HUB ASSY (LH)	DAMAGED	678.50	678.50
1	FRONT WHEEL HUB CAP	CUT	289.80	289.80
1	FRONT SHOCK ABSORBER (ASSY) (LH)	DISTORTED	372.50	372.50
1	FRONT SHOCK ABSORBER MOUNTING (LH)	NOT NECESSARY	206.90	-
1	FRONT DRIVE SHAFT (LH)	NOT NECESSARY	1,136.70	-
1	FRONT DRIVE SHAFT EXTENSION (LH)	NOT NECESSARY	1,125.80	-
1	RACK & PINION ASSY	NOT NECESSARY	1,087.40	-
1	STG TIE ROD	NOT NECESSARY	125.60	-
1	STG TIE END	NOT NECESSARY	94.70	-
1	STABILIZER BAR	NOT NECESSARY	326.80	-
1	STABILIZER BAR LINK	NOT NECESSARY	92.10	-
1	FRONT SUSPENSION LOWER ARM (LH)	DISTORTED	596.80	596.80
1	KNUCKLE ARM (LH)	DISTORTED	663.60	663.60
1	ABS SENSOR	NOT NECESSARY	290.00	-
1	HEADLAMP (RH) (ADDITIONAL)	CRACKED	3,987.30	1,993.65
	LESS 20% DISCOUNT		-6,443.56	-3,474.80
			25,774.24	13,899.20
	<u>NETT ITEMS</u>			
1	EMBLEM -BLUE DRIVE (LH) (N)	NECESSARY	26.60	26.60
	LESS 20% DISCOUNT		-	-5.32
			26.60	21.28
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT TYRE (LH) (SN)	NOT NECESSARY	216.00	-
			216.00	-

Report Ref No. CC6/CTI20012696/Drs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF BONNET HINGE (LH/RH).		1,600.00	700.00
	SPRAY PAINTING CHARGE.		1,400.00	600.00
	WIRING CHARGE.		180.00	30.00
	TUFF KOTE.		160.00	40.00
	TOWING CHARGE.	NOT NECESSARY	80.00	-
	FOUR WHEEL ALIGNMENT .		120.00	60.00
	REMOVE/REFIX UNDERCARRIAGE (FRT).		400.00	150.00
	RE-SET FRT ABS SYSTEM.	NOT NECESSARY	200.00	-
	REMOVE/REFIX RADIATOR .	NOT NECESSARY	90.00	-
	REMOVE/REFIX AIRCON & REFILL GAS.	NOT NECESSARY	130.00	-
	REMOVE/REFIX FUSE BOX.	NOT NECESSARY	120.00	-
	DIAGNOSTIC & RESETTING TO ERASE FAULT CODE.		550.00	150.00
			5,030.00	1,730.00
	GRAND TOTAL		31,046.84	15,650.48
RECOMMENDED COST OF REPAIRS				15,650.48

Report Ref No. CC6/CTI20012696/Drs3q2

ANG BRYAN TANI

Automotive Assessor / Investigator

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SH 9787L

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

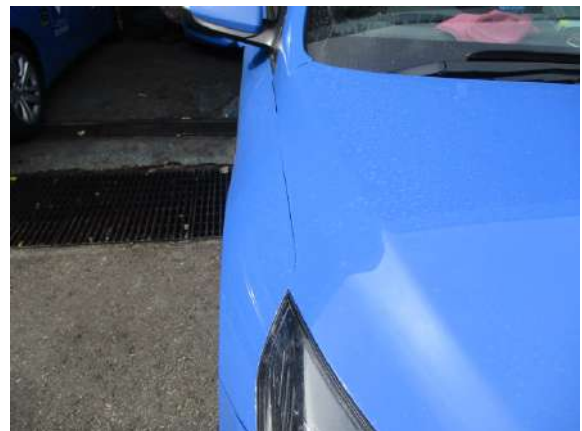



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SH 9787L

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SH 9787L

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

