



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

LONPAC INSURANCE BHD  
300 BEACH ROAD  
#17-04/07 THE CONCOURSE  
SINGAPORE 199555

INV No. AC2202525  
INV Date 05/05/2022  
Reference CC4/LPC20012713/Eea3q2  
Code LPC2

#### PROFESSIONAL SERVICE FEE

Vehicle No. SLW 6968E  
Insured Veh. XD 9748L  
Claim No. 20/20/20/VC00/023915  
Policy No. Z/20/VC00/108942  
Accident Date 14/11/2020  
Inspection Date 18/11/2020

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (7%)</b>	<b>28.00</b>
<b>Grand Total</b>	<b>428.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## Affiliated to Federation Internationale Des Experts En Automobile

LONPAC INSURANCE BHD

300 BEACH ROAD

#17-04/07 THE CONCOURSESINGAPORE 199555

Ref: CC4/LPC20012713/Eea3q2

Date: 05/05/2022

Code: LPC2

### 1. Policy Particulars :- THIRD PARTY CLAIM

<b>Insured Veh.</b>	XD 9748L	<b>Veh. Inspected</b>	SLW 6968E
<b>Policy No.</b>	Z/20/VC00/108942	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	20/20/20/VC00/023915	<b>Excess (\$)</b>	0.00
<b>Assign From</b>	GERALD	<b>Assign Date</b>	18/11/2020

### 2. Vehicle Particulars & Condition

<b>Make &amp; Model</b>	B.M.W. 420I	<b>c.c</b>	1997
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2015
<b>Chassis No.</b>	WBA4A12060GK07756	<b>Colour</b>	WHITE
<b>Odometer</b>	76535 KM	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	SPORTS RIM
<b>General</b>	FAIR		

### 3. Conditions of Tyres

	Size	Make	Balance
<b>R/H Front Tyre</b>	275/30 R19	PIRELLI	5 mm
<b>L/H Front Tyre</b>	275/30 R19	PIRELLI	5 mm
<b>R/H Rear Tyre</b>	275/30 R19	PIRELLI	5 mm
<b>L/H Rear Tyre</b>	275/30 R19	PIRELLI	5 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S & FRONT N/S PORTION.  
DAMAGES SEE DETAILS.

### 5. General Information

<b>Accident Date</b>	14/11/2020	<b>Inspection Date</b>	18/11/2020
<b>Survey held at</b>	GLOCKEWERKE 21 KAKI BUKIT ROAD 4 #01-02 SYNERGY @ KB SINGAPORE 417810		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.  
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **8 Working Days**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLW 6968E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	REAR RIGHT SIDE PANEL (FENDER)	DENTED	3,200.00	1,643.30
1	REAR RIGHT FENDER LINING	DEFORMED	253.00	253.00
1	REAR RIGHT DOOR	DENTED	2,400.00	1,273.85
1	REAR RIGHT DOOR ACTUATOR (LOCK)	JAMMED	418.00	418.00
1	REAR RIGHT DOOR WINDOW LIFTER	NOT NECESSARY	693.00	-
1	REAR RIGHT DOOR WINDOW MOTOR	NOT NECESSARY	506.00	-
1	REAR RIGHT RIM	CUT	850.00	800.00
1	RIGHT SIDE SKIRT	TO REPAIR SEE LABOUR	528.00	-
1	REAR RIGHT LOWER ARM (WISHBONE)	NOT NECESSARY	319.00	-
1	REAR RIGHT CONTROL ARM	NOT NECESSARY	280.00	-
1	REAR RIGHT WHEEL BEARING	NECESSARY	154.00	154.00
1	REAR DRIVESHAFT	NOT NECESSARY	3,200.00	-
1	RR ABSORBER WITH SPRING AND RUBBER	NOT NECESSARY	980.00	-
1	REAR RIGHT KNUCKLE	BENT	363.00	363.00
1	FRONT BUMPER	TO REPAIR SEE LABOUR	1,500.00	-
1	FRONT LEFT FENDER	DENTED	780.00	780.00
1	FRONT LEFT FENDER LINING	NOT NECESSARY	187.00	-
1	FRONT LEFT RIM	NOT NECESSARY	850.00	-
1	LEFT SIDE SKIRT	NOT NECESSARY	480.00	-
	LESS 10% DISCOUNT		-1,794.10	-568.52
			16,146.90	5,116.63
<b><u>SPECIAL NETT ITEMS</u></b>				
1	FRONT BUMPER CLIP (S) (SN)	NECESSARY	30.00	30.00
1	REAR RIGHT TYRE (275/30R19) (\$350.00) (70%) (SN)	TORN	350.00	245.00
			380.00	275.00
<b><u>LABOUR</u></b>				
	DIAGNOSE ,REPLACE AND REPAIR TO RECTIFY ELECTRICAL SYSTEM FOR PROPER FUNCTION .		120.00	80.00



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CHECK FAULT ,ERASE FAULT AND FACTORY REST FUNCTIONS.	NOT NECESSARY	120.00	-
	TO PERFORM WHEEL ALIGNMENT.		120.00	60.00
	TO PROVIDE WORKMANSHIP LABOUR TO REMOVE DAMAGE PARTS FOR ASSESSMENT AN TO NEW BODYPARTS ,REPAIR ,RE-CONSTRUCT AND RE-ADJUST STRUCTURE ,BODY ALIGNMENTS AND DAMAGED CONSISTENT FROM THE ACCIDENT.INCLUSIVE OF THE REPAIR OF RIGHT SIDE SKIRT AND FRONT BUMPER .		1,200.00	1,000.00
	TO RE-SPRAY PAINTING FOR CHARGE BODYPARTS ,REPAIR PORTION AND WHERE CONSISTENT FROM THE ACCIDENT.		1,200.00	1,000.00
			2,760.00	2,140.00
<b>GRAND TOTAL</b>			<b>19,286.90</b>	<b>7,531.63</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>6,050.00</b>

Report Ref No. CC4/LPC20012713/Eea3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SLW 6968E

## INSPECTION



Made in Germany 420 A96	<b>BAYERISCHE MOTOREN WERKE AG</b> e1*2007/46*0316 WBA4A12060GK07756 2065 kg 3640 kg 1- 920 kg 2- 1195 kg
----------------------------------	---




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

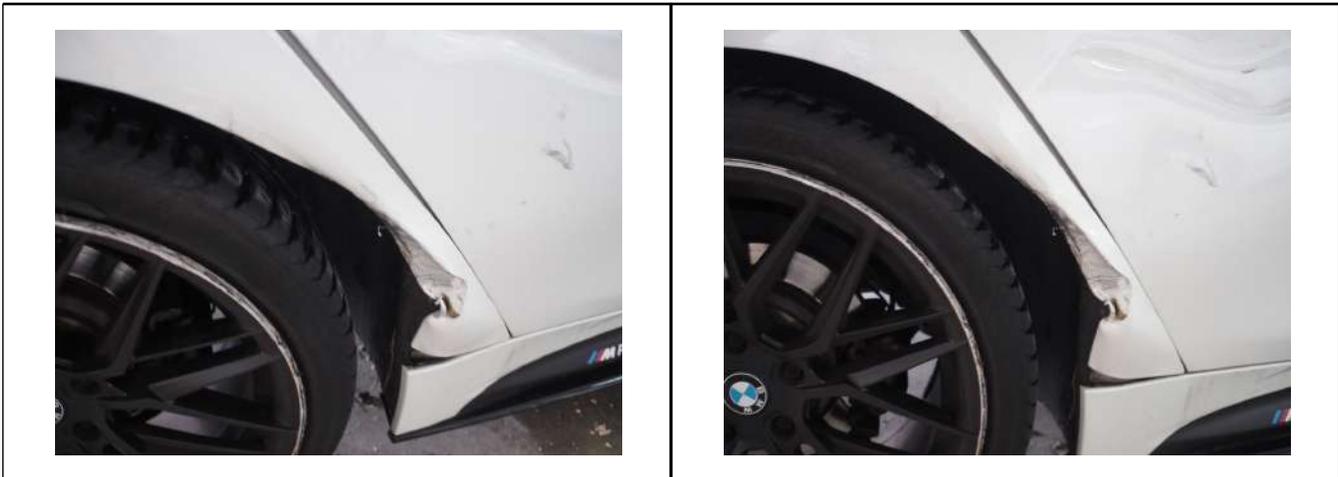



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

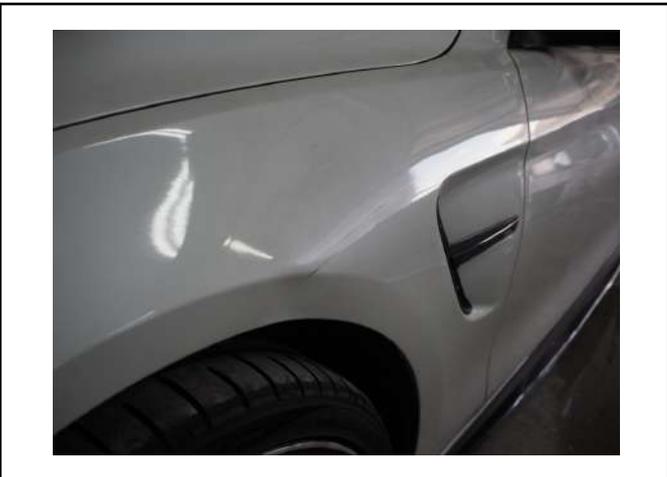




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

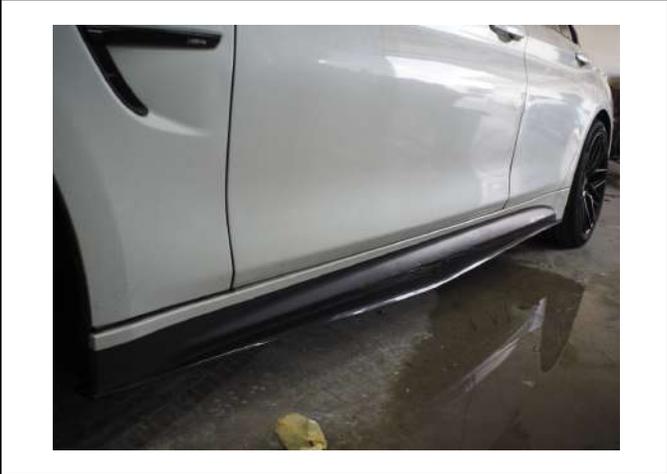





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

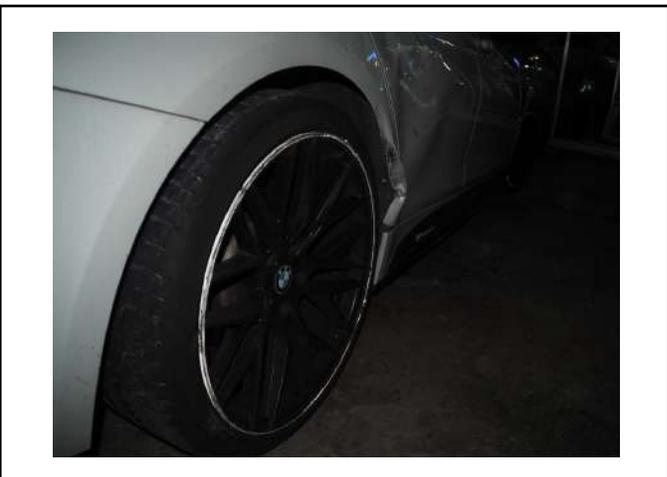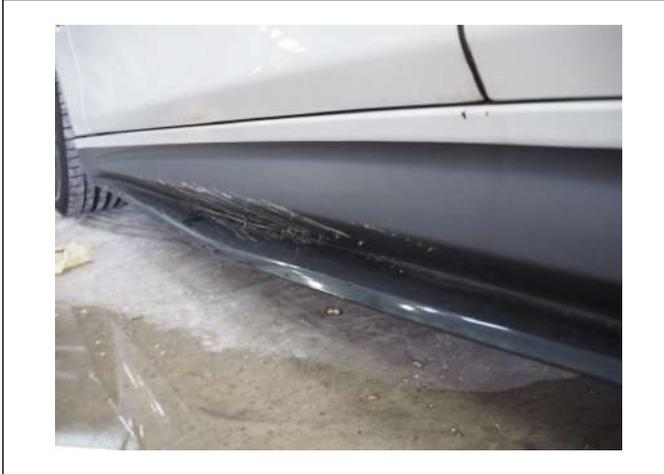





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

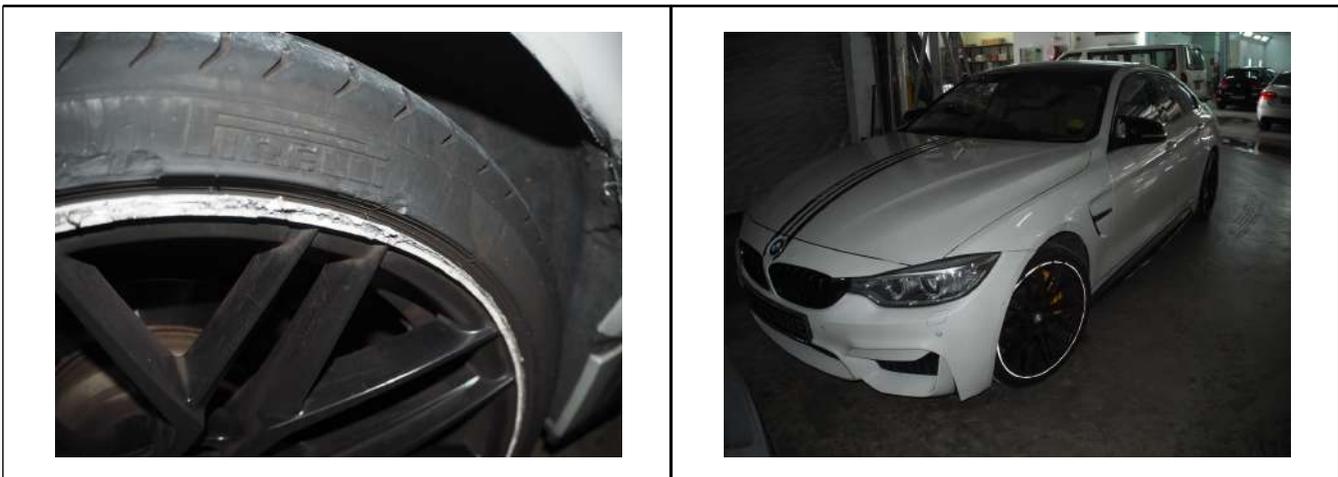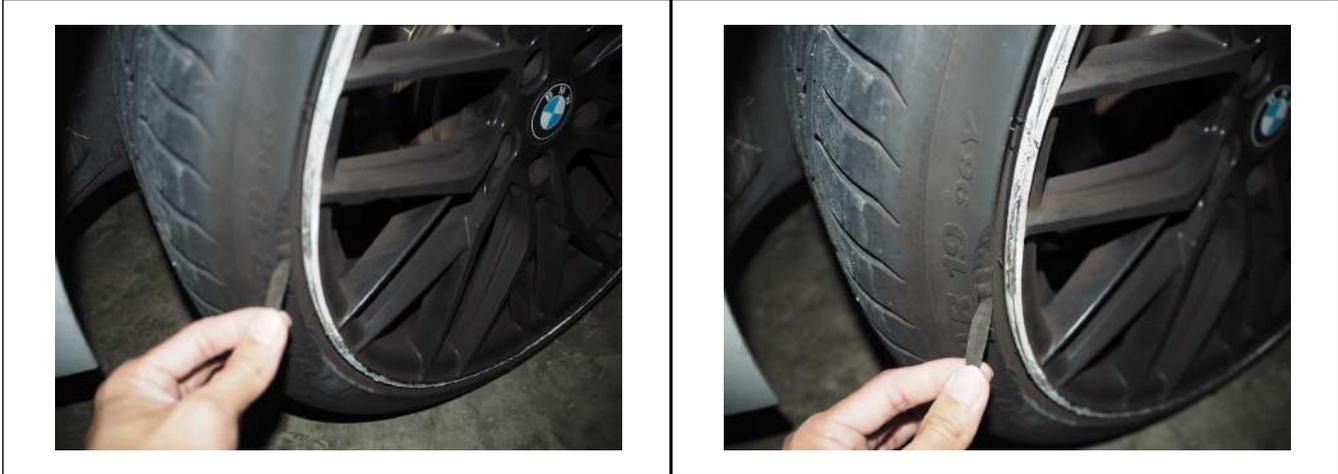



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLW 6968E

RE-INSPECTION

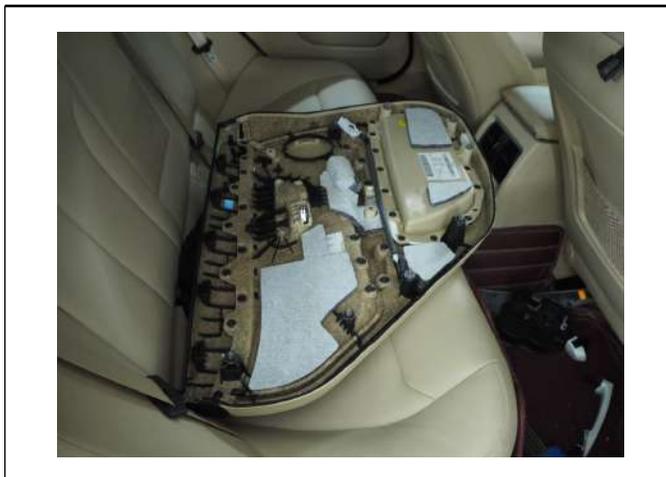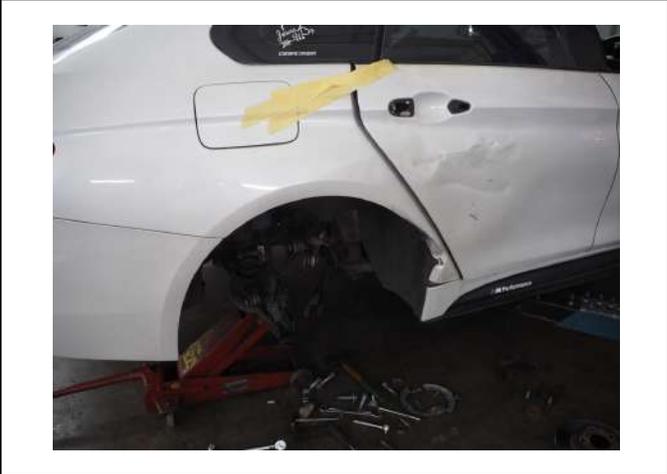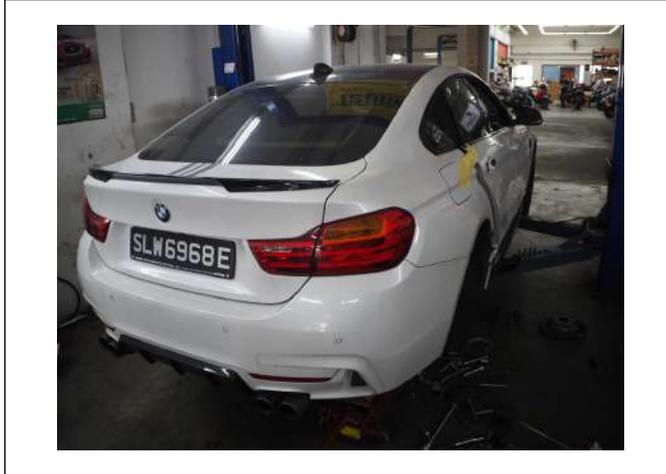



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLW 6968E

RE-INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

