



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2103977

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 08/06/2021
Reference CC4/FCI20012888/T1ra3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SMS 6689U
Insured Veh. SHB 4829U
Claim No. D20004762MFSH
Policy No. D-20094921MFSH
Accident Date 19/11/2020
Inspection Date 24/11/2020

Description	Total
Third Party Express Settlement	350.00
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSESINGAPORE 068877

Ref: CC4/FCI20012888/T1ra3q2

Date: 08/06/2021

Code: FCI2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHB 4829U	Veh. Inspected	SMS 6689U
Policy No.	D-20094921MFSH	Coverage (\$)	0.00
Claim No.	D20004762MFSH	Excess (\$)	0.00
Assign From	ERIC WOO	Assign Date	23/11/2020

2. Vehicle Particulars & Condition

Make & Model	SUBARU FORESTER 2.0	c.c	1995
Engine No.	HIDDEN	Year of Reg.	2020
Chassis No.	JF1SK7KL5KG018923	Colour	SILVER
Odometer	3058 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	225/55 R16	BRIDGESTONE	7 mm
L/H Front Tyre	225/55 R16	BRIDGESTONE	7 mm
R/H Rear Tyre	225/55 R16	BRIDGESTONE	7 mm
L/H Rear Tyre	225/55 R16	BRIDGESTONE	7 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	19/11/2020	Inspection Date	24/11/2020
Survey held at	EM-1 AUTO PTE LTD BLK 8 SIN MING INDUSTRIAL ESTATE SECTOR C #01-68 SINGAPORE 575643		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **8 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMS 6689U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	TAILGATE BADGE	NOT NECESSARY	82.50	-
1	TAILGATE EMBLEM (SUBARU)	NECESSARY	72.00	72.00
1	TAILGATE EMBLEM (AXA)	NECESSARY	68.00	68.00
1	TAILGATE EMBLEM (FORRESTER)	NECESSARY	72.00	72.00
1	TAILGATE EMBLEM (GT)	NECESSARY	68.00	68.00
1	TAILGATE EMBLEM (EYESIGHT)	NECESSARY	72.00	72.00
1	TAILGATE WEATHERSTRIP	TWISTED	192.20	192.20
1	REAR BUMPER	DEFORMED	690.20	690.20
1	REAR BUMPER TOW COVER	MISSING	29.00	29.00
2	REAR BUMPER SIDE RETAINERS @\$39.00	N/S DEFORMED / O/S NOT NECESSARY	78.00	39.00
2	REAR BUMPER ATTACHMENT RETAINERS @\$42.00	N/S DEFORMED / O/S NOT NECESSARY	84.00	42.00
1	SET REAR BUMPER CLIPS	NECESSARY	40.00	30.00
1	REAR BUMPER REINFORCEMENT	BENT	295.00	295.00
2	REAR BUMPER REFLECTOR @\$95.00	N/S CRACKED / O/S NOT NECESSARY	190.00	95.00
1	REAR BUMPER LOWER SKIRT	CRACKED	386.20	386.20
1	REAR BUMPER LOWER SPOILER	CRACKED	1,280.00	880.00
1	END PANEL	BENT	521.50	521.50
1	END PANEL TOP TRIM	DEFORMED	126.20	126.20
1	SET END PANEL TOP TRIM CLIPS	NECESSARY	30.00	20.00
1	SPARE TYRE PANEL	TO REPAIR SEE LABOUR	792.50	-
1	SPARE TYRE PANEL TOP SPONGE	NOT NECESSARY	369.50	-
1	SPARE TYRE WHEEL NUT	BENT	39.20	39.20
1	SPARE TYRE WHEEL JACK SPONGE	CRACKED	162.50	162.50
	LESS 20% DISCOUNT		-1,148.10	-780.00
			4,592.40	3,120.00

Report Ref No. CC4/FCI20012888/T1ra3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
SPECIAL NETT ITEMS				
1	SET BODY PANEL JOINT SEALER (SN)	NECESSARY	120.00	40.00
1	SET REVERSE SENSOR (SN)	NOT WORKING	250.00	200.00
1	REAR EXHAUST CHROME PIPE (SN)	CUT	140.00	140.00
1	REAR NUMBE PLATE WITH HOLDER (SN)	NOT NECESSARY	50.00	-
			560.00	380.00
LABOUR				
	PANEL BEATING .INCLUSIVE OF THE REPAIR OF SPARE TYRE PANEL .		1,600.00	1,200.00
	SPRAY PAINTING (PEARL).		1,200.00	1,000.00
	CHECK WIRING .		40.00	30.00
	ANTI RUST .		90.00	30.00
	REMOVE AND INSTALL REVERSE SENSOR .		90.00	30.00
	REMOVE AND INSTALL CARPET AND SEAT .		120.00	60.00
			3,140.00	2,350.00
GRAND TOTAL			8,292.40	5,850.00
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,700.00

Report Ref No. CC4/FCI20012888/T1ra3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMS 6689U

INSPECTION

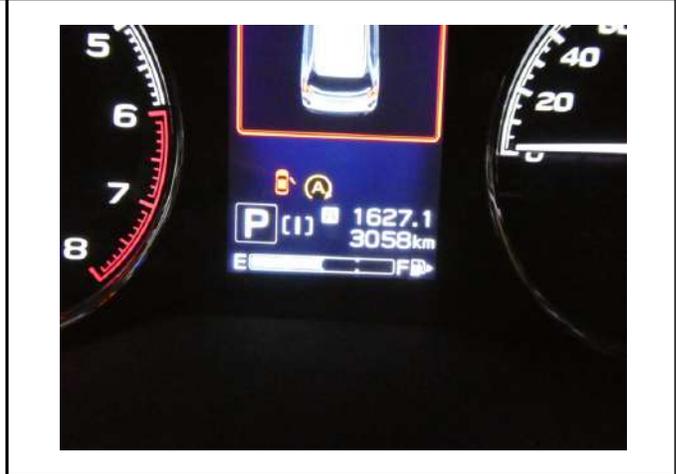



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

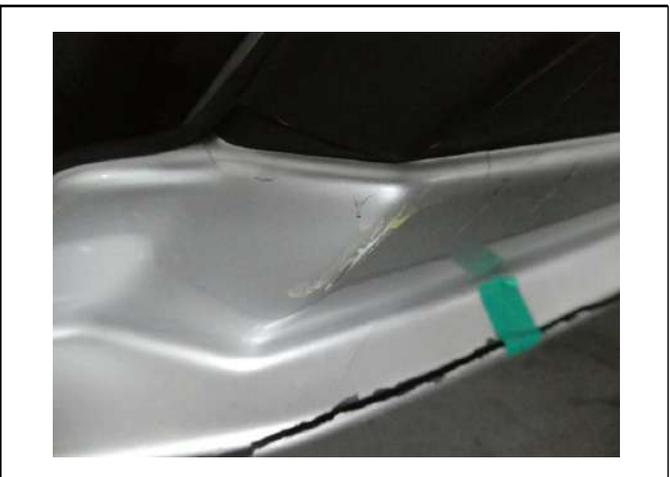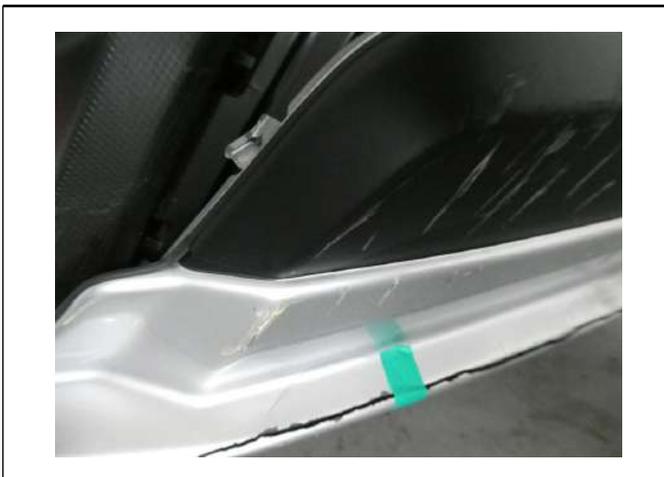



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

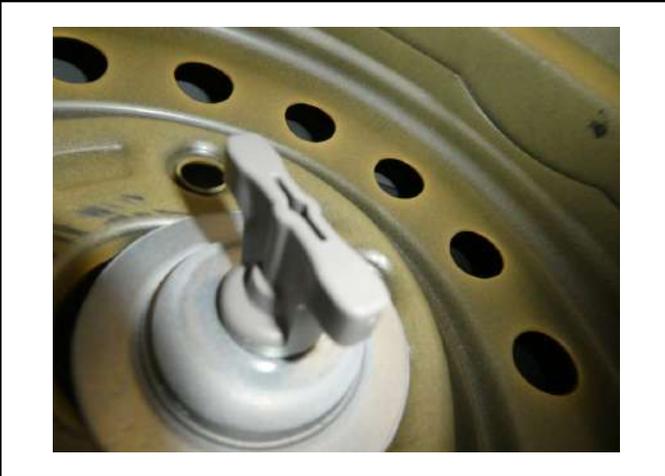



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

