



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2104751

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 06/07/2021
Reference CC4/FCI20012918/T1es3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SJG 6383A
Insured Veh. SH 8698S
Claim No. D20004792MFSH
Policy No. D-20094922MFSH
Accident Date 20/11/2020
Inspection Date 24/11/2020

Description	Total
Third Party Express Settlement	500.00
Subtotal	500.00
GST (7%)	35.00
Grand Total	535.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20012918/T1es3q2	
			Date: 06/07/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SH 8698S	Veh. Inspected	SJG 6383A	
Policy No.	D-20094922MFSH	Coverage (\$)	0.00	
Claim No.	D20004792MFSH	Excess (\$)	0.00	
Assign From	VIC	Assign Date	24/11/2020	
2. Vehicle Particulars & Condition				
Make & Model	HONDA SHUTTLE	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	GK81201726	Colour	WHITE	
Odometer	49556 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	185/60 R15	YOKOHAMA	6 mm	
L/H Front Tyre	185/60 R15	YOKOHAMA	6 mm	
R/H Rear Tyre	185/60 R15	YOKOHAMA	6 mm	
L/H Rear Tyre	185/60 R15	YOKOHAMA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	20/11/2020	Inspection Date	24/11/2020	
Survey held at	WAH HONG MOTORS & CREDIT PTE LTD 38 TOH GUAN ROAD EAST #01-57 ENTERPRISE HUB SINGAPORE 608581			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJG 6383A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BOOT LID	BENT	1,193.00	1,193.00
2	REAR BOOT LID HINGE LH /RH @\$50.00	TO REPAIR SEE LABOUR	100.00	-
2	REAR BOOT LID DAMPER RH/LH @\$164.00	TO REPAIR SEE LABOUR	328.00	-
1	REAR BOOT LID TRIM BOARD	DEFORMED	320.00	320.00
1	REAR BOOT LID INNER HANDLE GARNISH	DEFORMED	25.00	25.00
1	REAR BOOT LID CENTER OUTER CHROME	CRACKED	384.00	384.00
1	REAR BOOT LID LOGO BADGE	NECESSARY	38.00	38.00
1	REAR BOOT LID LOCK	BENT	158.00	158.00
1	REAR WINDSCREEN MOULDING	NECESSARY	120.00	120.00
2	REAR BOOT LID LAMP LH/RH @\$395.00	N/S NOT NECESSARY / O/S CRACKED	790.00	395.00
2	REAR TAIL LAMP RH/LH @\$521.00	CUT	1,042.00	1,042.00
1	REAR BUMPER	DEFORMED	1,151.00	1,151.00
2	REAR BUMPER SIDE RETAINER RH/LH @\$27.00	DEFORMED	54.00	54.00
1	REAR BUMPER SPONGE	DEFORMED	57.00	57.00
1	REAR END PANEL	BENT	561.00	561.00
1	REAR END PANEL TOP GARNISH	CRACKED	156.00	156.00
1	REAR BOOT LID WEATHERSTRIP	TWISTED	169.00	169.00
2	REAR FENDER INNER TRIM GARNISH RH/LH @\$490.00	N/S DEFORMED / O/S NOT NECESSARY	980.00	490.00
1	REAR TRUNK STORAGE COMPARTMENT	CRACKED	245.00	245.00
1	REAR TRUNK TOP COVER	DEFORMED	350.00	350.00
1	REAR TRUNK FLOOR PANEL	TO REPAIR SEE LABOUR	1,980.00	-
1	REAR BUMPER TOWING COVER	DEFORMED	17.00	17.00
1	REAR BUMPER SIDE REFLECTOR COVER LH	CUT	45.00	45.00
	LESS 20% DISCOUNT		-2,052.60	-1,394.00
			8,210.40	5,576.00

Report Ref No. CC4/FCI20012918/T1es3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	REAR BUMPER CLIPS (SN)	NECESSARY	35.00	30.00
1	WINDSCREEN SEALANT (SN)	NECESSARY	80.00	60.00
1	FLOOR PANEL AND END PANEL SEALANT (SN)	NECESSARY	100.00	40.00
1	CAR PLATE WITH HOLDER (SN)	CRACKED	35.00	35.00
1	SET REAR REVERSE SENSOR (SN)	NOT WORKING	200.00	200.00
			450.00	365.00
	<u>LABOUR</u>			
	TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS, PANEL BEAT & RESHAPE THE AFFECTED AREAS AND REPLACE THE DAMAGED PARTS AND COMPONENTS .INCLUSIVE OF THE REPAIR OF REAR BOOT LID HINGE LH /RH,REAR BOOT LID DAMPER RH/LH AND REAR TRUNK FLOOR PANEL .		1,600.00	1,000.00
	TO SUPPLY PAINT MATERIALS ,EXPANDABLE ITEMS & PUTY,RESPRAY PAINT ON PARTS REPLACED & REPAIRED .		1,200.00	900.00
	TO REMOVE AND REFIX REAR WINDSCREEN .		150.00	120.00
	TO REMOVE AND REFIX WIRING SYSTEM AT ACCIDENT DAMAGED AREA AND CHECK ALL ELECTRICAL & COMPONENT FOR PROPER FUNCTION .		120.00	30.00
	TO PERFORM ANTI-RUST TREATMENT ON AFFECTED AREAS.		120.00	40.00
	TO REMOVE AND REFIT /REPLACE REVERSE SENSOR .		120.00	30.00
	TO REMOVE AND REFIT /REPLACE REAR BOOT LID & REAR TRUNK BOTH SIDE FITTING ,TRIMMINGS ,GARNISH AND ETC.		200.00	60.00
			3,510.00	2,180.00
GRAND TOTAL			12,170.40	8,121.00
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,500.00

Report Ref No. CC4/FCI20012918/T1es3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJG 6383A

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

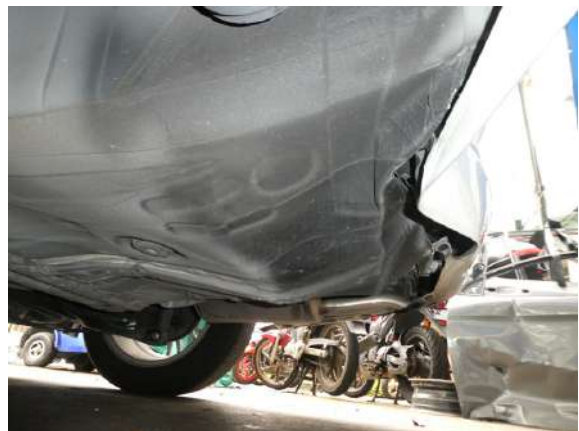



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJG 6383A

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

