



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2103296

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 11/05/2021
Reference CC4/FCI20013312/R1ea3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. GBD 6515Y
Insured Veh. SH 7519H
Claim No. D20004916MFSH
Policy No. D-20094922MFSH
Accident Date 01/12/2020
Inspection Date 07/12/2020

Description	Total
Third Party Express Settlement	350.00
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20013312/R1ea3q2	
			Date: 11/05/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SH 7519H	Veh. Inspected	GBD 6515Y	
Policy No.	D-20094922MFSH	Coverage (\$)	0.00	
Claim No.	D20004916MFSH	Excess (\$)	0.00	
Assign From	CHRIS LIM	Assign Date	03/12/2020	
2. Vehicle Particulars & Condition				
Make & Model	NISSAN NV350 PANEL VAN 2.5	c.c	2488	
Engine No.	HIDDEN	Year of Reg.	2015	
Chassis No.	JN1MC2E26Z0003656	Colour	GREY	
Odometer	83838 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195 R15C	BRIDGESTONE	6 mm	
L/H Front Tyre	195 R15C	BRIDGESTONE	6 mm	
R/H Rear Tyre	195 R15C	BRIDGESTONE	6 mm	
L/H Rear Tyre	195 R15C	BRIDGESTONE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	01/12/2020	Inspection Date	07/12/2020	
Survey held at	913 BUKIT TIMAH ROAD			
Repairer	TAN CHONG MOTOR SALES PTE LTD			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBD 6515Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	GLASS -TAIL GATE (N)	NECESSARY	891.00	891.00
2	CLIP BUMPER @\$1.30 (N)	NECESSARY	2.60	2.60
7	CLIP BUMPER @\$8.10 (N)	NECESSARY	56.70	56.70
1	BRKT -RR BUMPER CENTER (N)	SERVICEABLE	171.90	-
1	FACE -RR BUMPER (N)	DEFORMED	667.20	667.20
1	STRIKER -TAIL GA (N)	SERVICEABLE	34.80	-
1	LOCK & REMOCON (N)	SERVICEABLE	287.10	-
1	DOOR BACK (N)	BENT	1,998.30	1,998.30
1	EMBLEM -BACK DOO (N)	NECESSARY	64.90	64.90
1	EMBLEM -BACK DOO (N)	NECESSARY	110.00	110.00
1	EMBLEM -REAR (N)	NECESSARY	64.90	64.90
1	RUBBER -DUM (N)	NECESSARY	63.80	63.80
	LESS 20% DISCOUNT		-882.64	-783.88
			3,530.56	3,135.52
<u>SPECIAL NETT ITEMS</u>				
1	70KM/H (SN)	NECESSARY	9.00	9.00
1	LABEL -8 PAX (SN)	NECESSARY	12.00	12.00
1	MBR-CROSS ,TAIL OUTER (SN)	SERVICEABLE	147.10	-
2	GROMMET BUMPER @\$1.90 (SN)	NECESSARY	3.80	3.80
1	SUNDRIES (SN)	NECESSARY	100.00	20.00
1	REAR W/SCREEN SEALANT (SN)	NECESSARY	80.00	80.00
1	SENSOR -REVERSE (SN)	NOT WORKING	250.00	250.00
			601.90	374.80
<u>LABOUR</u>				
	PERFORM RUST PROFING & TREATMENT FOR AFFECTED PANEL.		120.00	120.00
	APPLY SEALANT TO ALL AFFECTED PANEL JOINTS & RESEAL NECESSARY AREA.		100.00	100.00
	REPAIR FLOOR BOARD AND RENEW REAR BUMPER ,TAILGATE END PANEL .		1,700.00	1,170.00
	S/PAINT REAR BUMPER ,TAILGATE AND END PANEL .		1,200.00	750.00

Report Ref No. CC4/FCI20013312/R1ea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TRANSFER TAILGATE MECHANICAL PARTS TO NEW DOOR .		80.00	80.00
	RENEW REAR WINDSCREEN TO ASSIST REPAIR .		180.00	180.00
	CHECK OR RENEW REVERSE SENSOR .		55.00	55.00
			3,435.00	2,455.00
GRAND TOTAL			7,567.46	5,965.32
RECOMMENDED COST OF REPAIRS				5,965.32

Report Ref No. CC4/FCI20013312/R1ea3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBD 6515Y

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

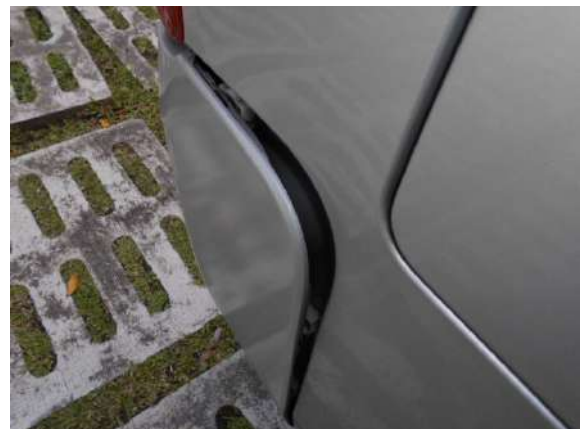



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBD 6515Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

