



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2103339

INV Date 12/05/2021

Reference CC4/LPC20013628/R1gs3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SLJ 1963U
Insured Veh. XD 4629E
Claim No. 20/20/20/VC05/023969
Policy No. Z20VC05006043
Accident Date 04/12/2020
Inspection Date 10/12/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC20013628/R1gs3q2 Date: 12/05/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XD 4629E	Veh. Inspected	SLJ 1963U	
Policy No.	Z20VC05006043	Coverage (\$)	0.00	
Claim No.	20/20/20/VC05/023969	Excess (\$)	0.00	
Assign From	KENNY	Assign Date	09/12/2020	
2. Vehicle Particulars & Condition				
Make & Model	VOLVO S60 T5 A/T ABS	c.c	1969	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	YV1FS40LDH2428532	Colour	GREY	
Odometer	76843 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/50 R17	MICHELIN	6 mm	
L/H Front Tyre	215/50 R17	MICHELIN	6 mm	
R/H Rear Tyre	215/50 R17	MICHELIN	6 mm	
L/H Rear Tyre	215/50 R17	MICHELIN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	04/12/2020	Inspection Date	10/12/2020	
Survey held at	WEARNES AUTOMOTIVE PTE LTD 249 ALEXANDRA ROAD SINGAPORE 159935			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			14 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLJ 1963U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FENDER PANEL FRT RH (SN)	BENT	1,093.20	983.88
1	FENDER BRACKET FRT S (SN)	NECESSARY	12.00	10.80
1	BONNET FRT S60 14-C (SN)	TO REPAIR SEE LABOUR	2,776.60	-
1	MIRROR BACK COVER RH (SN)	TO REPAIR SEE LABOUR	300.40	-
1	DOOR MIRROR RH S60 1 (SN)	SCRATCHED	700.80	630.72
1	V032228971/DOOR PANE (SN)	TORN	2,409.40	2,168.46
1	GUIDE MOULDING CHROM (SN)	NECESSARY	322.60	290.34
1	DOOR WAIST CHROME RH (SN)	NECESSARY	269.50	242.55
1	DOOR ATTACH SEAL FRT (SN)	NECESSARY	78.50	70.65
1	SOUND DEADENING PAD (SN)	NECESSARY	525.40	472.86
4	*D* ADHESIVE SEALANT (SN)	NECESSARY	312.00	280.80
1	DOOR CABLE HARNESS F (SN)	CUT	240.20	216.18
1	CABLE HARNESS FLOOR (SN)	CRACKED	2,008.80	1,807.92
20	DOOR TRIM CLIP S60 1 (SN) (ADDITIONAL)	NECESSARY	115.20	115.20
1	WHEELARCH FRT RH S60 (SN) (ADDITIONAL)	DEFORMED	178.65	178.65
			11,343.25	7,469.01
<u>LABOUR</u>				
TO REMOVE & INSTALL ROOF LININ . (ADDITIONAL)			2,040.00	2,040.00
TO TRANSFER FRONT RH DOOR PART. (ADDITIONAL)			250.00	250.00
TO REPLACE FRONT FENDER ,FRT BONNET ,FRT RH DOOR ,FRT RH DOOR HARNESS ,ETC.INCLUSIVE OF THE REPAIR OF BONNET FRT S60 14-C AND MIRROR BACK COVER RH.			3,200.00	2,400.00
TO PUTTY SPRAY PAINT ON FRT BONNET ,FRT RH FENDER ,FRT RH DOOR ,ETC.			2,800.00	2,100.00
TO REPLACE CABIN HANESS.			7,200.00	4,080.00
TO REMOVE & INSTALL DASHBOARD .			7,200.00	2,720.00
TO REMOVE & INSTALL INTERIOR P.			5,440.00	4,080.00

Report Ref No. CC4/LPC20013628/R1gs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CHECK WIRING INCLUDE RESETTING OF ALL ELECTRICAL MODULES.		510.00	510.00
			28,640.00	18,180.00
GRAND TOTAL			39,983.25	25,649.01
RECOMMENDED COST OF REPAIRS				25,649.01

Report Ref No. CC4/LPC20013628/R1gs3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLJ 1963U

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

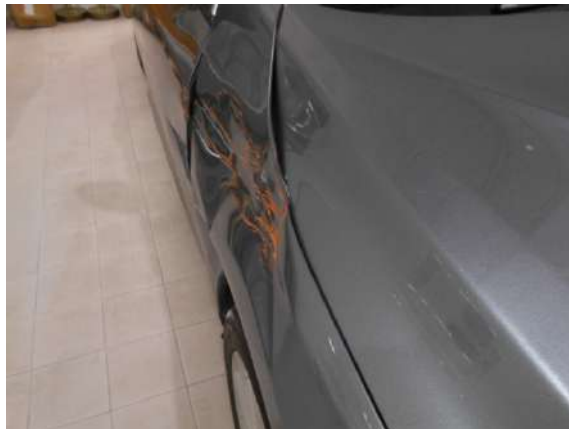



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLJ 1963U

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

