



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2101706

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 17/03/2021
Reference CC4/FCI20014020/Ges3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SME 1313K
Insured Veh. SHC 7255A
Claim No. D20005144MFSH
Policy No. D-20094921MFSH
Accident Date 14/12/2020
Inspection Date 17/12/2020

Description	Total
Survey Inspection	529.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	529.00
GST (7%)	37.03
Grand Total	566.03

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20014020/Ges3q2	
			Date: 17/03/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHC 7255A	Veh. Inspected	SME 1313K	
Policy No.	D-20094921MFSH	Coverage (\$)	0.00	
Claim No.	D20005144MFSH	Excess (\$)	0.00	
Assign From	MERINA CHIA	Assign Date	17/12/2020	
2. Vehicle Particulars & Condition				
Make & Model	HONDA JAZZ 1.5	c.c	1498	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	JHMGK5850JX208455	Colour	RED	
Odometer	43508 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	185/55 R16	YOKOHAMA	8 mm	
L/H Front Tyre	185/55 R16	YOKOHAMA	8 mm	
R/H Rear Tyre	185/55 R16	YOKOHAMA	8 mm	
L/H Rear Tyre	185/55 R16	YOKOHAMA	8 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	14/12/2020	Inspection Date	17/12/2020	
Survey held at	KAH MOTOR.CO.SDN.BHD 6A MANDAI ESTATE SINGAPORE 729903			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			10 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SME 1313K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	TAILGATE COMP (SN)	BUCKLED	562.20	562.20
1	WEATHERSTRIPTAILGATE (SN)	NOT NECESSARY	69.22	-
1	LOCK ASSY ,TAILGATE (SN)	NOT NECESSARY	64.65	-
1	STAY ASSY,R.TAILGATE OPEN (SN)	NOT NECESSARY	72.30	-
1	STAY ASSYL.TAILGATE OPEN (SN)	NOT NECESSARY	72.30	-
1	EMBLEMRR (SN)	NECESSARY	8.92	8.92
1	FACE ,RR.BUMPER (SN)	DISTORTED	386.62	386.62
1	FACER,R.RR.BUMPER SIDE (SN)	NOT NECESSARY	12.97	-
1	FACER,L.RR.BUMPER SIDE (SN)	CUT	12.97	12.97
1	DIFFUSER ASSY,RR.PR (SN)	DISTORTED	159.07	159.07
1	COVER ,R.RR.BUMPER (SN)	NOT NECESSARY	15.90	-
1	COVER ,L.RR.BUMPER (SN)	CUT	15.90	15.90
1	GARNISH ASSY,RR.LICENSE (SN)	NOT NECESSARY	164.32	-
1	EMBLEMH (SN)	NOT NECESSARY	8.02	-
2	NUTPUSH 3MM (SN)	NOT NECESSARY	3.15	-
1	PANEL COMPRR (SN)	BUCKLED	246.45	246.45
1	STIFFENER COMP,R.RR (SN)	NOT NECESSARY	66.90	-
1	GUTTER COMP,L.RR.PILLAR LOWER (SN)	BUCKLED	68.25	68.25
1	LID COMPFUEL FILLER (SN)	NOT NECESSARY	32.77	-
1	LID ASSYSPARE TIRE (SN)	NOT NECESSARY	146.02	-
1	BOX ASSY ,CARGO FLOOR (SN)	NECESSARY	85.12	85.12
1	PANEL SET ,L.RR.OUTSIDE (SN)	BUCKLED	438.97	438.97
1	PANEL COMP,L.RR (SN)	NOT NECESSARY	400.12	-
1	LINING ASSY,RR.PANEL (SN)	BROKEN	45.60	45.60
1	FRAME BL.RR (SN)	NOT NECESSARY	37.57	-
1	FLANGE ,RR.FRAME END (SN)	NOT NECESSARY	8.47	-
1	FENDER ,L.RR.INNER (SN)	NOT NECESSARY	60.75	-
1	LINING ASSYL.TRUNK (SN)	NOT NECESSARY	130.05	-
1	TAILLIGHT ASSYL (SN)	CRACKED	183.45	183.45
1	LIGHT ASSYL.LID (SN)	NOT NECESSARY	66.90	-
1	YOKOHAMA TYRE (DISC 20%) (SN)	CUT	135.00	108.00

Report Ref No. CC4/FCI20014020/Ges3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	DAMPER UNUTRR (SN)	NOT NECESSARY	167.17	-
1	BEAM ASSYRR.AXLE (SN)	BENT	701.02	701.02
1	GLASS SETRR.WINDSHIELD (SN)	NOT NECESSARY	469.20	-
1	RUBBER CWINDSHIELD DAMPER (SN)	NECESSARY	8.77	8.77
2	RUBBERWINDSHIELD DAMPER (SN)	NECESSARY	10.65	10.65
1	DAMPERSTD 5X5 (SN)	NECESSARY	6.52	6.52
1	WINDSCREEN SEALANT (SN)	NECESSARY	60.00	60.00
2	RUBBERRR QTR W/SHIELD (SN)	NECESSARY	14.85	14.85
1	CLIPQUARTER WINDSHIELD A (SN)	NECESSARY	2.77	2.77
1	CLIPQUARTER WINDSHIELD B (SN)	NECESSARY	2.77	2.77
1	CLIPQUARTER WINDSHIELD C (SN)	NECESSARY	1.87	1.87
1	WINDSCREEN SEALANT (SN)	NECESSARY	60.00	60.00
1	SUNDRIES (SN)	NECESSARY	100.00	30.00
1	STIFFENER COMP,L.RR (ADDITIONAL) (SN)	NECESSARY	68.25	68.25
1	COVER,L.RR.FENDER (ADDITIONAL) (SN)	NECESSARY	32.77	32.77
1	OUTLETRR AIR (ADDITIONAL) (SN)	CRACKED	19.42	19.42
1	BOLTLOCK STRIKER (ADDITIONAL) (SN)	NECESSARY	1.72	1.72
			5,508.65	3,342.90
	LABOUR			
	REMOVE & REPLACE RR AXLE . (ADDITIONAL)		650.00	650.00
	REPLACE RR.L QTR GLASS .		300.00	300.00
	REPLACE RR.WINDSCREEN .		650.00	650.00
	INSPECT RR LIGHTING MECHANISMS PERFORM WATER.		150.00	120.00
	REMOVE & RENEW REVERSE SENSORS.		150.00	120.00
	REMOVE & INSTALL REAR COMPARTMENT LININGS .		800.00	650.00
	REMOVE & TRANSFER ITEMS TO NEW TAILGATE ADJUST &.		450.00	350.00
	RESET VEHICLE SMART ENTRY SYSTEM.		450.00	325.00
	REMOVE INSTALL & CALIBRATE REAR VIEW CAMERA.		450.00	325.00
	REMOVE & INSTALL FUEL TANK FUEL PIPES.		650.00	325.00
	BODY JOINT SEALANT TAILGATE .		100.00	80.00
	BODY JOINT SEALANT END PANEL.		100.00	80.00
	BODY JOINT SEALANT FENDER .		100.00	80.00

Report Ref No. CC4/FCI20014020/Ges3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	CUT & RENEW RR L FENDER .STRAIGHTEN INNER PANEL.		4,500.00	4,225.00
	SPRAY PAINTING ON REPAIRED OR REPLACED AREAS.		3,500.00	2,600.00
	TOWING SERVICES (MBBS).		100.00	100.00
	REPLACE RR.L QTR GLASS .	REPEATED	160.00	-
	WHEEL ALIGNMENT.		180.00	180.00
			13,440.00	11,160.00
GRAND TOTAL			18,948.65	14,502.90
RECOMMENDED COST OF REPAIRS				14,502.90

Report Ref No. CC4/FCI20014020/Ges3q2

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SME 1313K

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

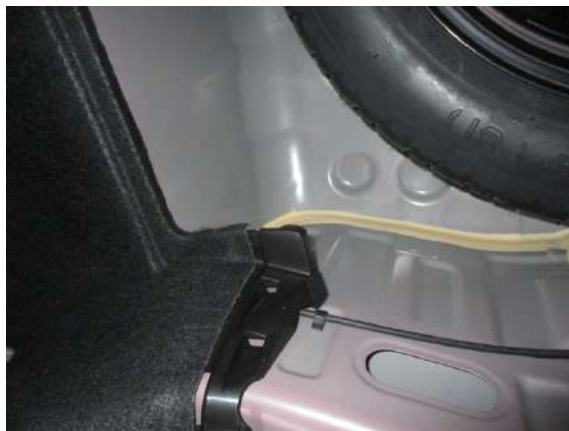



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SME 1313K

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SME 1313K

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

