

*Kenneth*

**ASSIGNMENT**

From: \_\_\_\_\_ Date: \_\_\_\_\_  
 Estimated Cost: \_\_\_\_\_  
 TP /  WS /  TP RES /  OD RES /  EVA /  INV /  MY  
 To Inspect Vehicle No: \_\_\_\_\_  
 at Workshop m/s: P&H  
 of \_\_\_\_\_  
 Insured: \_\_\_\_\_  
 Policy No: DMPCSNA00003832001  
 Claims No: SNM20D204957  
 Sum Insured: \_\_\_\_\_ Excess: 0/- 1000  
 (Client's Record)  
 Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 8 —  
 IDAC Accident Rpt: \_\_\_\_\_ Consistent?: Yes or No  
 GIA / PR Seen: \_\_\_\_\_ Consistent?: Yes or No  
 Est. Repairs: 04 days Res.: Yes or No  
 Lum Sum: 1-B.1 % 3 Val.: Yes or No  
 CA /  REV / REP. / 24 HRS  
 Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_ Vehicle: IN / OUT

Veh No: S 5337 CD Yr Regn: 01, 17  
 Type:  Car /  M.Cycle /  Bus /  Van /  Lorry /  Taxi /  Prime Mover /  
 Truck / Trailer or \_\_\_\_\_  
 Make: Mazda 3 c.c. 1498  
 Colour: N. Red A/C: Insured / Std / NI / NA  
 Sp. Reading: 28510 T/Radio: Insured / Std / NI / NA  
 Eng/No: \_\_\_\_\_  
 C/No: JM6BM 42A8G 0345916  
 Gen. Cond:  Good /  Fair /  Poor /  Burnt  
 Steering: In order / Jammed / Leaked / Burnt or \_\_\_\_\_  
 Brake: In order / Jammed / Leaked / Burnt or \_\_\_\_\_  
 Mod: Nil / S/Rlm / STD A/Rlm or \_\_\_\_\_  
 Tyre Size: F: 205/80R16  
 R: \_\_\_\_\_  
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /  
 YOYO / YOKO or \_\_\_\_\_  
 Front R/Bal. 8 mm Rear R/Bal. 8 mm  
 L/Bal. 8 mm L/Bal. 8 mm  
 D.O.A. 20/12/20 D.O.I. 23/12/202  
 Survey held at \_\_\_\_\_  
 Des. of Damages:  Frt /  Rear /  O/S /  N/S /  UIC /  Rooftop or \_\_\_\_\_  
 The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
<u>1</u>	<u>No MV</u>

24/12/20 @ 4.29pm revert to Adeline Chng via Merimen.  
 28/12/20 @ 5.05pm Alfred informed C/A & ex. \$1000 via Merimen.  
 28/12/20 @ 5.19pm Informed Ms Wong C/A & ex. \$1000 by email.  
 31/12/20 @ 9.01am Informed Doris the excess should be WAIVED instead of \$1000 as confirmed with Alfred.  
 Kenneth confirmed LS \$2750 (Red \$1397.36, 34%)

Date/Time, File Pass to?  : Prell. Report  
 11/26/01 Typist  : Final Report  
 Date/Time, File Return to?

Days Of Repair: 4  
 Resurvey No. of Trlp: 2

Add Fee:  : Site Insp (\$ )  
 : Interview (\$ )  
 : Tech Invs (\$ )  
 : Weekend (\$ )

Survey Fee:	
Transportation:	
S + RS:	
Others:	
TOTAL	

Report Format: MER-OD  
 Lump Sum LLB: (\$ 2750)

**S&H Motor Pte Ltd**  
**160 Sin Ming Drive #07-02**  
**Sin Ming Autocity**  
**Singapore 575722**

**Insurer Reference:**  
**Repairer Reference: 038353**  
**Date calculated: 21/12/2020 6:06 PM**

**Full Report**  
**Registration: S5337CD**  
**Printed: 21/12/2020 6:07 PM**

**Summary Information**

<b>Claim</b>			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	SH Motor	Currency:	SGD
Claim Reference:		Date of Incident:	20/12/20
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

**Vehicle Details**

<b>Vehicle</b>			
Manufacturer:	MAZDA		
Model:	3 (BM/BN)		
Sub Model:	BASE MODEL		
Model Sheet Number:	36 68 01		
Registration:	S5337CD		
VIN number:			
Odometer:			
<b>Model Specs</b>			
FROM 07/2018	2 ZONE AIR CON	1.6 LTR 77 KW	4-DOOR SALOON
PREPARE OFF VEHICLE	THREE COAT PEARL		

*Not with claim*  
*Insurance by claim*  
*Ex @ 1000h*  
*4 days*

**Labour**

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
S0201A-R-X	RENEW FRONT BUMPER INCLUDES: R + R BUMPER AND NECESSARY ATTACHED PARTS	6.0	6.0	25.20
S0204A-R-X)	RENEW RADIATOR GRILLE	5.0	5.0	21.00
T0301A-R-X)	R + R L/F HEADLAMP (BUMPER REMOVED) DOES NOT INCLUDE: ADJUST HEADLAMP	3.0	3.0	12.60
T0301A-R-X)	R + R R/F HEADLAMP (BUMPER REMOVED) DOES NOT INCLUDE: ADJUST HEADLAMP	3.0	3.0	12.60
S0612B-R-X)	R + R FRONT PANEL	9.0	9.0	37.80
E0201A-R-X)	RENEW RADIATOR	9.0	9.0	37.80
S0604X-R-X	R + R LOWER ENGINE PROTECTION	3.0	3.0	12.60
NO NUMBER	R + R AIR CLEANER	3.0	3.0	12.60
NO NUMBER	DRAIN + REFILL AIR CONDITIONING	7.0	7.0	29.40
NO NUMBER	R + R CONDENSER	5.0	5.0	21.00
0471	BONNET REPAIR	5.0*	5.0*	21.00

<b>Labour Cost</b>	<b>Hrs</b>	<b>WU</b>	
Panel / Mechanical Labour	5.80	58.0	243.60
<b>Total of Labour</b>			<b>243.60</b>

### Paint

Paint Work		SYSTEM AZT	Time Basis 10 WU/h
Code	Description - THREE COAT PEARL		WU Price SGD
	BONNET NEW PART PAINTING		31.4
	FRONT BUMPER NEW PART PAINT K1G		23.0
	UPP RAD GRILLE COVER NEW PART PAINT K1R		7.0
	L/F WING SURFACE PAINT		8.7

### Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	102.08
0281	FRONT BUMPER NEW PART PAINT K1G	74.63
0323	UPP RAD GRILLE COVER NEW PART PAINT K1R	13.70
0741	L/F WING SURFACE PAINT	14.15

### Labour Cost - Paint

Factor	Hrs	WU	Price SGD
	42.00		SGD/h
Time Paint		70.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.80	8.0	33.60
Preparation Multi-Coat	0.50	5.0	21.00
<b>Total</b>	<b>10 WU/h</b>	<b>108.0</b>	<b>453.60</b>

### Material Cost - Paint

Description	Price SGD
New Part Painting	102.08
New Part Painting - Plastic K1R	13.70
New Part Painting - Plastic K1G	74.63
Surface-/Blend Paint	14.15
Material-constant Metal Preparation	28.60
Material-constant Multi-Coat	9.30
Material-constant Plastic	12.70
<b>Total</b>	<b>255.16</b>

### Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01	Price SGD
0281	FRONT BUMPER	B63B50031BBB	Original	330.00	✓
0283	L/BUMPER BRACKET	BHN1500U1E	Original	8.00	✓
0287	L/LWR BUMPER BRACKET	BANE50163	Original	8.00	?
0288	R/LWR BUMPER BRACKET	BANE50153	Original	8.00	?
0323	UPP RAD GRILLE COVER	BANE50033A51	Original	120.00	✓
0340	FRT BUMPER SUPPORT	BJS750070C	Original	180.00	?

Code	Description	Part Number	Part Source	Price SGD
0347	L/F BUMPER COVER	BANE50C21A	Original	Pa 20.00 X
0348	R/F BUMPER COVER	BANE50C11A	Original	Pa 20.00 X
0349	FRT BUMPER GRILLE	BHN150712B	Original	CM 55.00 L
0369	L/F BUMPER MOULDING	B63B507K1A	Original	CM 65.00 L
0370	R/F BUMPER MOULDING	B63B507J1A	Original	Ma 65.00 L
0433	MANUFACTURER BADGE	D10J51730	Original	Ma 26.00 L
0561	L/F HEADLAMP	BAAN510L0E	Original	250.00 ?
0562	R/F HEADLAMP	BJF4510K0A	Original	250.00 ?
1009	FRONT PANEL	BJS753110B	Original	160.00 ?
1019	LOCK CARR CTR SUPP	B45A5215Y	Original	n 20.00 X
1351	UPP INN FRONT PANEL	BHN1501C0B	Original	45.00 ?
4465	CONDENSER	GHR161480B	Original	365.00 ?
7761	RADIATOR	PEKC15200A	Original	480.00 ?
7764	RADIATOR SHROUD CPL	PEAR15025	Original	n 450.00 X
8789	L/F WIND DEFLECTOR	BHN1501V1A	Original	15.00 ?
8790	R/F WIND DEFLECTOR	BHN1501U1A	Original	15.00 ?

f: OEM Parts  
n: Non-OEM Parts  
u: Used parts

<b>Savings</b>	0.00
<b>Subtotal</b>	2,955.00
<b>Fixed Sundry Parts Price</b>	100.00
<b>Total</b>	3,055.00

### Extras

Code	Description	Price SGD
1000	Electrical work Electrical work	25.00* 201
1001	Engine coolant Engine coolant	nn 30.00* X
1002	Air con coolant Air con	50.00* ?
1003	Front number plate Number Plate	CM 35.00* 201
<b>Total Extras</b>		140.00

### Final Calculation

	SGD	SGD
<b>Parts</b>	2,955.00	
Fixed Sundry Parts Price	100.00	
<b>Total Parts</b>		3,055.00
<b>Labour Time Base 10 WU/h</b>		
Total 58.0 WU X 42.00 SGD/h	243.60	
<b>Total of Labour</b>		243.60
<b>Total Of Extras</b>		140.00
<b>Paint Work Time Base 10 WU/h</b>		
Labour Cost 108.0 WU X 42.00 SGD/h	453.60	
Material Cost	255.16	
<b>Total Paint Including Material</b>		708.76
<b>Repair Cost Excludes GST</b>		4,147.36
GST (+7.0%)		290.32
<b>Repair Cost Included GST</b>		4,437.68

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature:  
Date:

# SINGAPORE ACCIDENT STATEMENT

## IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

## ACCIDENT STATEMENT

Date of Submission ..... 21/12/2020 14:11 (SGT)  
Date of Accident ..... 20/12/2020 15:05 (SGT)  
Exact Location of Accident ..... CTE, Singapore  
Additional Location Information ..... CTE Exit to PIE (Changi Airport)  
Country/State of Loss ..... Singapore

## DETAILS OF OWN VEHICLE

Vehicle Registration Number ..... S5337CD

### INSURED/POLICYHOLDER

Is company? ..... No  
Name Of Registered Owner ..... Pu Xiaojun  
Passport No/FIN ..... GXXXX398Z  
Email Address ..... buxiaojun@hotmail.com  
Mobile Phone No ..... (Phone) +65-91136370  
Alternative Phone No ..... (Home) +65-91136370

### VEHICLE PARTICULARS

Manufacturer ..... Mazda  
Model ..... 3  
Variant ..... -  
Exact purpose for which vehicle was being used at time of accident ..... Private use  
Are you claiming under your own insurance policy for repair to your vehicle? ..... Yes  
Vehicle Category ..... Private car

### INSURANCE COMPANY

Name of Insurance Company ..... China Taiping Insurance  
Type of Coverage ..... Comprehensive  
Fleet Policy ..... No  
Policy Number ..... DMPCSNA00003832001  
Cover Note Number ..... -

### DRIVER

Name of Driver ..... Qiu Yuanxing  
Passport No/FIN ..... GXXXX178U  
Date Of Birth ..... 03/01/1975  
Occupation ..... Indoor

Date Of Driving Pass ..... 21/06/2019  
 Driving experience ..... 1 YEAR AND 6 MONTHS  
 Gender ..... Male  
 Mobile Number ..... (Phone) +65-91136370  
 Alt. Phone Number ..... -  
 Email Address ..... buxiaojun@hotmail.com  
 Address ..... 150 Tanglin Road  
 Address complement ..... -  
 Postcode ..... 247969  
 Is the driver the policyholder? ..... No  
 If No, Relationship of the Driver with the Insured ..... Spouse  
 Does Driver Own Other Vehicles? ..... No  
 Vehicle Registration Number of Other Vehicle Owned by Driver ..... -  
 Insurance Company of Other Vehicle Owned by Driver ..... -

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident ..... Collision - Head to Rear  
 Weather Conditions ..... drizzling  
 Road Surface ..... Wet

OTHER INFORMATION

Was any foreign vehicle involved in the accident? ..... No  
 Number of vehicles involved in the accident ..... 2  
 Was anybody injured in the Accident? ..... No  
 Was any injured conveyed to hospital by ambulance? ..... -  
 Was any other material or property damaged? ..... Yes  
 Number of Passengers (Including Driver) ..... 3  
 Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance? ..... No

PASSENGER 1

Name ..... Pu Xiaojun  
 Gender ..... Female

PASSENGER 2

Name ..... child  
 Gender ..... Male

DETAILS OF POLICE ACTION

Was the accident reported to the police? ..... No  
 Was notice of intended Prosecution given? ..... No  
 If yes, against whom? ..... -

CIRCUMSTANCES OF ACCIDENT

refer attached report.

ATTACHMENT(S)

Are accident photos available for attachment? ..... Yes  
 Was there any video captured by Car Camera? ..... No  
 Was there any audio recorded? ..... No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number ..... SGM4977D  
 Vehicle Manufacturer ..... Lexus  
 Vehicle Model ..... Gs300  
 Vehicle Variant ..... -

**SKETCH PLAN**



A - S533100

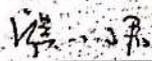
B - SGM49110

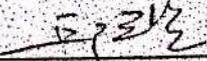
**DESCRIBE CIRCUMSTANCES OF THE ACCIDENT**

我驾车在 CTE 路上行驶，在 CTE 去往 PIE (樟宜机场) 方向的出口处，车辆拥堵。我在跟车时，对方车辆突然刹车，我立即刹车，但因路上湿滑，我车轻轻向前碰到对方的车尾部。

**DECLARATION**

I/We declare the foregoing particulars are true in every respect.

  
 Policyholder's Signature  
 Date & Time:

  
 Driver's Signature  
 (if driver is not the policyholder)  
 Date & Time:

  
 Reporting Centre Personnel's Signature  
 Name:  
 NRIC/FIN No.: