

CYCLE & CARRIAGE

AG - OD CLAIM  
SURVEY: 30/12/20  
LKK - STEVE

VEHICLE NO : SMH 5778 K

MODEL : MIT/ATRAGE 1.2 CVT

WIP : 61295

Material	:	\$	<u>3,782.89</u>
Labour	:	\$	<u>2,270.00</u>
Sub-Total	:	\$	<u>6,052.89</u>
Less 2% Disc	:	\$	<u>-</u>
Less Excess	:	\$	<u>-</u>
Total	:	\$	<u>6,052.89</u>
GST 7%	:	\$	<u>423.70</u>
Grand Total	:	\$	<u>6,476.59</u>
Finalise By/Date	:	<u>LARRY ON 11/01/21</u>	

REVERT BACK WITHIN 7 DAYS,  
OTHERWISE WILL PROCEED WITH INVOICING

SURVEYOR'S REPORT REQUIRED

REPAIR TOOK 05 WORKING DAYS + 2 days (wk end)



CYCLE &amp; CARRIAGE

**CYCLE & CARRIAGE AUTOMOTIVE PTE LIMITED**  
**PANDAN GARDENS CUSTOMER SERVICE CENTRE**

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65691056

**PRO-FORMA INVOICE**

Co Reg No : 197701469G

**THIS IS NOT AN OFFICIAL TAX INVOICE**


GST Reg No : MR-8500111-X

Invoice Name & Address	Owner Name & Vehicle Info
CHOONG WENG YEW	Cust No/Name KCV10306/CHOONG WENG YEW
46A ZION ROAD	Reg No/Reg Date SMH5778K / 28/01/2019
SINGAPORE 247777	Date In/Mileage 04/01/2021/ 23294
Contact No Mobile: 83399602	Chassis/Package MMBSTA13AKH000503
04/01/2021	Engine No 3A92UHL8461
	Make/Model MIT/19MY ATTRAGE 1.2 CVT
	Colour/Trim A06 COOL SILVER MET/ BK BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			
CTP00040	Cash	11/01/2021/ 11:02	BLD	884 / Lauro Songcuan	61295			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
E PNT88000								900.00 ✓
RENEW DAMAGED PARTS ON RH FRONT FENDER, FRONT BUMPER FACE, FRONT BODY KITS								
E PNT98000								1050.00 ✓
SPRAY PAINT RH FRONT FENDER, FRONT BUMPER, FRONT BODY KITS AND AFFECTED PORTIONS								
A 54900099								30.00 ✓
CHECK WIRING AND CHASSIS ELECTRICAL SYSTEM								
A 10028901								120.00 ✓
TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST USING HI-SCAN PRO TEST								
A WHEELALIGNMENTBP								120.00 ✓
To Conduct Computerize Full Wheel Alignment								
M SUNDRY								20.00 ✓
SUNDRIES								
S SPECIALISTJOB								30.00 ✓
SUPPLY LABOUR FOR INSTALLATION FRONT RH SPORT RIM D/N NO:313503								
X FENDER,FR RH ✓				1.00	497.00	23.00		382.69 ✓
X EMBLEM ECO ✓				1.00	17.00	00.00		17.00 ✓
X BRACKET,FR BUMPER,RH ✓				1.00	13.00	23.00		10.01 ✓
X GARNISH,FR BUMPER,RH ✓				1.00	127.00	23.00		97.79 ✓
X FACE,FR BUMPER ✓				1.00	703.00	23.00		541.31 ✓
X CLIP,FR BUMPER ✓				10.00	4.00	23.00		30.80 ✓
X HEADLAMP ASSY,RH ✓				1.00	660.00	23.00		508.20 ✓
X WHEEL,DISC ✓				1.00	687.00	23.00		528.99 ✓
X RIVET,FR BUMPER ✓				6.00	5.00	23.00		23.10 ✓
P UNPAINTED BODYKITS ✓				1.00	1643.00	00.00		1643.00 ✓
Z TEXT								
OD CLAIM - AIG								
DOA: 29.12.2020								
SURVEY: STEVE (LKK) 30.12.2020								
05 DAYS								
<i>Guarantee Your Warranty, Maintain with Cycle &amp; Carriage!</i>								

Parts	3,782.89			
Labour	2,220.00			
Standard Menu	0.00			
Specialist Job	30.00			
Diagnostics Job	0.00			
Sundry/Others	20.00			
Total(w/o GST)	6,052.89			
		7% GST on	6052.89	423.70
			<b>Total Payable</b>	<b>6,476.59</b>

This is not an official tax invoice.  
 This is a computer generated document, no signature is required.

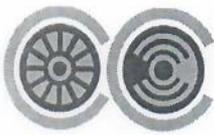

CYCLE & CARRIAGE

INSURANCE CO. : **AIG**

Supplementary For Registration No.: **SMH 5778 K**

<b><u>Materials</u></b>		<b><u>Cost \$</u></b>
1	Rivet, FR Bumper (6 pcs)	30.00 ✓ <i>hec</i>
		6.90
		<u>23.10</u>
	7% GST	1.62
	<b>Total</b>	<b><u>24.72</u></b>

Thank You.

Yours faithfully  
CYCLE & CARRIAGE AUTOMOTIVE PTE LTD

Larry Songcuan  
Customer Service  
Cycle & Carriage  
Pandan Gardens

CAR NO: SMH5778K

WIP: 61295

(ADDITIONAL PARTS CHANGE)

S/NO	PARTS NAME	? / SUPP	CSA SIGN	PHOTO TAKEN	REMARKS
1	Rivet Front Bumper	? / SUPP	<i>[Signature]</i>	<i>Mr Steve</i>	5/1/21 <i>Photo 657</i>
2		? / SUPP			
3		? / SUPP			
4		? / SUPP			
5		? / SUPP			
6		? / SUPP			
7		? / SUPP			
8		? / SUPP			
9		? / SUPP			
10		? / SUPP			
11		? / SUPP			
12		? / SUPP			
13		? / SUPP			
14		? / SUPP			
15		? / SUPP			
16		? / SUPP			
17		? / SUPP			
18		? / SUPP			
19		? / SUPP			
20		? / SUPP			

	DATE	TAKEN BY
PHOTO BEFORE PAINT	<i>3:30pm</i>	<i>Steve</i>
PHOTO AFTER PAINT	<i>5/1/21</i>	
PHOTO OF MOUNT TO CELLETTE BENCH		
REMOVE AND INSTALL ENGINE		
REMOVE AND INSTALL DASHBOARD		
REMOVE & INSTALL FUEL TANK		
PHOTO UNDERCARRIAGE PARTS		

MODEL: Attrage 1.2

SURVEYOR: Steve @ LKK

Work Order: R001303  
 License: SMH 5778 K  
 Technician: 106 WENG SOON  
 Mileage: 23294  
 Date: 8.1.21 19:38

Mitsubishi : Mirage/Attrage : 2012- (Including G4)

Front : Left

Actual	Before	Specified Range
-0°27'	-0°26'	-0°40' 0°50'
3°57'	3°57'	3°15' 4°45'
0°00'	-0°04'	-0°07' 0°07'
13°45'*	13°44'*	10°05' 13°05'
13°19'	13°19'	9°25' 13°55'

Camber  
 Caster  
 Toe  
 SAI  
 Included Angle  
 Turning Angle Diff.

Front : Right

Actual	Before	Specified Range
-0°34'	-0°39'	-0°40' 0°50'
4°18'	4°18'	3°15' 4°45'
0°00'	0°10'*	-0°07' 0°07'
12°00'	12°05'	10°05' 13°05'
11°26'	11°26'	9°25' 13°55'

Front

Cross Camber  
 Cross Caster  
 Cross SAI  
 Total Toe  
 Cross Turn Diff.

Actual	Before	Specified Range
0°07'	0°13'	-0°30' 0°30'
-0°21'	-0°21'	-0°30' 0°30'
1°45'	1°39'	
0°00'	0°06'	-0°14' 0°14'

Rear : Left

Actual	Before	Specified Range
-1°04'	-1°04'	-1°45' -0°15'
0°11'	0°11'	-0°01' 0°13'

Camber  
 Toe

Rear : Right

Actual	Before	Specified Range
-1°16'	-1°16'	-1°45' -0°15'
0°08'	0°08'	-0°01' 0°13'

Rear

Cross Camber  
 Total Toe  
 Thrust Angle

Actual	Before	Specified Range
0°11'	0°11'	-0°30' 0°30'
0°19'	0°19'	-0°02' 0°26'
0°02'	0°02'	

**Work Order:** R001303  
**License:** SMH 5778 K  
**Technician:** 106 WENG SOON  
**Mileage:** 23294  
**Date:** 8.1.21 19:38

**Mitsubishi : Mirage/Attrage : 2012- (Including G4)**

**Front : Left**

Actual	Before	Specified Range
-0°27'	-0°26'	-0°40' 0°50'
3°57'	3°57'	3°15' 4°45'
0°00'	-0°04'	-0°07' 0°07'
13°45'*	13°44'*	10°05' 13°05'
13°19'	13°19'	9°25' 13°55'

**Camber**  
**Caster**  
**Toe**  
**SAI**  
**Included Angle**  
**Turning Angle Diff.**

**Front : Right**

Actual	Before	Specified Range
-0°34'	-0°39'	-0°40' 0°50'
4°18'	4°18'	3°15' 4°45'
0°00'	0°10'*	-0°07' 0°07'
12°00'	12°05'	10°05' 13°05'
11°26'	11°26'	9°25' 13°55'

**Front**

**Cross Camber**  
**Cross Caster**  
**Cross SAI**  
**Total Toe**  
**Cross Turn Diff.**

Actual	Before	Specified Range
0°07'	0°13'	-0°30' 0°30'
-0°21'	-0°21'	-0°30' 0°30'
1°45'	1°39'	
0°00'	0°06'	-0°14' 0°14'

**Rear : Left**

Actual	Before	Specified Range
-1°04'	-1°04'	-1°45' -0°15'
0°11'	0°11'	-0°01' 0°13'

**Camber**  
**Toe**

**Rear : Right**

Actual	Before	Specified Range
-1°16'	-1°16'	-1°45' -0°15'
0°08'	0°08'	-0°01' 0°13'

**Rear**

**Cross Camber**  
**Total Toe**  
**Thrust Angle**

Actual	Before	Specified Range
0°11'	0°11'	-0°30' 0°30'
0°19'	0°19'	-0°02' 0°26'
0°02'	0°02'	

SMH 5778 K.

Diagnostic check before erase all DTC

All DTCs

Item	Setting	Information
M.U.T.-3 Version		SEW20091-00
V.C.I. Version		B178
Vehicle Information		A13A 2019MY

All DTCs

2021.01.08

System Name	SCC or DVC or Diagnostic database ID	Diagnostic trouble code(s)	Name	Malfunction Condition
MPI/GDI/DIESEL	KOSOSS_99880010		No DTCs	
AT/CVT/A-MT/TTC-SST	KOSOSS_99880010		No DTCs	
4WS/Electric Power Steering	KOSOSS_99880010		No DTCs	
ABS/ASC/ASTC/WSS	KOSOSS_99880010		No DTCs	
SRS-AIR BAG	KOSOSS_99880010		No DTCs	
Air Conditioner	KOSOSS_99880010		No DTCs	
ETACS	KOSOSS_99880010	B1707	Flasher open	Active
Meter	KOSOSS_99880010		No DTCs	
Steering Angle Sensor	KOSOSS_99880010		Non-target System	
KOS/OSS/MMO/Keyless (with KOS)	KOSOSS_99880010		No DTCs	

SMH 5778K

All DTCs Diagnostic check after erase all DTC

2021.01.08

Setting	
Item	Information
M.U.T.-3 Version	SEW20091-00
V.C.I. Version	B178
Vehicle Information	A13A 2019MY

System Name	SCC or DVC or Diagnostic database ID	Diagnostic trouble code(s)	Name	Malfunction Condition
MPI/GDI/DIESEL	KOSOSS_99880010		No DTCS	
AT/CVT/A-MT/TTC-SST	KOSOSS_99880010		No DTCS	
4WS/Electric Power Steering	KOSOSS_99880010		No DTCS	
ABS/ASC/ASTC/WSS	KOSOSS_99880010		No DTCS	
SRS-AIR BAG	KOSOSS_99880010		No DTCS	
Air Conditioner	KOSOSS_99880010		No DTCS	
ETACS	KOSOSS_99880010		No DTCS	
Meter	KOSOSS_99880010		No DTCS	
Steering Angle Sensor	KOSOSS_99880010		Non-target System	
KOS/OSS/IMMO/Keyless (with KOS)	KOSOSS_99880010		No DTCS	