



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2105581

INV Date 10/08/2021

Reference CC4/LPC20014816/R1ea3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SKS 7273C

Insured Veh. XD 4524Z

Claim No. 20/20/21/VC05/024039

Policy No. Z20VC05004347

Accident Date 22/12/2020

Inspection Date 31/12/2020

Description	Total
Survey Inspection	350.00
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC20014816/R1ea3q2 Date: 10/08/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XD 4524Z	Veh. Inspected	SKS 7273C	
Policy No.	Z20VC05004347	Coverage (\$)	0.00	
Claim No.	20/20/21/VC05/024039	Excess (\$)	0.00	
Assign From	KENNY	Assign Date	30/12/2020	
2. Vehicle Particulars & Condition				
Make & Model	AUDI A3 SEDAN 1.4 TFSI AMB	c.c	1395	
Engine No.	HIDDEN	Year of Reg.	2015	
Chassis No.	WAUZZZ8V6F1115526	Colour	GREY	
Odometer	92643 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/55 R16	YOKOHAMA	6 mm	
L/H Front Tyre	205/55 R16	YOKOHAMA	6 mm	
R/H Rear Tyre	205/55 R16	YOKOHAMA	6 mm	
L/H Rear Tyre	205/55 R16	YOKOHAMA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	22/12/2020	Inspection Date	31/12/2020	
Survey held at	24 BENOI SECTOR			
Repairer	PREMIUM AUTOMOBILES PTE LTD			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			25 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKS 7273C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER (SN)	DEFORMED	1,847.00	1,847.00
1	REAR BUMPER FIXING PARTS (SN)	NOT NECESSARY	191.00	-
2	REAR BUMPER GUIDE SECTION -LH/RH (SN)	NOT NECESSARY	32.00	-
2	REAR BUMPER LOCKING MECHANISM (SN)	* CHECK	59.00	-
1	REAR BUMPER GUIDE SECTION -RH (SN)	NOT NECESSARY	66.00	-
1	REAR FENDER RH TO A-PILLAR (SN)	BENT	3,436.00	3,436.00
1	REAR WINDSCREEN (SN)	NECESSARY	805.00	805.00
1	1/4 GLASS -RH (SN)	NECESSARY	563.00	563.00
1	PRIMER (SN)	NECESSARY	19.00	19.00
1	SILL TRIM STRIP -RH (SN)	* CHECK	69.00	-
1	SILL TRIM STRIP (SN)	* CHECK	125.00	-
1	WHEEL HOUSING LINER (SN)	* CHECK	237.00	-
1	WHEEL HOUSING LINER ATTACHMENT PARTS (SN)	* CHECK	88.00	-
1	REAR DOOR -RH (SN)	BENT	2,494.00	2,494.00
1	REAR DOOR OUTER SEAL -RH (SN)	NECESSARY	159.00	159.00
1	BONDING AGENT (SN)	NECESSARY	47.00	47.00
1	CLEANING SOLUTION (SN)	NECESSARY	65.00	65.00
1	APPLICATOR (SN)	NECESSARY	7.00	7.00
1	REAR DOOR CATCH (SN)	NECESSARY	93.00	93.00
1	REAR DOOR SEAL INNER (SN)	NECESSARY	189.00	189.00
1	REAR DOOR HINGE -RH UPPER (SN)	* CHECK	77.00	-
1	REAR DOOR HINGE HALF UPPER PART -RH LOWER (SN)	* CHECK	46.00	-
1	FRONT DOOR HINGE HALF LOWER PART -RH LOWER (SN)	* CHECK	75.00	-
1	EXTERIOR REAR DOOR HANDLE -RH (SN)	* CHECK	359.00	-
1	DOOR HANDLE HOUSING -RH (SN)	SCRATCHED	51.00	51.00
1	REAR DOOR MOUNTING BAR -RH (SN)	* CHECK	156.00	-
1	DOOR RELEASE CABLE (SN)	* CHECK	50.00	-
1	WINDOW REGULATOR -RH (SN)	* CHECK	246.00	-
1	SET DOOR WIRING (SN)	* CHECK	330.00	-

Report Ref No. CC4/LPC20014816/R1ea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	WINDOW SLOT SEAL -RH REAR (SN)	NOT NECESSARY	292.00	-
1	C-PILLAR TRIM -RH (SN)	NECESSARY	114.00	114.00
1	B-PILLAR TRIM -RH (SN)	NECESSARY	115.00	115.00
1	FRONT DOOR -RH (SN)	BENT	2,494.00	2,494.00
1	FRONT DOOR OUTER SEAL -RH (SN)	NECESSARY	159.00	159.00
1	BONDING AGENT (SN)	NECESSARY	47.00	47.00
1	CLEANING SOLUTION (SN)	NECESSARY	65.00	65.00
1	FRONT DOOR ATTACHMENT PARTS (SN)	* CHECK	238.00	-
1	FRONT DOOR CATCH (SN)	NECESSARY	104.00	104.00
1	FRONT DOOR SEAL INNER (SN)	NECESSARY	159.00	159.00
2	FRONT DOOR HINGE -UPPER /LOWER (SN)	* CHECK	154.00	-
1	EXTERIOR FRONT DOOR HANDLE -RH (SN)	* CHECK	359.00	-
1	FRONT DOOR HANDLE CAP -RH (SN)	MISSING	53.00	53.00
1	FRONT DOOR SLIDE VALVE -RH (SN)	* CHECK	22.00	-
1	FRONT DOOR LOCK CYLINDR -RH (SN)	* CHECK	517.00	-
2	FRONT UNDERLAY -RIGHT FRONT /REAR (SN)	* CHECK	11.00	-
1	FRONT DOOR MOUNTING BAR -RH (SN)	* CHECK	155.00	-
1	FRONT DOOR RELEASE CABLE (SN)	* CHECK	50.00	-
1	EXTERIOR MIRROR MOUNTING -RH (SN)	CRACKED	1,013.00	1,013.00
1	MIRROR CAP -RH (SN)	CRACKED	148.00	148.00
1	MIRROR GLASS -RH (SN)	NOT NECESSARY	1,644.00	-
1	CORNER TRIM -RH (SN)	SCRATCHED	45.00	45.00
1	WINDOW GUIDE TRIM STRIP -RH (SN)	* CHECK	254.00	-
1	B-PILLAR TRIM -RH (SN)	NECESSARY	103.00	103.00
1	WINDOW SLOT SEAL -RH FRONT (SN)	SCRATCHED	305.00	305.00
1	WINDOW REGULATOR -RH (SN)	* CHECK	261.00	-
1	FRONT DOOR PANEL TRIM COVER (SN)	NOT NECESSARY	13.00	-
1	SET FRONT DOOR WIRING (SN)	* CHECK	571.00	-
1	TYRE PRESSURE DATA PLATE (SN)	NECESSARY	28.00	28.00
1	DATA TAG (SN)	NECESSARY	457.00	457.00
1	FRONT FENDER -RH (SN)	BENT	841.00	841.00
1	FRONT FENDER ATTACHMENT PARTS (SN)	* CHECK	71.00	-
1	FRONT FENDER BRACKET -RH (SN)	NOT NECESSARY	38.00	-

Report Ref No. CC4/LPC20014816/R1ea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT FENDER BRACKET -RH (SN)	NOT NECESSARY	27.00	-
1	FRONT FENDER BRACKET -RH (SN)	NOT NECESSARY	27.00	-
1	FRONT FENDER BRACE -RH (SN)	* CHECK	95.00	-
1	FRONT FENDER CLOSING ELEMENT -RH (SN)	NOT NECESSARY	33.00	-
1	FRONT FENDER INSULATOR -RH (SN)	NOT NECESSARY	42.00	-
1	WHEEL HOUSING LINER -RH (SN)	* CHECK	167.00	-
1	WEHEL HOUSING LINER ATTACHMENT PARTS (SN)	* CHECK	88.00	-
1	FRONT BUMPER (SN)	DEFORMED	1,987.00	1,987.00
1	FRONT BUMPER FIXING PARTS (SN)	* CHECK	185.00	-
1	FRONT BUMPER GUIDE SECTION -RH (SN)	* CHECK	38.00	-
1	FRONT BUMPER AIR GUIDE GRILLE -RH (SN)	NOT NECESSARY	108.00	-
2	FRONT ALUMINIUM RIM -RH (SN)	SCRATCHED	1,397.00	1,397.00
1	FRONT TRACK CONTROL ARM -RH LOWER (SN)	* CHECK	363.00	-
1	FRONT WHEEL BEARING HOUSING (SN)	* CHECK	563.00	-
1	FRONT WHEEL BEARING (SN)	* CHECK	485.00	-
1	FRONT GAS SHOCK ABSORBER (SN)	* CHECK	259.00	-
1	FRONT GUIDE JOINT -RH (SN)	* CHECK	120.00	-
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	200.00	200.00
1	1/4 GLASS SEALANT (SN)	NECESSARY	100.00	100.00
1	METAL FILLER POWDER (SN)	NECESSARY	280.00	280.00
1	STONE CHIP (SN)	NECESSARY	180.00	180.00
1	CAVITY WAX (SN)	NECESSARY	140.00	140.00
1	ACRYLIC SEALANT (SN)	NECESSARY	180.00	180.00
1	SUNDRIES (SN)	* CHECK	500.00	-
			30,445.00	20,489.00
	LABOUR			
	TO REMOVE ,CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS ,HORNS ,OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY .		280.00	280.00
	TO DISMANTLE AND RENEW FRONT BUMPER AND RHS FRONT FENDER .RE-ORGANISE CRASH MANAGEMENT COMPONENTS .REINSTALL ALL PARTS REMOVED.		2,100.00	1,400.00
	TO RESPRAY FRONT BUMPER AND RHS FRONT FENDER .		2,000.00	1,500.00

Report Ref No. CC4/LPC20014816/R1ea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE AND TRANSFER REAR PARKING AID .CHECK FUNCTION AND RENEW ACCORDING TO DAMAGE .		280.00	280.00
	TO RENEW REAR WINDSCREEN AND 1/4 GLASS TO FACILITATE FENDER RENEWAL .		600.00	600.00
	TO INSTALL SOLAR FILM FOR REAR WINDSCREEN AND 1/4 GLASS .		400.00	400.00
	TO CARRY OUT WATER SEEPAGE TEST FOR REAR WINDSCREEN .		200.00	200.00
	TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS ,BATTERY MANAGER ,FUSE AND RELAY TRAYS ,ELECTRICAL AND AUDIO EQUIPMENT.		1,400.00	1,400.00
	TO REMOVE AND REINSTALL REAR SEAT ,BACK REST ,HAT TRAY ABCD PILLAR TRIMS ,LUGGAGE COMPARTMENT TRIMS ,DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIRBAG ETC.		1,400.00	1,400.00
	TO REMOVE AND TRANSFER RHS FRONT DOOR AND RHS REAR DOOR'S MULTI LOCK SYSTEM AND POWER WINDOW DEVICES .INSPECT FOR DAMAGES.		560.00	560.00
	TO DISMANTLE AND RENEW REAR BUMPER ,RHS REAR DOOR AND RHS FRONT DOOR CUT OUT AND WELD RHS REAR FENDER ,RHS SILL PANEL ,RHS B-PILLAR AND RHS A-PILLAR ,RE-ORGANIZE CRASH MANAGEMENT COMPONENTS .REINSTALL ALL PARTS REMOVED.		9,800.00	9,100.00
	TO RESPRAY REAR BUMPER ,RHS REAR FENDER ,RHS REAR DOOR ,RHS FRONT DOOR ,RHS WING MIRROR COVER ,RHS B-PILLAR ,RHS A-PILLAR ,RHS SILL PANELL,DOOR ENTRANCE ,ROOF CHANNEL ,DRAIN PANEL AND END PANELLING .TO CARRY OUT STONE CHIP TREATMENT AND JOINT SEALER WORKS.		7,950.00	7,150.00
	TO CARRY OUT PRE-WHEEL ALIGNMENT AND POST WHEEL ALIGNMENT .TO RENEW RHS FRONT RIM AND RHS REAR RIM .		560.00	560.00
	TO REMOVE AND RENEW RHS FRONT WHEEL SUSPESNION ASSY .	* CHECK	1,800.00	-
	TO CARRY OUT FIRST MEASUREMENT TEST ON CAR-O-LINER .	* CHECK	800.00	-
	TO PUT VEHICLE ON CAR-O-LINER TO FACILITATE THE REPAIR .	* CHECK	2,400.00	-
	TO TOW BACK THE VEHILE FRONT ACCIDENT SCENE.	* CHECK	280.00	-
	TO CARRY OUT PRE-DIAGNOSTIC CHECK AND POST DIAGNOSTIC CHECK.		384.00	192.00

Report Ref No. CC4/LPC20014816/R1ea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
			33,194.00	25,022.00
GRAND TOTAL			63,639.00	45,511.00
RECOMMENDED COST OF REPAIRS (REPAIR COST NOT CONCLUDE) (EXCLUDE CHECK ITEMS S\$12,739.00 NETT)				45,511.00

Report Ref No. CC4/LPC20014816/R1ea3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKS 7273C

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

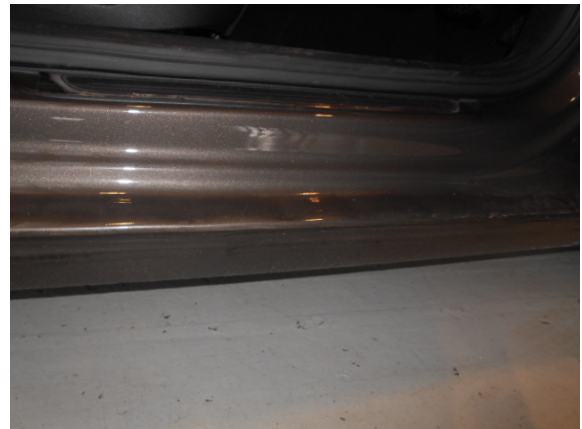



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

