



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2104322

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 17/06/2021
Reference CC6/CTI21000105/Qra3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLS 2057G
Insured Veh. SJC 4726D
Claim No. SNM21D200049
Policy No. DMPCSNA0017362002
Accident Date 01/01/2021
Inspection Date 04/01/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21000105/Qra3q2 Date: 17/06/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SJC 4726D	Veh. Inspected	SLS 2057G	
Policy No.	DMPCSNA0017362002	Coverage (\$)	0.00	
Claim No.	SNM21D200049	Excess (\$)	0.00	
Assign From		Assign Date	04/01/2021	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI ELANTRA AD	c.c	1591	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	KMHD841CMJU537709	Colour	ORANGE	
Odometer	72391 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	YOKOHAMA	6 mm	
L/H Front Tyre	195/65 R15	YOKOHAMA	6 mm	
R/H Rear Tyre	195/65 R15	YOKOHAMA	6 mm	
L/H Rear Tyre	195/65 R15	YOKOHAMA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT & REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	01/01/2021	Inspection Date	04/01/2021	
Survey held at	AUTOMOTIVE REPAIR CENTRE PTE LTD 38 WOODLANDS INDUSTRIAL PARK E1 # 05-18 SINGAPORE 757700			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLS 2057G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	CRUMPLED	580.00	474.40
10	FRONT BUMPER CLIP @\$5.00	NECESSARY	50.00	30.00
1	FRONT BUMPER RETAINER RH	SERVICEABLE	40.00	-
1	FRONT BUMPER RETAINER LH	SERVICEABLE	40.00	-
1	FRONT REINFORCEMENT	SERVICEABLE	700.00	-
1	FRONT SPONGE /ABSORBER	CRUMPLED	180.00	180.00
1	FRONT LICENSE GARNISH	SCRATCHED	40.00	40.00
1	FRONT GRILLE ASSY	SCRATCHED	480.00	480.00
1	REAR BUMPER	CRUMPLED	580.00	580.00
10	REAR BUMPER CLIPS @\$5.00	NECESSARY	50.00	30.00
1	REAR BUMPER LOWER	CRUMPLED	280.00	280.00
1	REAR BUMPER UNDER COVER	SERVICEABLE	80.00	-
1	REAR BUMPER RETAINER RH	SERVICEABLE	50.00	-
1	REAR BUMPER RETAINER LH	SERVICEABLE	50.00	-
1	REAR BUMPER REFLECTOR RH	CRACKED	50.00	50.00
1	REAR BUMPER REFLECTOR LH	CRACKED	50.00	50.00
1	REAR REINFORCEMENT	BENT	300.00	300.00
1	REAR TAIL LAMP RH	NOT NECESSARY	400.00	-
1	REAR TAIL LAMP LH	CRACKED	400.00	400.00
2	REAR TAIL LAMP CLIPS @\$10.00	NECESSARY (1 PCS ONLY)	20.00	10.00
1	REAR HYUNDAI EMBLEM	NECESSARY	60.00	60.00
1	REAR ELANTRA EMBLEM	NECESSARY	60.00	60.00
1	REAR S EMBLEM	NECESSARY	50.00	50.00
1	REAR BOOT	DENTED	1,580.00	1,580.00
1	REAR BOOT HINGE RH	TO REPAIR SEE LABOUR	80.00	-
1	REAR BOOT HINGE LH	TO REPAIR SEE LABOUR	80.00	-
1	REAR BOOT LOWER LATCH	SERVICEABLE	30.00	-
1	REAR BOOT LOCK	JAMMED	130.00	130.00
1	REAR BOOT RUBBER SEAL	CRUMPLED	180.00	180.00

Report Ref No. CC6/CTI21000105/Qra3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR BOOT LAMP RH	SERVICEABLE	280.00	-
1	REAR BOOT LAMP LH	CRACKED	280.00	280.00
1	REAR /END PANEL GARNISH	CRUMPLED	100.00	100.00
1	END PANEL	DENTED	380.00	380.00
1	END PANEL INNER BRACKET	SERVICEABLE	80.00	-
1	REAR SPARE TYRE TOP BOARD	SERVICEABLE	120.00	-
1	REAR SPARE TIRE SINK	TO REPAIR SEE LABOUR	380.00	-
1	REAR EXHAUST MUFFLER	SERVICEABLE	680.00	-
2	REAR EXHAUST MUFFLER BUSH @\$30.00	SERVICEABLE	60.00	-
1	REAR ANTENNA DEVICE (ADDITIONAL)	CRACKED	70.00	70.00
	LESS 20% DISCOUNT		-	-1,158.88
			9,100.00	4,635.52
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT NUMBER PLATE WITH FRAME (SN)	DENTED	40.00	40.00
1	REAR NUMBER PLATE WITH FRAME (SN)	SERVICEABLE	40.00	-
1	REVERSE SENSOR (SN)	SHORTED	200.00	200.00
			280.00	240.00
	<u>LABOUR</u>			
	SPRAY PAINTING WHOLE FRONT AND WHOLE REAR .		1,800.00	800.00
	REMOVE AND REFIT FRONT & REAR AFFECTED AREA.INCLUSIVE OF THE REPAIR OF REAR BOOT HINGE RH ,REAR BOOT HINGE LH AND REAR SPARE TIRE SINK .		1,800.00	1,000.00
	REMOVE AND REFIT REAR BUMPER REVERSE SENSOR .		80.00	30.00
	REMOVE AND REFIT REAR EXHAUST PIPE AND SILENCER ,RE-ALIGN .	NOT NECESSARY	80.00	-
	APPLY RUST PROOFING ON REPLACED/ REPAIRED PANEL.		100.00	40.00
	CHECK AND RECTIFY ELECTRICAL WIRING .		30.00	30.00
			3,890.00	1,900.00
	GRAND TOTAL		13,270.00	6,775.52

Report Ref No. CC6/CTI21000105/Qra3q2



RECOMMENDED COST OF REPAIRS			6,775.52
-----------------------------	--	--	----------

Report Ref No. CC6/CTI21000105/Qra3q2

OI SUN PIN

Asst. Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLS 2057G

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

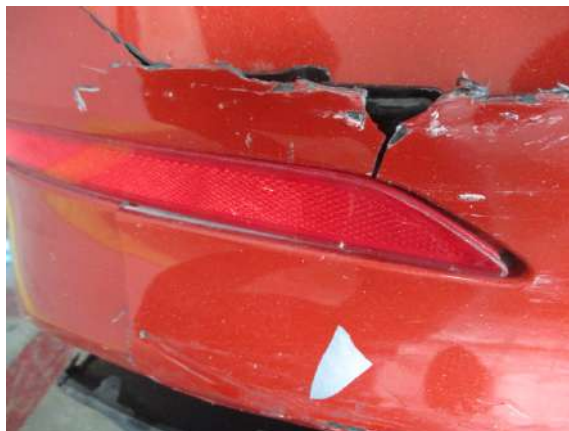



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLS 2057G

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

