



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2106144
3 ANSON ROAD #16-00	INV Date	02/09/2021
SPRINGLEAF TOWER	Reference	CC6/CTI21000184/Aea3q2
SINGAPORE 079909	Code	CTI

### PROFESSIONAL SERVICE FEE

Vehicle No.	SME 4972M
Insured Veh.	GBC 3487U
Claim No.	SNM21D200200/C02
Policy No.	DMCVSNW00118232000
Accident Date	31/12/2020
Inspection Date	06/01/2021

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (7%)</b>	<b>28.00</b>
<b>Grand Total</b>	<b>428.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD  
3 ANSON ROAD #16-00  
SPRINGLEAF TOWERSINGAPORE 079909

Ref: CC6/CTI21000184/Aea3q2

Date: 02/09/2021

Code: CTI

### 1. Policy Particulars :- THIRD PARTY CLAIM

<b>Insured Veh.</b>	GBC 3487U	<b>Veh. Inspected</b>	SME 4972M
<b>Policy No.</b>	DMCVSNW00118232000	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	SNM21D200200/C02	<b>Excess (\$)</b>	0.00
<b>Assign From</b>		<b>Assign Date</b>	06/01/2021

### 2. Vehicle Particulars & Condition

<b>Make &amp; Model</b>	HYUNDAI ELANTRA	<b>c.c</b>	1591
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2018
<b>Chassis No.</b>	KMHD841CMJU757132	<b>Colour</b>	WHITE
<b>Odometer</b>	35576 KM	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	SPORTS RIM
<b>General</b>	GOOD		

### 3. Conditions of Tyres

	Size	Make	Balance
<b>R/H Front Tyre</b>	195/65 R15	NEXEN	6 mm
<b>L/H Front Tyre</b>	195/65 R15	NEXEN	6 mm
<b>R/H Rear Tyre</b>	195/65 R15	NEXEN	6 mm
<b>L/H Rear Tyre</b>	195/65 R15	NEXEN	6 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY.  
DAMAGES SEE DETAILS.

### 5. General Information

<b>Accident Date</b>	31/12/2020	<b>Inspection Date</b>	06/01/2021
<b>Survey held at</b>	CAS GARAGE PTE LTD NO. 1 KAKI BUKIT AVE 6, #02-22 AUTOBAY 417883 KAKI BUKIT		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.  
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **11 Working Days**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SME 4972M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>REPLACEMENT OF PARTS</b>				
1	FRONT RH DOOR	DENTED	1,904.70	1,904.70
1	FRONT RH DOOR SWITCH	NOT NECESSARY	14.50	-
1	FRONT RH DOOR OUTER HANDLE	NOT NECESSARY	188.10	-
1	FRONT RH DOOR OUTER HANDLE BRACKET	NOT NECESSARY	68.50	-
1	FRONT RH DOOR OUTER CHROME MOULDING	NOT NECESSARY	93.90	-
1	FRONT RH DOOR LOCK	NOT NECESSARY	191.50	-
1	FRONT RH DOOR LOCK CATCH	NOT NECESSARY	23.10	-
2	FRONT RH DOOR BLACK STICKER @\$14.80	NECESSARY	29.60	29.60
2	FRONT RH DOOR HINGES @\$59.80	LOWER BENT	119.60	59.80
1	FRONT RH DOOR WEATHERSTRIP	CUT	96.00	96.00
1	FRONT RH DOOR FRAME WEATHERSTRIP	NOT NECESSARY	119.20	-
1	FRONT RH DOOR INNER TRIM BOARD	CRACKED	756.90	462.00
1	FRONT RH DOOR REGULATOR MOTOR	NOT NECESSARY	267.80	-
1	FRONT RH DOOR REGULATOR GEAR	DAMAGED	280.40	280.40
1	FRONT RH DOOR CHANNEL SEAL	NOT NECESSARY	140.60	-
2	FRONT RH DOOR STOPPERS @\$8.60	NOT NECESSARY	17.20	-
1	FRONT RH DOOR LOCK MECHANISMS	DAMAGED	234.00	234.00
1	FRONT RH DOOR STEP GARNISH	NOT NECESSARY	29.80	-
1	FRONT RH DOOR SIDE MIRROR ASSY	NOT NECESSARY	638.60	-
1	FRONT DOOR PILLAR (INNER)	DAMAGED	498.00	498.00
1	CENTER PILLAR RH	DENTED	3,919.20	805.00
1	CENTER PILLAR GARNISH TOP RH	NOT NECESSARY	62.50	-
1	CENTER PILLAR GARNISH BOTTOM RH	NOT NECESSARY	55.90	-
1	FRONT BUMPER	TO REPAIR SEE LABOUR	474.40	-
1	FRONT FENDER RH	DENTED	1,227.70	985.00
1	FRONT FENDER INNER COWLING RH	TORN	85.70	85.70
1	FRONT FENDER MUDFLAP RH	NOT NECESSARY	35.00	-
1	FRONT SHOCK ABSORBER RH	BENT	392.50	392.50
1	FRONT SHOCK ABSORBER TOP MOUNTING RH	NOT NECESSARY	128.90	-
1	FRONT LOWER ARM RH	BENT	296.80	296.80

Report Ref No. CC6/CTI21000184/Aea3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT KNUCKLE ARM RH	DAMAGED	363.60	363.60
1	FRONT WHEEL BEARING RH	NECESSARY	452.80	452.80
1	FRONT TIE ROD	NOT NECESSARY	116.50	-
1	FRONT TIE ROD END	NOT NECESSARY	73.50	-
1	FRONT STABILIZER BAR	NOT NECESSARY	246.80	-
1	FRONT STABILIZER BAR LINKAGE	NOT NECESSARY	75.50	-
1	REAR BUMPER	TO REPAIR SEE LABOUR	459.40	-
1	REAR RH DOOR	DENTED	1,878.30	1,575.00
1	REAR RH DOOR OUTER HANDLE	NOT NECESSARY	68.80	-
1	REAR RH DOOR CHROME OUTER MOULDING	NOT NECESSARY	85.10	-
3	REAR RH DOOR BLACK STICKER @\$14.80	NECESSARY	44.40	44.40
1	REAR RH DOOR LOCK	NOT NECESSARY	191.50	-
1	REAR RH DOOR LOCK CATCH	NOT NECESSARY	23.10	-
2	REAR RH DOOR HINGES @\$59.80	LOWER BENT	119.60	59.80
1	REAR RH DOOR WEATHERSTRIP	CUT	116.20	116.20
1	REAR RH DOOR FRAME WEATHERSTRIP	NOT NECESSARY	105.80	-
1	REAR RH DOOR INNER TRIM BOARD	CRACKED	613.60	613.60
2	REAR RH DOOR STOPPERS @\$8.60	NOT NECESSARY	17.20	-
1	REAR RH DOOR REGULATOR MOTOR	NOT NECESSARY	267.80	-
1	REAR RH DOOR REGULATOR GEAR	NECESSARY	280.40	280.40
1	REAR RH DOOR CHANNEL SEAL	NOT NECESSARY	140.60	-
1	REAR RH DOOR CHECKER	NOT NECESSARY	78.30	-
1	REAR RH DOOR STEP GARNISH	NOT NECESSARY	29.80	-
1	SIDE ROCKER PANEL RH	DENTED	1,799.60	1,799.60
1	REAR FENDER RH	TO REPAIR SEE LABOUR	1,892.00	-
1	REAR SHOCK ABSORBER RH	NOT NECESSARY	230.50	-
1	REAR WHEEL BEARING RH	NOT NECESSARY	454.00	-
2	SPORT RIMS @\$671.30	CUT	1,342.60	1,342.60
	LESS 20% DISCOUNT		-4,791.58	-2,555.50
			19,166.32	10,222.00

Report Ref No. CC6/CTI21000184/Aea3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>SPECIAL NETT ITEMS</b>				
1	SET FRONT BUMPER CLIPS (SN)	NOT NECESSARY	50.00	-
1	SET FRONT FENDER INNER COWLING CLIPS (SN)	NECESSARY	30.00	30.00
1	SET REAR BUMPER CLIPS (SN)	NOT NECESSARY	50.00	-
1	SET REAR FENDER INNER COWLING CLIPS (SN)	NOT NECESSARY	30.00	-
			160.00	30.00
<b>LABOUR</b>				
	TO REMOVE AND REPLACE ACCIDENT AFFECTED PORTION. INCLUSIVE OF THE REPAIR OF FRONT BUMPER, REAR BUMPER AND REAR FENDER RH.		2,600.00	1,400.00
	TO RESPRAY ACCIDENT AFFECTED PORTION.		2,800.00	1,600.00
	TO TUFF COAT AFFECTED AREAS.		200.00	100.00
	TO APPLY SEALANT AND UNDER COATING TO THE AFFECTED AREAS.		250.00	100.00
	TO CONDUCT WIRING CHECK.		80.00	30.00
	TO CONDUCT WATER LEAK TEST.	NOT NECESSARY	120.00	-
	TO REMOVE AND REPLACE BOTH DOORS PARTS.		360.00	160.00
	TO REMOVE AND REPLACE FRONT & REAR UNDERCARRIAGE.		600.00	220.00
	TO PERFORM WHEEL ALIGNMENT CHECK.		180.00	80.00
	TO REMOVE AND REFIT RH INTERIOR UPHOLSTERY.		280.00	80.00
	TO PERFORM RESET ON THE POWER WINDOW MODULE AND SETTING.	NOT NECESSARY	160.00	-
	TO RESET AND REPROGRAM FAULT CODE.		180.00	100.00
			7,810.00	3,870.00
<b>GRAND TOTAL</b>			<b>27,136.32</b>	<b>14,122.00</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>11,300.00</b>

Report Ref No. CC6/CTI21000184/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



# LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SME 4972M

INSPECTION

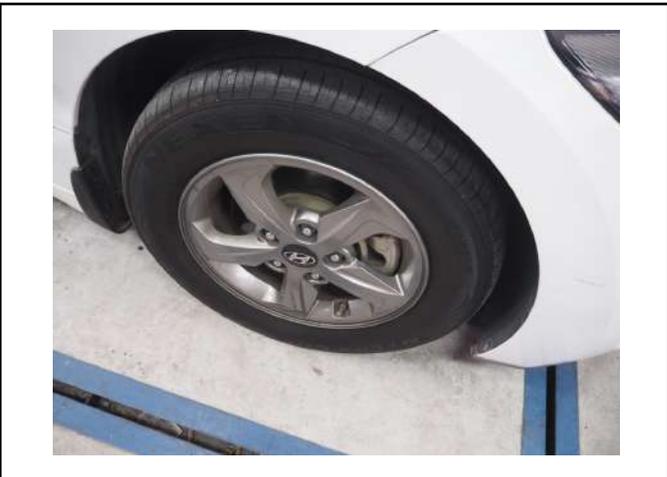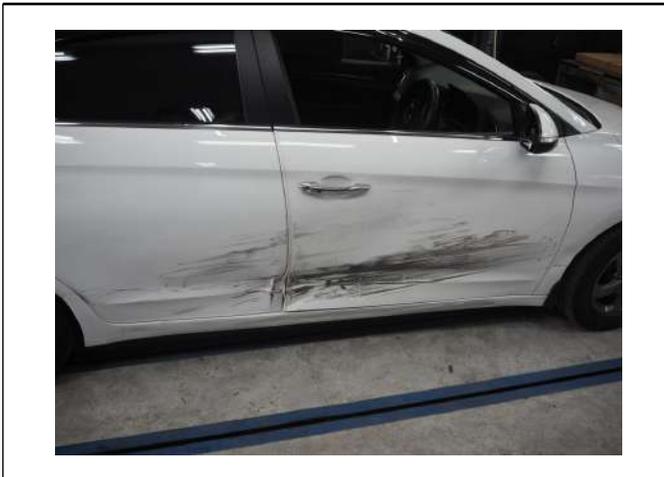




## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

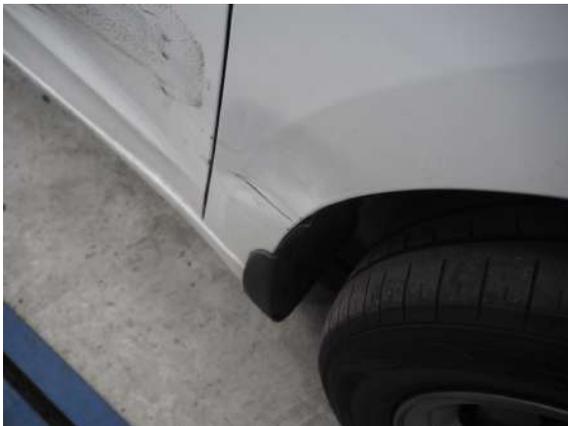



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SME 4972M

RE-INSPECTION

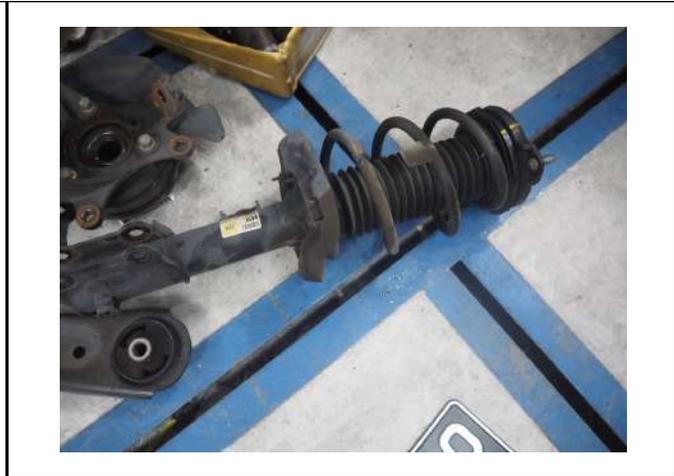



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

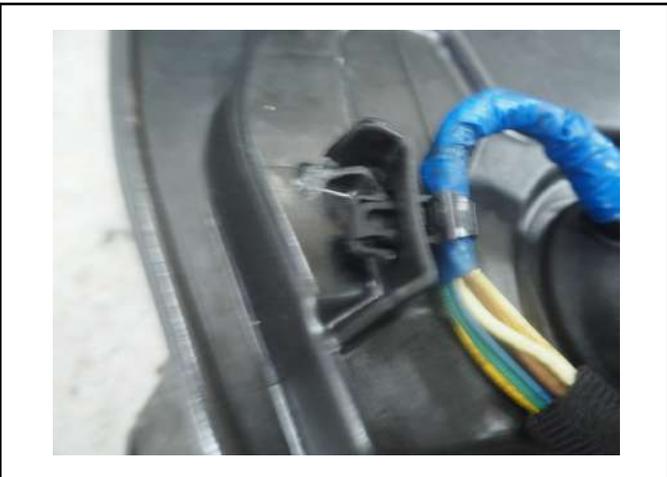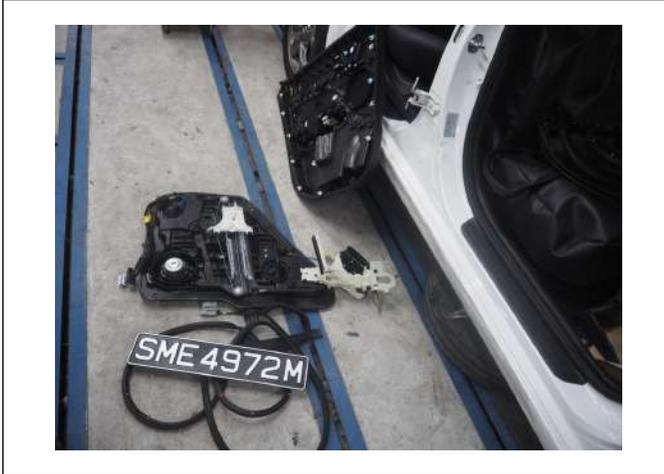





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

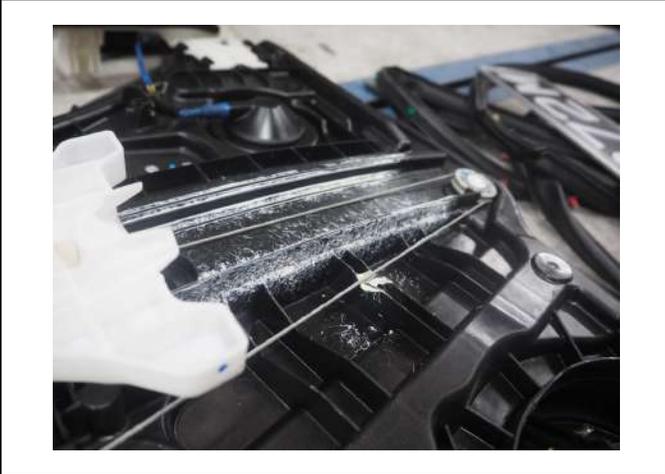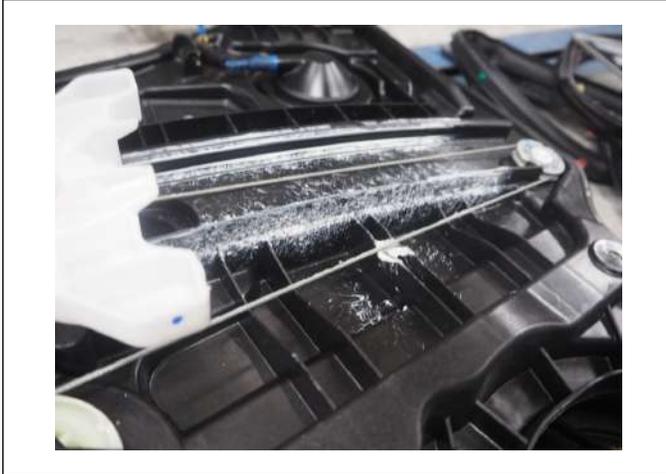





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

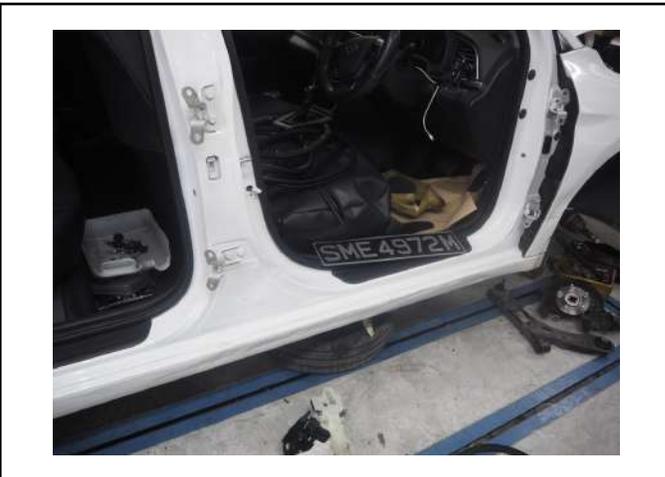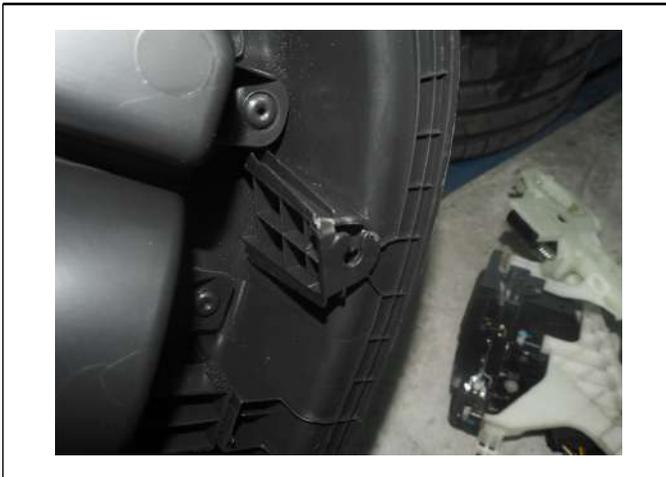



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

