

SURVEYOR COPY

AH LIM Motor Company
#01-09, AMK Autopoint, 10 Ang Mo Kio
Ind. Park 2A
568047

Insurer Reference:
Repairer Reference: 038581
Date calculated: 04/01/2021 2:49 PM

Full Report
Registration: SMG9334L
Printed: 04/01/2021 2:49 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	India International Insurance
Printed by:	Kee Mui Hong	Currency:	SGD
Claim Reference:		Date of Incident:	27/12/20
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer: MAZDA
Model: 6 (GJ)
Sub Model: BASE MODEL
Model Sheet Number: 36 66 01
Registration: SMG9334L
VIN number:
Odometer:

Model Specs

FROM 05/2016 XENON HEADLAMPS FRONT DRIVE TWO COAT METALLIC
PREPARE OFF VEHICLE


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

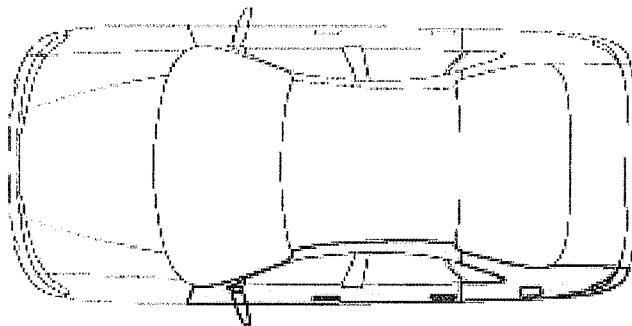

Labour

Code	Description	Time Base 10 WU/h	Price = 45.00 SGD/h	
			WU	Price SGD
S2201B-R-X)	R + R L/HEAD AIRBAG		2.0	9.00
S1101B-R-X	RENEW L/R DOOR INCLUDES: R + R REAR DOOR, CONVERT ALL ATTACHED PARTS, ADJUST DOOR		16.0	72.00
NO NUMBER	R + R BOOTLID		4.0	18.00
S1402X-R-X	R + R REAR SCREEN		21.0	94.50
NO NUMBER	R + R REAR BUMPER INCLUDES: R + R BOTH TAILLAMPS		4.0	18.00
NO NUMBER	RENEW L/R SIDE PANEL		95.0	427.50
NO NUMBER	DETACH + REFIT FLOOR CARPET		4.0	18.00
S1701X-R-X)	R + R HEADLINING INCLUDES: R + R SUN VISORS, ROOF GRAB HANDLES, ROOF INTERIOR LAMP AND UPPER PILLAR TRIMS		14.0	63.00
Q0103A-R-X)	RENEW L/R WHEEL (REMOVED)		3.0	13.50
F0503X-R-X)	R + R FILLER PIPE OR FILLER TUBE		7.0	31.50
1481	LEFT FRONT DOOR REPAIR		30.0*	135.00
2279	L/B-PILLAR/SILL REPAIR		30.0*	135.00
Labour Cost		Hrs	WU	
Panel / Mechanical Labour		23.00	230.0	1,035.00
Total of Labour				1,035.00

Paint

Paint Work		SYSTEM AZT	Time Basis 10 WU/h	
Code	Description - TWO COAT METALLIC		WU	Price SGD
	L/R DOOR NEW PART PAINTING		15.0	
	L/R SIDE PANEL NEW PART PAINTING		31.0	
	L/F WING REPAIR PAINTING <50%		12.0	
	LEFT FRONT DOOR REPAIR PAINTING <50%		17.0	
	L/B-PILLAR/SILL REPAIR PAINTING <50%		19.0	

Paint Material Per Part

Code	Description	Price SGD
1781	L/R DOOR NEW PART PAINTING	39.73
3481	L/R SIDE PANEL NEW PART PAINTING	43.45
0741	L/F WING REPAIR PAINTING <50%	14.86
1481	LEFT FRONT DOOR REPAIR PAINTING <50%	28.42
2279	L/B-PILLAR/SILL REPAIR PAINTING <50%	33.92



Labour Cost - Paint		Hrs	WU	Price SGD
Factor	45.00 SGD/h			
Time Paint			94.0	
Preparation Main Work Metal		2.50	25.0	112.50
Total	10 WU/h	11.90	119.0	535.50


Material Cost - Paint		Price SGD
New Part Painting		83.18
Repair Painting		77.20
Material-constant Metal Preparation		28.60
Total		188.98

Spare Parts

				prices as at 2015-06-01/01
Code	Description	Part Number	Part Source	Price SGD
1781	L/R DOOR	GHY17302XB	Original	1,312.10
1813	L/R UPP DOOR STRIPE	GHK150995H	Original	70.00
1959	L/R DOOR FRONT STRIP	GHP950M40D		0.00
1961	L/R UPP DOOR MLDG	GHK150670E		0.00
1963	L/R DOOR REAR STRIP	GJR950M60A		0.00
3160	REAR SCREEN BOND KIT	KNGKWI2		0.00
3161	REAR SCREEN SEAL	GHK150611B	Original	117.10
3481	L/R SIDE PANEL	GHY37141X	Original	1,247.00
9551	L/R WHEEL	9965077570CN	Original	430.00
1000	RR DOOR TAPE	X1	Original	14.00
f: OEM Parts	Savings			0.00
n: Non-OEM Parts	Subtotal			3,190.20
u: Used parts	Addition(+10.00%)			319.02
	Total			3,509.22

Extras

Code	Description	Price SGD
1001	WHEEL ALIGNMENT	80.00*
1002	TO REINSTALL RR W/S	120.00*
1003	TRANSF DOOR FITTINGS	90.00*
1004	REINSTALL CUSHION	90.00*
	Total Extras	380.00

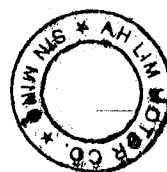

Final Calculation

	SGD	SGD
Parts	3,190.20	
Addition(+10.00%)	319.02	
Total Parts		3,509.22
Labour Time Base 10 WU/h		
Total 230.0 WU X 45.00 SGD/h	1,035.00	
Total of Labour		1,035.00
Total Of Extras		380.00
Paint Work Time Base 10 WU/h		
Labour Cost 119.0 WU X 45.00 SGD/h	535.50	
Material Cost	188.98	
Total Paint Including Material		724.48
Repair Cost Excludes GST		5,648.70
GST (+7.0%)		395.41
Repair Cost Included GST		6,044.11

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.



[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	805C
Vehicle Details	
Vehicle No.:	SMG9334L
Vehicle to be Exported:	Yes
Intended Deregistration Date:	05 Jan 2021
Vehicle Make:	MAZDA
Vehicle Model:	MAZDA6 4-DOOR SEDAN 2.5L SP,6EAT SR LED
Primary Colour:	Red
Manufacturing Year:	2016
Engine No.:	PY20832885
Chassis No.:	JM6GL1031H0102303
Maximum Power Output:	141.0 kW (189 bhp)
Open Market Value:	\$28,358.00
Original Registration Date:	13 Dec 2016
First Registration Date:	13 Dec 2016
Transfer Count:	1
Actual ARF Paid:	\$31,702.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	12 Dec 2026
PARF Rebate Amount:	\$23,776.00
Intended COE Rebate Details	
COE Expiry Date:	12 Dec 2026
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$46,229.00
COE Rebate Amount:	\$27,439.00
Total Rebate Amount:	\$51,215.00

The information contained herein is correct as at 29 Dec 2020

OK

Enquire Vehicle's Insurance Particulars

Thank You!

The insurance details of the vehicle you enquired can be found below. If you have entered a valid email address, a copy would have been sent to you.

Vehicle No.	Incident Date/Time	Insurance Company Name
SHD2733P	27 Dec 2020 / 18:20:00	INDIA INT'L INS PTE LTD

Save as PDF

OK →

Print