

ASS. REC. BY:

Sun Pin

REF:

NTYC

ASSIGNMENT

From:

Date:

Estimated Cost:

QD/TP/WS/TP RES/QD RES/EVA/INV/MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No. 5119698435

Claims No. MT/1116187-002

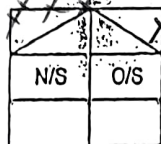
Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Lump Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SHF3 R

Yr Regn: 03/11/2017

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toyota Prius 4

c.c 1795

Colour:

Maroon

A/C: Insured / Std / NI / NA

Sp. Reading

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

JTDKB3FU963573735

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size:

F: 195 / 65 R15

R: 195 / 65 R15

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Touring

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

30/12/2020

D.O.I.

04/01/2021

Survey held at

SMRT

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

TP

TAX/12/20/2076

SGZ 5718K.

Finalize amount \$20,900. Repair day 11 days. (L/S, before gst).

red:38403.64%

59303.64

Date/Time, File Pass to?



Prell. Report

1)



Final Report

Date/Time, File Return to?

2)

Days Of Repair: 11

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS SJ

Phone

Others

TOTAL

Add Fee:



Site Insp (\$



Interview (\$



Tech. Invs (\$



Weekend (\$

Report Form:

Lump Sum / L/S / C

(N-tuc)

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	02/01/2021 08:21 (SGT)
Date of Accident	30/12/2020 19:40 (SGT)
Exact Location of Accident	Jurong East Street 21, Singapore
Additional Location Information	JUNCTION OF JURONG EAST ST 21 & JURONG GATEWAY
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHF3R
-----------------------------	-------

INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	SMRT TAXIS PTE LTD
Company Reg No	1XXXXX369K
Email Address	tARC@SMRT.COM.SG
Mobile Phone No	(Phone) +65-68662671
Alternative Phone No	(Office) +65-68662672

VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Prius
Variant	-
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Taxi

INSURANCE COMPANY

Name of Insurance Company	First Capital
Type of Coverage	ThirdParty
Fleet Policy	Yes
Policy Number	D-20095484MFSH
Cover Note Number	-

DRIVER

Name of Driver	CHOO BOOK GUAN
NRIC No	SXXXXX087F
Date Of Birth	08/07/1950
Occupation	Outdoor

Driving Pass	23/10/1978
Driving experience	42 YEARS AND 2 MONTHS
Gender	Male
Mobile Number	(Phone) +65-68662672
Alt. Phone Number	-
Email Address	TARC@SMRT.COM.SG
Address	11
Address complement	-
Postcode	-
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Hirer
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Cross Junction
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other material or property damaged?	Yes
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

PASSENGER 1

Name	UNKNOWN
Gender	Male

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

ON 30/12/20 AT ABOUT 0740PM. I WAS ALONG JURONG EAST ST 21 WITH A PASSENGER. I STOP MY VEHICLE AT JUNCTION OF JURONG EAST ST 21 & JURONG GATEWAY RD. I SAW TRAFFIC LIGHT TURN GREEN ARROW I STARTED TO RIGHT. SUDDENLY A VEHICLE SGZ5718K FROM OPPOSITE DIRECTION HIT ONTO FRONT LEFT PORTION OF MY VEHICLE. AT THE POINT OF THE ACCIDENT NO ONE WAS INJURED.

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SGZ5718K
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-

Category	Private car
Name of Driver	-
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

SKETCH PLAN**IMPORTANT NOTICE**

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

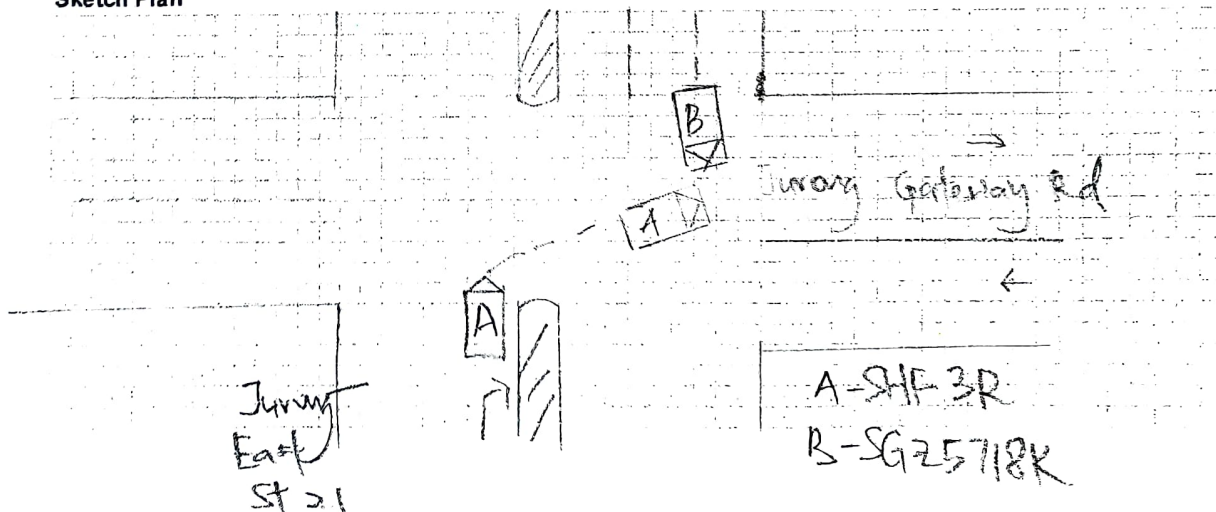
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
- (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.



Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan

Describe Circumstances of the Accident

[illegible]

Declaration

We declare the foregoing particulars are true in every respect.



Policyholder's Signature / Date &
Time

York 342-20

Driver's Signature (If driver is not the policyholder) / Date
& Time

A. 31/12/20

Witnessed by Reporting Centre
Personnel



Case Details

Case Reference Number :

TAX/12/20/2076

Type of Repair : Accident Repair

Vehicle Registration Number : SHF3R

Company Type : SMRT Taxis Pte Ltd

Estimation ID : EST-13579-ID

Assigned By : Taxi Claims Manager Team

Insurance Company Name : NTUC Income Insurance Co-operative Ltd

Accident Date and Time : 30/12/2020 11:40 AM

Vehicle Age(In Months) : 37

Documents / Photographs

View Documents / Photographs

Total Documents: 0

Estimation Details

Spare Part's Cost Detail

SMRT Recommendation										Surveyor Approval				
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			COVER, FR BUMPER	1	495.50	495.50	25.00	371.63	Replace	1	371.63	Replace	✓ CRU
One Time Key In	Main			SUPPORT, FR BUMPER RH	1	76.90	76.90	25.00	57.68	Replace	1	57.68	Replace	✓ BR
One Time Key In	Main			SUPPORT, FR BUMPER LH	1	82.30	82.30	25.00	61.72	Replace	1	61.73	Replace	✓ BR
One Time Key In	Main			COVER, FR BUMPER RH	1	28.10	28.10	25.00	21.08	Replace	1	21.08	Replace	✓ MIS
One Time Key In	Main			COVER, FR BUMPER LH	1	28.10	28.10	25.00	21.08	Replace	1	21.08	Replace	✓ MIS
One Time Key In	Main			BRACKET, FR BUMPER	1	99.80	99.80	25.00	74.85	Replace	1	74.85	Replace	✓ CRU
One Time Key In	Main			NUMBER PLATE	1	35.00	35.00	0.00	35.00	Replace	1	35.00	Replace	✓ MIS
One Time Key In	Main			NUMBER PLATE FRAME	1	25.00	25.00	0.00	25.00	Replace	1	25.00	Replace	✓ MIS
One Time Key In	Main			REINFORCEMENT FRONT UPPER	1	691.10	691.10	25.00	518.33	Replace	1	518.33	Replace	✓ BT

Total Spare Part Cost 44,066.09

Lump Sum Discount (%) 20.00

Final Spare Part Cost 35,252.87

Surveyor Total 16,107.74

Lump Sum Dis (%) 20

Final Sur Total 12,886.19

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			ABSORBER, FR BUMPER	1	70.30	70.30	25.00	52.72	Replace	1	52.72	Replace	✓ CNY
One Time Key In	Main			EXTENSION SUB-ASSY, LH	1	116.30	116.30	25.00	87.22	Replace	1	87.22	Replace	✓ BT
One Time Key In	Main			EXTENSION SUB-ASSY, RH	1	116.30	116.30	25.00	87.22	Replace	1	87.22	Replace	✓ BT
One Time Key In	Main			REINFORCEMENT FRONT LOWER	1	238.50	238.50	25.00	178.88	Replace	1	178.88	Replace	✓ BT
One Time Key In	Main			ABSORBER, FR BUMPER LOWER	1	117.00	117.00	25.00	87.75	Replace	1	87.75	Replace	✓ CNY
One Time Key In	Main			SEAL, HOOD TO FR END	1	24.40	24.40	25.00	18.30	Replace	1	18.30	Replace	✓ CNY
One Time Key In	Main			COVER, RADIATOR	1	227.80	227.80	25.00	170.85	Replace	1	170.85	Replace	✓ CNY
One Time Key In	Main			EMBLEM ASSY FRONT	1	87.10	87.10	25.00	65.32	Replace	1	65.32	Replace	✓ MTS
One Time Key In	Main			GRILLE, RADIATOR	1	165.00	165.00	25.00	123.75	Replace	1	123.75	Replace	✓ CNY
One Time Key In	Main			GRILLE SUB-ASSY	1	335.60	335.60	25.00	251.70	Replace	1	251.70	Replace	✓ CNY
One Time Key In	Main			CLIPS PIECE, FRT & RR BUMPER	10	1.50	15.00	25.00	11.25	Replace	10	11.25	Replace	✓ MTC
One Time Key In	Main			COVER ASSY, ENGINE	1	180.10	180.10	25.00	135.07	Replace	1	135.07	Replace	✓ CNY
One Time Key In	Main			COVER ASSY, ENGINE UNDER CENTER SET	1	452.80	452.80	25.00	339.60	Replace	0	0	Check	✓ SK
One Time Key In	Main			COVER, ENGINE UNDER CENTER	1	94.50	94.50	25.00	70.88	Replace	0	0	Check	✓ SK
One Time Key In	Main			COVER, ENGINE UNDER SIDE RH	1	76.90	76.90	25.00	57.68	Replace	0	0	Check	✓ SK

Total Spare Part Cost 44,066.09

Surveyor Total 16,107.74

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 35,252.87

Final Sur Total 12,886.19

BOM Type	Costing Type	Portion	Material Number	SMRT Recommendation							Surveyor Approval			
				Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			COVER, ENGINE UNDER SIDE LH	1	76.90	76.90	25.00	57.68	Replace	1	57.68	Replace	IVIS.
One Time Key In	Main			COVER, ENGINE UNDER, REAR	1	36.50	36.50	25.00	27.38	Replace	0	0	Check	X Suc
One Time Key In	Main			WINDSCREEN FRONT GLASS SUB-ASSY	1	1,626.40	1,626.40	25.00	1,219.80	Replace	1	1,219.	Replace	BR
One Time Key In	Main			SEALANT W/SCREEN	3	37.00	111.00	0.00	111.00	Replace	3	111.00	Replace	NEC
One Time Key In	Main			MOULDING RH	1	83.30	83.30	25.00	62.47	Replace	0	0	Check	X Suc
One Time Key In	Main			MOULDING LH	1	83.30	83.30	25.00	62.47	Replace	0	0	Check	X Suc
One Time Key In	Main			WIPER GARNISH LOUVER SUB-ASSY	1	666.90	666.90	25.00	500.17	Replace	0	0	Check	X Suc
One Time Key In	Main			WIPER GARNISH SHIELD, COWL WATER , RH	1	18.90	18.90	25.00	14.17	Replace	0	0	Check	X Suc
One Time Key In	Main			WIPER GARNISH SHIELD, COWL WATER , LH	1	18.90	18.90	25.00	14.17	Replace	0	0	Check	X Suc
One Time Key In	Main			SEAL, RADIATOR TO RH	1	24.80	24.80	25.00	18.60	Replace	0	0	Check	X Suc
One Time Key In	Main			SEAL, RADIATOR TO LH	1	24.80	24.80	25.00	18.60	Replace	0	0	Check	X Suc
One Time Key In	Main			GUIDE, RADIATOR AIR , RH	1	54.60	54.60	25.00	40.95	Replace	0	0	Check	X Suc
One Time Key In	Main			GUIDE, RADIATOR AIR , LH	1	58.80	58.80	25.00	44.10	Replace	0	0	Check	X Suc
One Time Key In	Main			RADIATOR ASSY	1	1,841.10	1,841.10	25.00	1,380.82	Replace	1	1380.83 1,380.	Replace	CRQ
One Time Key In	Main			FAN RADIATOR , RH	1	233.00	233.00	25.00	174.75	Replace	0	0	Check	X Suc
Total Spare Part Cost									44,066.09	Surveyor Total 16,107.74				
Lump Sum Discount (%)									20.00	Lump Sum Dis (%) 20				
Final Spare Part Cost									35,252.87	Final Sur Total 12,886.19				

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			FAN RADIATOR , LH	1	181.80	181.80	25.00	136.35	Replace	0	0	Check	X Svc
One Time Key In	Main			FAN SHROUD RADIATOR	1	219.30	219.30	25.00	164.48	Replace	0	0	Check	X Svc
One Time Key In	Main			MOTOR, COOLING FAN , RH	1	443.40	443.40	10.00	399.06	Replace	0	0	Check	X Svc
One Time Key In	Main			MOTOR, COOLING FAN , LH	1	543.50	543.50	10.00	489.15	Replace	0	0	Check	X Svc
One Time Key In	Main			AIR CON COMPRESSOR ASSY	1	2,887.80	2,887.80	25.00	2,165.85	Replace	0	0	Check	X Svc
One Time Key In	Main			TUBE & ACCESSORY	1	574.40	574.40	25.00	430.80	Replace	0	0	Check	X Svc
One Time Key In	Main			AIR CON CONDENSER ASSY	1	1,317.70	1,317.70	25.00	988.28	Replace	1	988.28	Replace	X CNY
One Time Key In	Main			HOSE SUB-ASSY, DISCHARGE	1	337.10	337.10	25.00	252.83	Replace	0	0	Check	X Svc
One Time Key In	Main			HOSE SUB-ASSY, SUCTION	1	541.90	541.90	25.00	406.42	Replace	0	0	Check	X Svc
One Time Key In	Main			PIPE SUB-ASSY, SUCTION	1	389.60	389.60	25.00	292.20	Replace	0	0	Check	X Svc
One Time Key In	Main			BRACKET, COOLER REFRIGERANT HOSE, NO.1	1	13.20	13.20	25.00	9.90	Replace	0	0	Check	X Svc
One Time Key In	Main			BRACKET, COOLER REFRIGERANT HOSE, NO.2	1	18.70	18.70	25.00	14.02	Replace	0	0	Check	X Svc
One Time Key In	Main			TANK, RESERVE SEALED W/O CAP	1	127.00	127.00	25.00	95.25	Replace	0	0	Check	X Svc
One Time Key In	Main			PIPE, WATER BY-PASS , NO.1	1	11.00	11.00	25.00	8.25	Replace	0	0	Check	X Svc
One Time Key In	Main			HOSE, WATER BY-PASS , NO.8	1	37.90	37.90	25.00	28.42	Replace	0	0	Check	X Svc
Total Spare Part Cost									44,066.09	Surveyor Total 16,107.74				
Lump Sum Discount (%)									20.00	Lump Sum Dis (%) 20				
Final Spare Part Cost									35,252.87	Final Sur Total 12,886.19				

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			INLET, AIR CLEANER, NO 3	1	35.30	35.30	25.00	26.47	Replace	0	0	Check	✓ X SUC
One Time Key In	Main			INLET, AIR CLEANER, NO 2	1	93.90	93.90	25.00	70.43	Replace	0	0	Check	✓ X SUC
One Time Key In	Main			INLET, AIR CLEANER, NO 1	1	130.50	130.50	25.00	97.88	Replace	0	0	Check	✓ X SUC
One Time Key In	Main			CLAMP (FOR AIR CLEANER INLET , NO.1)	1	7.10	7.10	25.00	5.32	Replace	0	0	Check	✓ X SUC
One Time Key In	Main			BRACKET, AIR CLEANER	1	26.90	26.90	25.00	20.17	Replace	0	0	Check	✓ X SUC
One Time Key In	Main			AIR CLEANER ASSY	1	956.20	956.20	25.00	717.15	Replace	1	717.15	Replace	✓ ONA
One Time Key In	Main			BATTERY	1	1,584.90	1,584.90	10.00	1,426.41	Replace	0	0	Check	✓ X SUC
One Time Key In	Main			INVERTER WATER PUMP ASSY	1	432.00	432.00	10.00	388.80	Replace	0	0	Check	✓ X SUC
One Time Key In	Main			HOSE, HV WATER PUMP OUTLET	1	29.60	29.60	25.00	22.20	Replace	0	0	Check	✓ X SUC
One Time Key In	Main			HOSE, HV WATER PUMP INLET	1	37.90	37.90	25.00	28.42	Replace	0	0	Check	✓ X SUC
One Time Key In	Main			TANK ASSY, INVERTER RESERVE	1	371.30	371.30	25.00	278.48	Replace	0	0	Check	✓ X SUC
One Time Key In	Main			HOSE, INVERTER COOLING OUTLET	1	29.60	29.60	25.00	22.20	Replace	0	0	Check	✓ X SUC
One Time Key In	Main			HOSE, INVERTER RADIATOR INLET	1	40.70	40.70	25.00	30.53	Replace	0	0	Check	✓ X SUC
One Time Key In	Main			HOSE, INVERTER COOLING INLET	1	43.10	43.10	25.00	32.33	Replace	0	0	Check	✓ X SUC
One Time Key In	Main			COOLER, MOTOR COOLING	1	249.10	249.10	10.00	224.19	Replace	0	0	Check	✓ X SUC

Total Spare Part Cost 44,066.09

Surveyor Total 16,107.74

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 35,252.87

Final Sur Total 12,886.19

BOM Type	Costing Type	Portion	Material Number	SMRT Recommendation							Surveyor Approval			
				Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			WIRE, ENGINE ROOM MAIN	1	6,138.00	6,138.00	10.00	5,524.20	Replace	0	0	Check	X SUC
One Time Key In	Main			WIRE, ENGINE, NO.3	1	260.40	260.40	10.00	234.36	Replace	0	0	Check	X SUC
One Time Key In	Main			WIRE, AIR CONDITIONER	1	445.70	445.70	10.00	401.13	Replace	0	0	Check	X SUC
One Time Key In	Main			COVER SUB-ASSY, FRONT PILLAR, UPR RH	1	96.90	96.90	25.00	72.68	Replace	0	0	Check	X SUC
One Time Key In	Main			COVER SUB-ASSY, FRONT PILLAR, UPR LH	1	96.90	96.90	25.00	72.68	Replace	0	0	Not Give	X SUC
One Time Key In	Main			FENDER SUB-ASSY, FR, RH	1	933.10	933.10	25.00	699.83	Replace	1	699.83	Replace	X CR4
One Time Key In	Main			KNUCKLE, STEERING, LH	1	555.20	555.20	25.00	416.40	Replace	0	0	Check	X SUC
One Time Key In	Main			END SET, TIE ROD, LH	1	155.90	155.90	25.00	116.93	Replace	0	0	Check	X SUC
One Time Key In	Main			LOWER ARM SUB-ASSY, FRONT LH	1	631.60	631.60	25.00	473.70	Replace	0	0	Check	X SUC
One Time Key In	Main			MIRROR ASSY, OUTER REAR VIEW, LH	1	1,283.90	1,283.90	10.00	1,155.51	Replace	0	0	Not Give	X SUC
One Time Key In	Main			COVER, OUTER MIRROR, LH	1	89.50	89.50	25.00	67.13	Replace	0	0	Not Give	X SUC
One Time Key In	Main			PANEL SUB-ASSY, FRONT DOOR RH	1	1,249.60	1,249.60	25.00	937.20	Replace	1	0	Repair	X R
One Time Key In	Main			STICKER DECAL SMRT (DOOR) RH	1	60.00	60.00	0.00	60.00	Replace	1	60.00	Replace	X NEC
One Time Key In	Main			LAMP ASSY, FOG, RH	1	910.20	910.20	10.00	819.18	Replace	0	0	Check	X SUC
One Time Key In	Main			LAMP ASSY, FOG, LH	1	910.20	910.20	10.00	819.18	Replace	1	819.18	Replace	X MIS

Total Spare Part Cost 44,066.09

Surveyor Total 16,107.74

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 35,252.87

Final Sur Total 12,886.19

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			UNIT , HEADLAMP , LH	1	2,558.90	2,558.90	10.00	2,303.01	Replace	1	2,303.01	Replace	✓ CR4
One Time Key In	Main			UNIT , HEADLAMP , RH	1	2,558.90	2,558.90	10.00	2,303.01	Replace	1	2,303.01	Replace	✓ CRA
One Time Key In	Main			COMPUTER SUB-ASSY, HEADLAMP, LH NO.1	1	486.40	486.40	10.00	437.76	Replace	1	437.76	Replace	✓ CR4
One Time Key In	Main			COMPUTER SUB-ASSY, HEADLAMP, RH NO.1	1	486.40	486.40	10.00	437.76	Replace	0	0	Check	✓ X Svc
One Time Key In	Main			HOOD SUB-ASSY	1	938.40	938.40	25.00	703.80	Replace	1	703.80	Replace	✓ CR4
One Time Key In	Main			INSULATOR, HOOD	1	393.90	393.90	25.00	295.42	Replace	1	295.42	Replace	✓ CR4
One Time Key In	Main			HINGE ASSY, HOOD, RH	1	57.00	57.00	25.00	42.75	Replace	1	42.75	Replace	✓ BT
One Time Key In	Main			HINGE ASSY, HOOD, LH	1	57.00	57.00	25.00	42.75	Replace	1	42.75	Replace	✓ BT
One Time Key In	Main			LOCK ASSY, HOOD	1	131.10	131.10	25.00	98.32	Replace	1	98.32	Replace	✓ Jun
One Time Key In	Main			SUPPORT S/A UPPER,	1	364.90	364.90	25.00	273.67	Replace	1	273.67	Replace	✓ BT
One Time Key In	Main			SUPPORT S/A RH	1	237.00	237.00	25.00	177.75	Replace	0	0	Check	✓ X Svc
One Time Key In	Main			SUPPORT S/A LH	1	237.00	237.00	25.00	177.75	Replace	0	0	Check	✓ X Svc
One Time Key In	Main			SUPPORT SUB-ASSY LOWER	1	397.40	397.40	25.00	298.05	Replace	0	0	Check	✓ X Svc
One Time Key In	Main			SUPPORT, RADIATOR UPPER RH	1	76.70	76.70	25.00	57.53	Replace	1	57.53	Replace	✓ BT
One Time Key In	Main			SUPPORT, RADIATOR UPPER LH	1	76.70	76.70	25.00	57.53	Replace	1	57.53	Replace	✓ BT

Total Spare Part Cost

44,066.09

Surveyor Total

16,107.74

Lump Sum Discount (%)

20.00

Lump Sum Dis (%)

20

Final Spare Part Cost

35,252.87

Final Sur Total

12,886.19

SMRT Recommendation										Surveyor Approval				
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			HORN ASSY, HIGH	1	112.80	112.80	25.00	84.60	Replace	0	0	Check	X SVC
One Time Key In	Main			HORN ASSY, LOW	1	112.80	112.80	25.00	84.60	Replace	0	0	Check	X SVC
One Time Key In	Main			BRACKET, HORN	2	7.80	15.60	25.00	11.70	Replace	0	0	Check	X SVC
One Time Key In	Main			HORN ASSY, SECURITY	1	112.80	112.80	25.00	84.60	Replace	0	0	Check	X SVC
One Time Key In	Main			WIPER WASHER INLET	1	55.40	55.40	25.00	41.55	Replace	0	0	Check	X SVC
One Time Key In	Main			WIPER WASHER JAR	1	183.60	183.60	25.00	137.70	Replace	0	0	Check	X SVC
One Time Key In	Main			GUIDE, RADIATOR AIR,	1	93.90	93.90	25.00	70.43	Replace	0	0	Check	X SVC
One Time Key In	Main			SEAL, RADIATOR GRILLE	2	40.70	81.40	25.00	61.05	Replace	0	0	Check	X SVC
One Time Key In	Main			BRACE, HOOD LOCK SUPPORT	1	76.20	76.20	25.00	57.15	Replace	1	57.15	Replace	BT
One Time Key In	Main			EMBLEM, SIDE PANEL (HYBRID)	1	52.90	52.90	25.00	39.67	Replace	1	39.67	Replace	INAC
One Time Key In	Main			LINER, FR FENDER, RH	1	198.40	198.40	25.00	148.80	Replace	0	0	Check	X SVC
One Time Key In	Main			PAD, FR WHEEL RH	1	57.70	57.70	25.00	43.28	Replace	0	0	Not Give	X SVC
One Time Key In	Main			APRON SUB-ASSY, FRONT FENDER , RH	1	944.20	944.20	25.00	708.15	Replace	1	0	Repair	X R
One Time Key In	Main			WHEEL, DISC FRONT	1	1,555.10	1,555.10	25.00	1,166.32	Replace	0	0	Not Give	X R
One Time Key In	Main			HUB & BEARING ASSY, RH & LH	1	554.20	554.20	25.00	415.65	Replace	0	0	Not Give	X R

Total Spare Part Cost 44,066.09

Surveyor Total 16,107.74

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 35,252.87

Final Sur Total 12,886.19

SMRT Recommendation											Surveyor Approval		
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace Remarks
One Time Key In	Main			TYRE	1	126.74	126.74	0.00	126.74	Replace	0	0	Not Give ☒ SUC
One Time Key In	Main			PILLAR, FRONT BODY, RH	1	339.40	339.40	25.00	254.55	Replace	0	0	Not Give ☒ SUC
One Time Key In	Main			MIRROR ASSY, OUTER REAR VIEW, RH	1	1,373.50	1,373.50	10.00	1,236.15	Replace	0	0	Not Give ☒ SUC
One Time Key In	Main			COVER, OUTER MIRROR, RH	1	89.50	89.50	25.00	67.13	Replace	0	0	Not Give ☒ SUC
One Time Key In	Main			FENDER SUB-ASSY, FR, LH	1	933.10	933.10	25.00	699.83	Replace	1	699.83	Replace ☒ CRK
One Time Key In	Main			EMBLEM, SIDE PANEL (HYBRID) LH	1	52.90	52.90	25.00	39.67	Replace	1	39.68 39.67	Replace ☒ NAC
One Time Key In	Main			LINER, FR FENDER, LH	1	194.30	194.30	25.00	145.73	Replace	1	145.73	Replace ☒ CRH
One Time Key In	Main			PAD, FR WHEEL LH	1	57.70	57.70	25.00	43.28	Replace	0	0	Not Give ☒ SUC
One Time Key In	Main			SEAL SUB-ASSY, LH	1	50.20	50.20	25.00	37.65	Replace	0	0	Not Give ☒ SUC
One Time Key In	Main			PROTECTOR, FR FENDER LH	1	90.40	90.40	25.00	67.80	Replace	0	0	Not Give ☒ SUC
One Time Key In	Main			APRON SUB-ASSY, FRONT FENDER, LH	1	944.20	944.20	25.00	708.15	Replace	1	0	Repair ☒ R
One Time Key In	Main			WHEEL, DISC FRONT	1	1,555.10	1,555.10	25.00	1,166.32	Replace	0	0	Not Give ☒ SUC
One Time Key In	Main			TYRE	1	126.74	126.74	0.00	126.74	Replace	0	0	Not Give ☒ SUC
One Time Key In	Main			HUB & BEARING ASSY, RH & LH	1	554.20	554.20	25.00	415.65	Replace	0	0	Not Give ☒ SUC
One Time Key In	Main			PILLAR, FRONT BODY, LH	1	339.40	339.40	25.00	254.55	Replace	0	0	Not Give ☒ SUC
Total Spare Part Cost									44,066.09	Surveyor Total		16,107.74	
Lump Sum Discount (%)									20.00	Lump Sum Dis (%)		20	
Final Spare Part Cost									35,252.87	Final Sur Total		12,886.19	

Labour's Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPAIR FRONT PORTION	1,352.00	1,000	
Total:			1,352.00	1,000.00	

Spray Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPSRAY FRONT BUMPER	378.00	200	
2	Main	TO RESPRAY FRONT BUMPER LOWER GRILLE	180.00	0	
3	Main	TO REPSRAY FRONT HOOD	378.00	200	
4	Main	TO RESPRAY FRONT SUPPORT PANEL	180.00	100	
5	Main	TO RESPRAY FRONT FENDER RH	378.00	200	
6	Main	TO RESPRAY APRON PANEL RH	180.00	0	
7	Main	TO RESPRAY FRONT FENDER LH	378.00	200	
8	Main	TO RESPRAY APRON PANEL LH	180.00	80	
9	Main	TO RESPRAY RIM	360.00	0	
10	Main	TO RESPRAY FRONT DOOR RH	378.00	200	
11	Main	TO REPRAY FRONT PILLAR RH	180.00	0	
12	Main	TO RESPRAY FRONT PILLAR LH	180.00	0	
13	Main	RESPRAY MIRROR COVER LH	180.00	0	
14	Main	RESPRAY MIRROR COVER RH	180.00	0	
15	Main	TO RESPRAY ROCKER PANEL MOULDING	180.00	0	
16	Main	TO RESPRAY REAR BUMPER	378.00	0	
Total:			4,248.00	1,180.00	

Other Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
-------	--------------	-----------	----------------------------	----------------------------	---------

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	60	
2	Main	TO REMOVE AND REFIX VIEW MIRROR	120.00	0	
3	Main	TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	120.00	0	
4	Main	TO REMOVE / REFIT WINDSCREEN	250.00	100	
5	Main	TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	450.00	450.00	
6	Main	TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	30	
7	Main	TO REPLACE SUNDRY PARTS	100.00	0	
8	Main	TO CHECK WIRING AND SYSTEM FUNCTION	80.00	20	
9	Main	TO WASH AND VACUUM	60.00	0	
10	Main	TOWING CHARGE	56.00	0	
11	Main	TO REMOVE AND REFIT ENGINE WIRE ROOM	200.00	0	
12	Main	TO CHECK & RESET SYSTEM FUNCTION	80.00	0	
Total:			1,736.00	660.00	

Summary

	Estimator Assesment(\$)	Surveyor Assesment(\$)
Total Spare Part Detail	35,252.87	12,886.19
Total Labour Cost	1,352.00	1,000.00
Total Spray Painting	4,248.00	1,180.00
Other	1,736.00	660.00
Overall Total	42,588.87	15,726.19
Lump Sum Repair Option	☐	☒
Lump Sum Total	42,600.00	15,750.00
Surveyor Approved Amount		15,750.00
No of Repair Days*	12	7 <i>7dys</i>
Remarks		L/S, after paint photo.

Estimator Assessment(\$)

Surveyor Assessment(\$)

Surveyor Name

Sun Pin (LKK)

Signature



Save

Clear

Survey Date

04/01/2021

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed **and**
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	369K
Vehicle Details	
Vehicle No.:	SHF3R
Vehicle to be Exported:	No
Intended Deregistration Date:	04 Jan 2021
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS HYBRID 1.8 CVT
Primary Colour:	Maroon
Manufacturing Year:	2017
Engine No.:	2ZRS102243
Chassis No.:	JTDKB3FU903573735
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$29,007.00
Original Registration Date:	03 Nov 2017
First Registration Date:	03 Nov 2017
Transfer Count:	0
Actual ARF Paid:	\$5,000.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	02 Nov 2025
PARF Rebate Amount:	\$3,750.00
Intended COE Rebate Details	
COE Expiry Date:	02 Nov 2025
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$33,596.00
COE Rebate Amount:	\$20,275.00
Total Rebate Amount:	\$24,025.00
Message	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 04 Jan 2021

OK